Spark® ATEX Noise Dosimeters and Blaze® Software

Technical Reference Manual

FOR NOISE DOSIMETERS
703-ATEX, 703+ATEX, 705-ATEX,
705+ATEX, 706-ATEX, and 706RC-ATEX

LARSON DAVIS
A PCB PIEZOTRONICS DIV.

Larson Davis

Spark® 706-ATEX

Personal Noise Dosimeter

Technical Reference Manual

Copyright

Copyright 2006, 2007, 2008 and 2009 by PCB Piezotronics, Inc. This manual is copyrighted, with all rights reserved. The manual may not be copied in whole or in part for any use without prior written consent of PCB Piezotronics, Inc.

Disclaimer

The following paragraph does not apply in any state or country where such statements are not agreeable with local law:

Even though PCB Piezotronics, Inc. has reviewed its documentation, PCB Piezotronics, Inc. makes no warranty or representation, either expressed or implied, with respect to this instrument and documentation, its quality, performance, merchantability, or fitness for a particular purpose. This documentation is subject to change without notice, and should not be construed as a commitment or representation by PCB Piezotronics, Inc.

This publication may contain inaccuracies or typographical errors. PCB Piezotronics, Inc. will periodically update the material for inclusion in new editions. Changes and improvements to the information described in this manual may be made at any time.

Record of Serial Number and Purchase Date

Serial Number: _____ Purchase Date: _____

Recycling

PCB Piezotronics, Inc. is an environmentally friendly organization and encourages our customers to be environmentally conscious. When this product reaches its end of life, please recycle the product through a local recycling center or return the product to:

PCB Piezotronics, Inc.
Attn: Recycling Coordinator
1681 West 820 North
Provo, Utah, USA 84601-1341

where it will be accepted for disposal



Table of Contents

Chapter 1 Introduction 1-1

About This Manual 1-1
About This Chapter....1-2
Formatting Conventions 1-2
Spark®-ATEX Family Features 1-3
Spark® 706-ATEX RC Features 1-3
Spark®706-ATEX Features....1-4
Sparkâ 703+ATEX/705+ATEX Features 1-6
Spark® 703-ATEX/705-ATEX Features....1-7
Spark® 704-ATEX Features....1-8
Spark® -ATEX Instruments 1-9
Getting Started 1-10
Unpacking and Inspection....1-10
Sparkâ-ATEX dosimeter Standard and Optional Accessories....1-11
Standard Accessories....1-11
Optional Accessories....1-11
Assembling the Sparkâ-ATEX Dosimeter....1-12
Installing Batteries in the 706RC-ATEX, 706-ATEX, 704-ATEX, 703+ATEX, and 703-ATEX....1-14
Installing Batteries in the 705-ATEX/705+ATEX 1-17
Using Rechargeable Batteries 1-18
Connecting the dosimeter to a PC....1-19
Environmental Considerations....1-20
Data Retention....1-21
Installing the Blaze® Software 1-21
703-ATEX/703+ATEX/705-ATEX/705+ATEX Front Panel Indicators....1-27

Chapter 2 Using Larson Davis Blaze® Software 2-1

Starting Blaze® Software 2-1
Blaze® Main Window 2-1
Communication Methods in the Blaze® software....2-5
Direct Port Access....2-5
Selecting the Communication Method....2-5
Selecting the Spark®-ATEX Instrument 2-5
Select the IR Connection Type....2-6
Setting the Spark®-ATEX instrument clock 2-8
Synchronize Date and Time with Computer....2-9

Set Date and Time Manually....2-9
Calibrating the Spark®-ATEX instrument....2-10
Possible Dialog Boxes....2-13
Level Greater than Cal High Range....2-13
Current Level Greatly Exceeds the Calibration High Limit....2-13
Calibration Information....2-13
Calibration Offset....2-14
Calibration History....2-14
Printing Calibration Data....2-15
Setting the Spark® -ATEX instrument to Collect Data....2-16
General Settings....2-16
Modifying the General Settings....2-18
RMS Weighting....2-24
Peak Weighting....2-24
Detector Setting....2-24
Sample Interval....2-24
Gain....2-25
Battery Type....2-25
Dose....2-25
Dose Default Values....2-25
Exchange Rate....2-25
Threshold Level (dB)....2-26
Criterion Level (dB)....2-26
Criterion Duration (hrs.)....2-26
S.E.A. Metric....2-26
User Defined Configurations....2-28
Saving the Instrument Settings....2-30
Setting the Auto-Timer....2-30
Timer Off....2-32
Block Timer....2-32
Repeat Once Daily....2-34
Repeat Twice Daily....2-34
Set Timer....2-35
Instrument Settings....2-35
Default Settings....2-35
Save as Default....2-35
Manual Control of the Spark®-ATEX instrument....2-35
Setting the Lock Using Blaze®....2-40

Unlocking the Sparkâ-ATEX Instrument Using Blaze® 2-41
Downloading Data from the Spark®-ATEX 2-43
Adding General Information During Download 2-44
Setting a Reference Line 2-45
Measurement Summary 2-47
Selecting Display of Dose Data 2-48
Viewing Other Data Records 2-50
General Information 2-52
Recalculating the Results 2-53
Modifying The Dose Parameters 2-53
Setting a Reference Line in a Time History Graph 2-55
Merging Records 2-56
Modifying the Time History Interval 2-59
Averaging Time Histories between Different Files 2-61
Time History Graph 2-62
Zooming 2-65
Zoom Out 2-67
Editing the Time History 2-68
Setting a Reference Line 2-69
Excluding Sections from the Record's Time History 2-70
Adding/Subtracting dB Values from Selected Sections 2-73
Add Note 2-78
Graph Records from Different Files 2-80
Adding Notes 2-83
Show Graph in Actual Time 2-85
The Statistics Graph 2-85
Ln Data 2-92
Time History Display 2-92
Summary Report Display 2-93
Ln Data Export 2-94
Printing Reports 2-95
Advanced Print Options. 2-99
Exporting Record Data 2-101
Searching the Blaze® Database 2-105
Troubleshooting Download Problems 2-109
Temporary Workaround 2-109

Chapter 3 Manual Operation of the 706-ATEX/706RC-ATEX 3-1

Spark® 706-ATEX/706RC-ATEX – Quick Reference 3-1

Overview....3-1
User Interface....3-1
Keypad Functions....3-2
706-ATEX/706RC-ATEX Icon Descriptions....3-3
Battery....3-3
Mail Icon....3-3
Communication....3-3
Run Indicator....3-4
Overload....3-4
Run-Time Clock....3-4
Powering up the 706-ATEX/706RC-ATEX....3-4
706-ATEX/706RC-ATEX Displays....3-5
Tools....3-9
Remote Control of Remote unit....3-10
(706RC-ATEX ONLY)....3-10
Calibration of the 706-ATEX/706RC-ATEX....3-11
Using the Lock Feature....3-14
Activating the Lock....3-14
Deactivating the Lock....3-15
Setting up the 706-ATEX/706RC-ATEX....3-16
Setting the 706-ATEX Date and Time....3-16
Tour Tools Menu....3-18
Changing the Gain....3-19
Changing the Frequency Weighting....3-20
Changing the Peak Weighting....3-21
Changing the Detector....3-22
Changing the Time History Period....3-23
Changing the Dose Measurement Settings....3-24
Changing the Threshold Level....3-24
Changing the Exchange Rate....3-25
Changing the Criterion Time....3-25
Changing the Criterion Level....3-26
Memory Settings....3-27
Memory Time....3-27
Memory Used....3-27
Memory Free....3-28
Number of Records Stored....3-28
Installed Bytes of Memory....3-28

Upload (706RC-ATEX only) 3-28
Clear All 3-28
About 3-29
The Power Menu 3-30
Auto-Off 3-31
Timers 3-32
Display 3-33

Chapter 4 706RC-ATEX Operation 4-1

Introduction 4-1
Menu Structure 4-1
Controlling a Remote Device 4-2
Inversion Mode 4-3
Record Transfer 4-5

Appendix A Spark® 706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX Specifications A-1

General Characteristics A-1
Type Precision A-1
Reference Direction A-1
Typical Measurement Ranges A-1
Calibration Reference Level A-2
Frequency Weightings A-2
Detector Time Weightings A-3
Operating Temperature Range A-3
Effects of Humidity A-3
Storage Temperature A-3
Effects of Magnetic Fields A-3
Effects of Strong Acoustic Fields A-4
Compliance with Electromagnetic Compatibility Standards A-4
Effects of Mechanical Vibration A-5
Microphone Extension Cables A-6
Calibration Procedure A-6
Reference Frequency A-6
Stabilization Time A-6
Microphone Electrical Impedance A-6
Functions Measured A-6
Data Storage A-7
Data Communications A-7
Digital Display A-8

Digital Display Resolution A-8
Real-time Clock/Calendar A-8
Run-time Clock A-8
Standards Met A-8
Power Supply A-8
Dimensions/Weight (with Microphone, Preamplifier, and Battery, and Case) A-9
Approved Battery Types A-9
Larson Davis Spark® Dosimeters Run-time Specifications A-9

Appendix B Frequently Asked Questions B-1

Measurements and Interfaces B-1
Connecting the IR Interface B-2
Identifying the COM Port B-2
Connecting to a Spark® Dosimeter in Blaze® B-3

Appendix C Glossary C-1

A-weight C-1
Calibration C-1
Calibration Check C-1
Criterion Duration C-1
Criterion Level C-1
C-weight C-1
Daily Personal Noise Exposure (LEP,d) C-1
Detector Rate C-2
Dose C-2
Exchange Rate C-2
Equivalent-Continuous Sound Level or Leq C-2
Equivalent Time Weighted Average or TWA(x) C-3
Frequency & Exponential-Time Weighted Sound Level or Lwt C-4
Frequency Weighting C-5
LEP,d C-5
Lmax C-5
Lmin C-5
Ln C-6
Noise Dose C-6
Peak C-7
Peak Frequency Weighting C-7
Projected Noise Dose C-8

Projected Sound Exposure C-8
Sound Exposure (SE) C-9
Threshold Level C-9
Time Weighted Average (TWA) C-9

Appendix D Communications Troubleshooting D-1

The First Step D-1
Still having problems? D-1
Additional IR Connection Solutions D-2
General Information D-2
Direct Serial Connection D-2
USB Connection D-3
Blaze® Check for COM Port D-4
Blaze® Connection Wizard for IR Communications D-4

Appendix E Sample Reports E-1

Summary Report E-1
Time History Report E-2
Statistics Report E-3
Measurement Record Summary Report E-4
Time History Graph Printout E-5
Statistics Graph Printout E-6

Appendix F ATEX Intrinsic Safety Approvals F-1

Back Panel Labels F-2
703-ATEX, 703+ATEX, 704-ATEX, 706-ATEX, 706RC-ATEX F-2
705-ATEX F-3
705+ATEX F-4

CHAPTER

1 Introduction

Thank you for purchasing the Spark®−ATEX/Blaze® noise dosimetry system. The Spark®−ATEX family instruments are among the smallest, most powerful noise dosimeters available for work place noise measurement. Spark®−ATEX's rugged construction will provide you with years of trouble-free operation.

The 706-ATEX and 706RC-ATEX are full-featured dosimeters and sound level meters that can operate independently under manual control (via keypad). The 703-ATEX, 703+ATEX, 705-ATEX and 705+ATEX are similar in operation except that they have no keypad or display, making them virtually tamper proof. Spark® 706RC-ATEX, 706-ATEX, 705+ATEX, 705-ATEX, 703+ATEX and 703-ATEX work integrally with the Blaze® software.

Blaze® provides a simple way to setup the Spark®−ATEX instruments, download and analyze the measured data. Blaze® software runs on Windows® NT SP4, Windows XP® and Windows Vista®.

We invite you to read this manual to achieve the best results from your Spark®−ATEX instrument and Blaze® software.

About This Manual

This manual has 4 chapters and 6 appendices covering the following topics:

- Chapter 1 - Introduction: user manual overview and an introduction to the functionality and measurement capabilities of the dosimeter.
- Chapter 2 - Using Blaze®: instructions for using the Blaze® software, connecting to the dosimeter, setting up the dosimeter to take measurements, downloading data from the dosimeter to a file, and printing reports.

- Chapter 3 - Using the Spark® 706RC-ATEX and 706-ATEX without Blaze®. This chapter reviews manual operation on the 706RC-ATEX and 706-ATEX via its built in keypad and on-board user interface.
- Chapter 4 - Using the 706RC-ATEX to control and upload other Spark®–ATEX family instruments.
- Appendix A – Dosimeter specifications
- Appendix B – Frequently Asked Questions
- Appendix C – Glossary
- Appendix D – IR Communications Troubleshooting
- Appendix E – Sample Reports
- Appendix F – ATEX Intrinsic Safe Approvals

About This Chapter

Specifically, this introductory chapter covers the following topics:

- Formatting Conventions: explanation of the fonts and other formatting conventions used in this manual
- Getting Started: instructions for unpacking, inspecting, and initially assembling the dosimeter.

Formatting Conventions

This manual uses the following formatting conventions:

In step-by-step directions, the process (what you do) is shown in the right column, and the rationale (why you do it) with other cautions and comments shown in the left column. Especially important information is shown in italics. Where it is necessary to distinguish the operation of the different Spark®–ATEX family instruments, it will be noted on the left column and described on the right.

Spark®–ATEX Family Features

The Larson Davis Spark®–ATEX family of products meet all national and international requirements for dosimeter standards. The family is segmented into 7 instruments. The 703-ATEX, 703+ATEX, 704-ATEX, 705-ATEX, 705+ATEX, 706-ATEX, and 706RC-ATEX. Each instrument has unique features that will fit the needs of a wide variety of users.

Spark® 706-ATEX RC Features

- The 706RC-ATEX has the ability to connect to the 703+ATEX, 705+ATEX, 706-ATEX and other 706RC-ATEX units. The Remote Control functionality allows manual setup and control of the remote instrument. The 706RC-ATEX can also download and store data from several other Spark®–ATEX units.
- Stand Alone capability. In addition to the Remote Control functions, the 706RC-ATEX is a fully functional Noise Dosimeter, having all the functionality of a standard 706-ATEX instrument.
- Measurement range of 40 dB to 143 dB (rms), in four ranges.
- Peak detector range of 80 to 146 in four ranges.
- Leq, Max, and Peak levels stored at 1, 5, 15, 30, or 60 second time intervals. 4 user defined time weighted average levels or calculations are also stored, as well as Lmin.
- Ln statistics (1 – 99 in 0.5 dB resolution) stored at 5 minute intervals
- Automatic detection of Microphone Failure. Spark®–ATEX instruments will detect and display a warning message if the microphone is disconnected. (Microphone failure is also recorded in the status byte of each time history record)
- 4 Megabytes of nonvolatile memory.

- Infrared interface providing transfer rates to the PC at up to 115,000 bits per second.
- User-programmed daily start/stop times.
- PC-based setup, dose calculation, report generation, and graphics.
- Manual setup of instrument functions. (Timers can only be set from the Blaze® software.)
- Slow or Fast rms detection using A or C weighting.
- Calculation of noise exposure in percentage dose, projected dose, SE (Pa^2 hours), and Pasques (Pa^2 seconds) units using a variety of exchange rates, threshold, and criteria values.
- Continuous display of SPL level. The instrument will continue to display the current SPL level, even when the instrument is not running. During this time the instrument will not be logging data, the value is only being displayed on the screen.
- Noise Floor typical of 35 dBA (A-weighted) Slow/Fast (using 30 dB gain).
- Frequency Response of A and C weighting meets ANSI and IEC Standards.
- Detector accuracy: True RMS; less than 0.7 dB error from 40 to 143 dB.
- Two standard AA internal alkaline batteries provide greater than 100 hours of continuous battery life.

Spark®706-ATEX Features

- The 706-ATEX is a fully functional Noise Dosimeter.
- Measurement range of 40 dB to 143 dB (rms), in four ranges.
- Peak detector range of 80 to 146 in four ranges.
- Leq, Max, and Peak levels stored at 1, 5, 15, 30, or 60 second time intervals. 4 user defined time weighted average levels or calculations are also stored, as well as Lmin.

- Ln statistics (1 – 99 in 0.5 dB resolution) stored at 5 minute intervals.
- Automatic detection of Microphone Failure. Spark®–ATEX instruments will detect and display a warning message if the microphone is disconnected. (Microphone failure is also recorded in the status byte of each time history record).
- 4 Megabyte of nonvolatile memory.
- Infrared interface providing transfer rates to the PC at up to 115,000 bits per second.
- User-programmed daily start/stop times.
- PC-based setup, dose calculation, report generation, and graphics.
- Manual setup of instrument functions. (Timers can only be set from the Blaze® software.)
- Slow or Fast rms detection using A or C weighting.
- Calculation of noise exposure in percentage dose, projected dose, SE (Pa^2 hours), and Pasques (Pa^2 seconds) units using a variety of exchange rates, threshold, and criteria values.
- Continuous display of SPL level. The instrument will continue to display the current SPL level, even when the instrument is not running. During this time the instrument will not be logging data, the value is only being displayed on the screen.
- Noise Floor (typical) of 35 dBA (A-weighted) Slow/Fast (using 30 dB gain).
- Frequency Response of A and C weighting meets ANSI and IEC Standards.
- Detector accuracy: True RMS; less than 0.7 dB error from 40 to 143 dB.
- Two standard AA internal alkaline batteries provide greater than 100 hours of continuous battery life.

Spark® 703+ATEX/705+ATEX Features

NOTE: The 703+ATEX and 705+ATEX are identical in operation and features. The 705+ATEX offers an extruded metal housing and runs on a single AA battery. The 703+ATEX offers a tough but lightweight housing and runs on two AA batteries.

- Maximum security with full functionality in an extremely durable case. Faceless instrument provides indicators on face for Run Status and Battery life.
- Measurement range of 40 dB to 143 dB (rms), in four ranges.
- Peak detector range of 80 to 146 in four ranges.
- Leq, Max, and Peak levels stored at 1, 5, 15, 30, or 60 second time intervals. 4 user defined time weighted average levels or calculations are also stored, as well as Lmin.
- Ln statistics (1 – 99 in 0.5 dB resolution) stored at 5 minute intervals.
- Automatic detection of Microphone Failure. Spark®–ATEX instruments will detect and display a warning message if the microphone is disconnected. (Microphone failure is also recorded in the status byte of each time history record).
- 4 Megabyte of nonvolatile memory.
- Infrared interface providing transfer rates to the PC at up to 115,000 bits per second.
- User-programmed daily start/stop times.
- PC-based setup, dose calculation, report generation, and graphics.
- Manual setup possible with the 706RC-ATEX.
- Slow or Fast rms detection using A or C weighting.
- Calculation of noise exposure in percentage dose, projected dose, SE (Pa^2 hours), and Pasques (Pa^2 seconds) units using a variety of exchange rates, threshold, and criteria values.
- Noise Floor (typical) of 35 dBA (A-weighted) Slow/Fast (using 30 dB gain).
- Frequency Response of A and C weighting meets ANSI and IEC standards.

- Detector accuracy: True RMS; less than 0.7 dB error from 40 to 143 dB.
- (703+ATEX only) Two standard AA internal alkaline batteries provide greater than 100 hours of continuous battery life.
- (705+ATEX only) One standard AA internal alkaline battery provides greater than 35 hours of continuous battery life.

Spark® 703-ATEX/705-ATEX Features

NOTE: The 703-ATEX and 705-ATEX are identical in operation and features. The 705-ATEX offers an extruded metal housing and runs on a single AA battery. The 703-ATEX offers a tough but lightweight housing and runs on two AA batteries.

- Maximum security with full functionality in an extremely durable case. Faceless instrument provides indicators on face for Run Status and Battery life.
- Measurement range of 40 dB to 143 dB (rms), in four ranges.
- Peak detector range of 80 to 146 in four ranges.
- Leq, Max, and Peak levels stored at 1, 5, 15, 30, or 60 second time intervals. 4 user defined time weighted average levels or calculations are also stored, as well as Lmin.
- Ln statistics (1 – 99 in 0.5 dB resolution) stored at 5 minute intervals.
- Automatic detection of Microphone Failure. Spark®–ATEX® instruments will detect and display a warning message if the microphone is disconnected. (Microphone failure is also recorded in the status byte of each time history record).
- 4 Megabyte of nonvolatile memory.
- Infrared interface providing transfer rates to the PC at up to 115,000 bits per second.
- User-programmed daily start/stop times.
- PC-based setup, dose calculation, report generation, and graphics.
- Slow or Fast rms detection using A or C weighting.

- Calculation of noise exposure in percentage dose, projected dose, SE (Pa^2 hours), and Pasques (Pa^2 seconds) units using a variety of exchange rates, threshold, and criteria values.
- Noise Floor (typical) of 35 dBA (A-weighted) Slow/Fast (using 30 dB gain).
- Frequency Response of A and C weighting meets ANSI and IEC standards.
- Detector accuracy: True RMS; less than 0.7 dB error from 40 to 143 dB.
- (705-ATEX only) One standard AA internal alkaline battery provides greater than 35 hours of continuous battery life.
- (703-ATEX only) Two standard AA internal alkaline batteries provide greater than 100 hours of continuous battery life.
- Limited to Summary Report from the Blaze software.

Spark® 704-ATEX Features

- Measurement range of 40 dB to 143 dB (rms), in four ranges.
- Peak detector range of 80 to 146 in four ranges.
- Leq, Max, Min, and Peak levels.
- Manual Start and Stop functions.
- Manual setup from the instrument front panel, with control of weighting, dose parameters and start and stop functions.
- Slow or Fast rms detection using A or C weighting.
- Automatic detection of Microphone Failure. Spark®–ATEX instruments will detect and display a warning message if the microphone is disconnected. (Microphone failure is also recorded in the status byte of each time history record).

- Calculation of noise exposure in percentage dose, projected dose, SE (Pa^2 hours), and Pasques (Pa^2 seconds) units using a variety of exchange rates, threshold, and criteria values.
- Noise Floor (typical) of 35 dBA (A-weighted) Slow/Fast (using 30 dB gain).
- Frequency Response of A and C weighting meets ANSI and IEC standards.
- Detector accuracy: True RMS; less than 0.7 dB error from 40 to 143 dB.
- Two standard AA internal alkaline batteries provide greater than 100 hours of continuous battery life.

Spark® –ATEX Instruments

NOTE: The 706-ATEX, 705+ATEX and 703+ATEX can also be controlled by the 706RC-ATEX.

The 706RC-ATEX and 706-ATEX are fully functional dosimeters that are controlled either independently (via their own keypads and display) or by the Blaze® software. The 705+ATEX, 705-ATEX, 703+ATEX and 703-ATEX are programmed using the Blaze® software only, since they maintain a tamperproof configuration with no keypad or display.

Figure 1-1 ***706-ATEX, 705+ATEX, and 703+ATEX***

The Spark®−ATEX family instruments include a 3/8 in. (10.6mm) diameter microphone.

Getting Started

This section outlines the steps to follow after unpacking the dosimeter. The following topics are covered:

- Unpacking and Inspection
- Assembling the dosimeter
- Standard and Optional Accessories
- Installing the Batteries
- Connecting the dosimeter to a PC
- Environmental Considerations
- Data Retention

You will then be ready to use the dosimeter for actual measurements (as described later in Chapter 2 of this manual).

Unpacking and Inspection

Your Spark®−ATEX® dosimeter has been shipped in protective packaging. Please verify the package contents with the list Accessories and Optional Equipment later in this chapter, and retain the product packaging for safe shipment at a future date. Report any damage or shortage immediately to PCB Piezotronics, Inc. at (888)-258-3222. If you have not already done so, please record your instrument's serial number (located on the label on the back of the dosimeter) and the purchase date at the beginning of this manual (see the copyright page). You may be asked to give this information in any future communications with Larson Davis.

The following system diagram (Figure 1-2) illustrates the standard configuration of the Spark® 706-ATEX/706RC-ATEX. The Spark® 704-ATEX is identical except that it has

no IR Port. The Spark® 703-ATEX and 703+ATEX are identical except they have no keypad or screen.

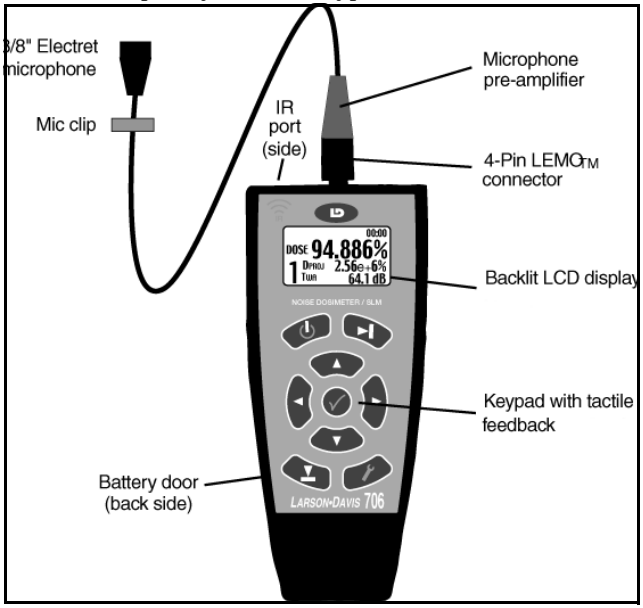

Figure 1-2 ***Spark® 706-ATEX***

Spark®–ATEX dosimeter Standard and Optional Accessories

Your Spark®–ATEX dosimeter was delivered with a number of additional items. Please make sure that you have received the following equipment with your dosimeter:

- Spark®–ATEX dosimeter

Standard Accessories

- Detachable 3/8 in. (10.6 mm) microphone/preamp/and integrated 3 ft. (1 m) cable (MPR001)
- AA alkaline batteries
- Windscreen
- CCS018 nylon pouch (706RC-ATEX, 706-ATEX, 704-ATEX, 703+ATEX, and 703-ATEX only.)
- Microphone clip

Optional Accessories

- Blaze® software
- CAL150 Type 2 microphone calibrator

- DVX008 external IR (infrared) interface module
- DVX008A IR (infrared) USB-to-DBM9 serial adapter
- DVX009 IR (infrared) USB interface module
- MPR002 3" cylindrical mast type preamp for use as SLM

If any of these items are missing, please contact your Larson Davis sales representative, or contact Larson Davis directly.

Assembling the Spark®–ATEX Dosimeter

Remove the microphone and preamplifier from its protective packaging. The windscreen and microphone clip should already be attached.

Figure 1-3 ***Integrated microphone and preamplifier (MPR001) shown on left. 3" cylindrical mast type preamp for use as SLM (MPR002) shown on right***

Step 1 Align the red dots of the microphone connector plug (on cable) and the microphone connector receptacle (on the dosimeter).

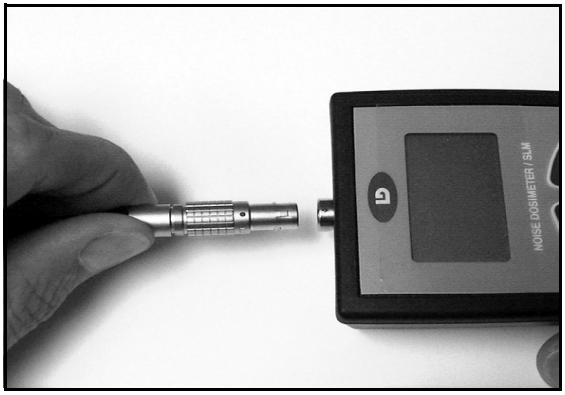

Figure 1-4 ***Aligning the microphone connectors***

Step 2 Carefully push the microphone connector plug into the connector receptacle on the dosimeter.

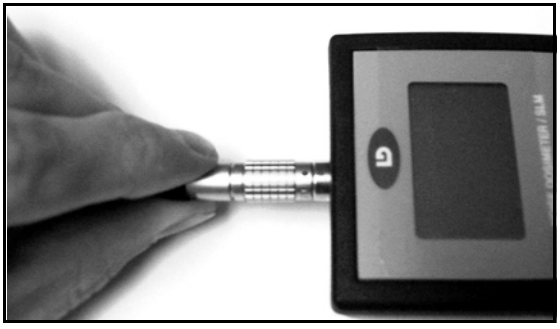

Figure 1-5 ***Connecting the microphone***

Step 3 If you wish to use the protective carrying case (recommended), slide the dosimeter into the conforming pouch and secure the Velcro® strap.

Figure 1-6 ***The CCS027 protective case***

Important*: When removing the dosimeter from the pouch, do not pull microphone connector. This can cause damage. Instead, push the dosimeter at the bottom of the pouch while firmly holding the sides.*

Installing Batteries in the 706RC-ATEX, 706-ATEX, 704-ATEX, 703+ATEX, and 703-ATEX

NOTE: Only AA type batteries can be used in the Spark®–ATEX instruments.

To insert the two AA batteries in the dosimeter, remove the battery cover on the back of the instrument.

WARNING! Do not replace the batteries in an explosive environment.

Step 1 Move the sliding tab towards the bottom (away from the microphone end) of the dosimeter.

Figure 1-7 ***Moving the battery door sliding tab***

Step 2 Grasp the sides of the battery door (towards the top of the dosimeter) and pull outward to remove.

Figure 1-8 ***Opening the battery door***

NOTE: When installing batteries into a 703-ATEX or 703+ATEX, 705-ATEX, or 705+ATEX, both indicator LED's should illuminate when the batteries are first installed for approximately 5 seconds. This time can be extended by up to 60 seconds if there is data in the units memory. See section titled "703-ATEX/ 703+ATEX/705-ATEX/705+ATEX Front Panel Indicators" for further details on the 703-ATEX,703+ATEX, 705-ATEX, and 705+ATEX indicators.

Note: When installing batteries into the 706-ATEX or 706RC-ATEX, the instrument startup screen will be displayed. During this time the instrument is checking previously stored data in memory. Depending on how much data is already in memory, this startup screen may be displayed from 3 to 90 seconds."

Step 3 If there are batteries in the unit, carefully remove and replace them with new AA batteries. Replace the door by first inserting the bottom side of the battery cover in the dosimeter case.

Figure 1-9 ***Re-inserting the battery door***

Step 4 Move the top side of the battery cover flush against the dosimeter case. Then move the sliding tab to its original "up" position.

Figure 1-10 ***Locking the battery door***

Internal battery life varies, depending on the operating mode. Operating continuously, the dosimeter will last

beyond 100 hours. Using the backlight, or communicating via the IR port will reduce the battery life.

Installing Batteries in the 705-ATEX/705+ATEX

NOTE: Only AA type batteries can be used in the Spark® –ATEX instruments.

To insert the AA battery in the 705-ATEX dosimeter, remove the battery cover on the bottom of the instrument.

WARNING! Do not replace the batteries in an explosive environment.

Step 1 To remove the battery door, unscrew the two screws at the bottom of the 705-ATEX using a flat-bladed screwdriver.

Figure 1-11 ***Removing the battery door***

Step 2 Remove the battery door to expose the battery compartment.

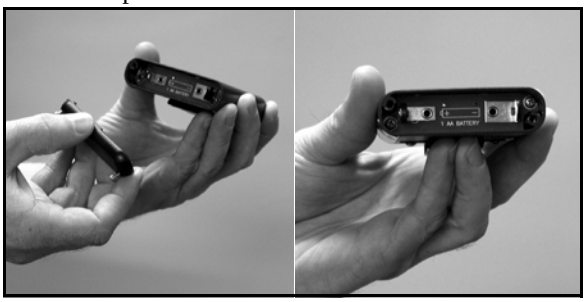

Figure 1-12 ***Battery compartment***

Step 3 If there is a battery in the unit, carefully remove and replace with a new AA battery.

Figure 1-13 ***Replacing the battery***

Step 4 Replace the door by aligning the battery door with the bottom of the 705-ATEX. Re-tighten the screws to secure the battery door in place using a screwdriver.

Figure 1-14 ***Replacing the battery door***

Using Rechargeable Batteries

NOTE: Only AA type batteries can be used in the Spark®–ATEX instruments.

Note: The instrument should not be operated in an explosive environment if using any batteries other than those approved and listed in Appendix F

The 706RC-ATEX, 706-ATEX, 704-ATEX, 703+ATEX, 703-ATEX dosimeters can provide over 40 hours (15 hours for 705-ATEX and 705+ATEX) continuous operation with NiCD and NiMH rechargeable batteries. If you wish to use rechargeable batteries rather than alkaline cells, we recommend the following batteries and battery chargers.

Radio Shack Rechargeable Batteries:

Catalog Number	Description
23-149A	NiCd 1000mAH AA, 2-pack
23-525	NiMH 1200mAH AA, 2-pack

Table 1-1 **Rechargeable battery recommendation**

Radio Shack Battery Chargers:

Catalog Number	Description
23-405	NiCd/NiMH 1 Hour Charge
23-406	NiCd/NiMH 5 Hour Charge

Table 1-2 **Battery charger recommendation**

Connecting the dosimeter to a PC

Communication between the dosimeter and a PC is made via an IR (infrared) interface module. Not only does this provide a cable free way to connect to the computer, but it also yields a very fast transfer rate of 115,000 bits per second. The following Larson Davis IR interface modules are available for this purpose.

- DVX008 (for direction serial port connections)
- DVX008A with DVX008 (for USB port connections)
- DVX009 (for USB port connections)

These modules are all shown in Figure 1-15

.

Figure 1-15 ***External IR Interface Modules***

External IR interfaces connect to the computer's serial or USB port. If you need assistance in installing or configuring the DVX008, DVX008A, or DVX009 see "Communications Troubleshooting" on page D-1.

Environmental Considerations

The dosimeter can be used and stored in a wide range of temperature and non-condensing humidity conditions. However, some precautions should be taken. For example, allow the dosimeter ample time to adjust to abrupt temperature changes. Condensation may form inside a cold dosimeter if it is brought into a warm room or vehicle, and may persist long after the outside case has adjusted to the ambient temperature.

Also, temperatures inside closed vehicles can reach excessive levels. Therefore, do not leave the instrument in direct sunlight inside a vehicle. A simple safeguard is to keep the instrument inside a sealed foam insulated case or bag with desiccant silica gel, available at photographic equipment stores or from Larson Davis (LD part number DSC001).

See pages A-3 for further information regarding environmental considerations.

Data Retention

The measurement data gathered by the dosimeter is stored in non-volatile memory. Therefore, the data will not be lost if the batteries expire. However, the dosimeter will halt data gathering, and the built in clock will lose time and date information should the batteries run out. In this case, the clock settings will need to be re-entered using the Blaze® software. In order to avoid losing the clock settings and having the dosimeter stop during a measurement, data should be downloaded and the batteries changed at the end of every 100 hours of continuous usage (35 hours of continuous usage for the 705+ATEX and 705-ATEX). Good measurement practice is to download data after every shift, and replace the batteries when they are running low.

Installing the Blaze® Software

To install the Blaze® software in Windows®:

Step 1 Select **Run** from the **Start** menu on the Task bar at the bottom of the Windows® desktop.

Step 2 Type in the Run window:
d:\setup.exe or the drive letter of your CD Rom
and press the **OK** button.

NOTE: During the installation procedure, the Blaze® software will prompt the user to enter a product serial number. The serial number is located on the bottom of the Blaze® CD.

The install program installs the program files, and prompts for any additional required information. For Windows XP and Vista users, a PCB **Piezotronics/Blaze** menu item is created under the **All Programs** menu item in the **Start** menu.

The drivers for both the DVX008A and DVX009 can be installed during the Blaze® install. If you are planning to use either of these IR interface modules, **ensure that they are not connected during the installation process**.

When the driver install screen appears (for the DVX009 driver install only) be sure to check the box labeled "Launch the CP210x VCP Driver installer" if you are planning on using the DVX009. Enter the product serial number found on your Blaze CD in the Serial Number fields.

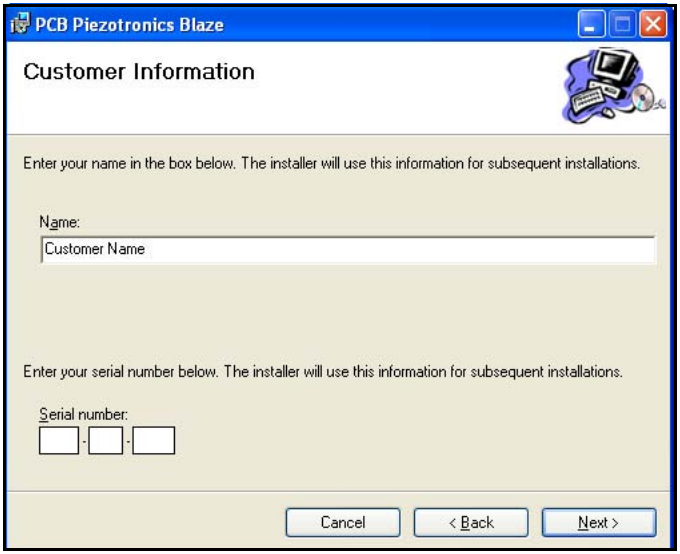
PCB Piezotronics Blaze
Customer Information
Enter your name in the box below. The installer will use this information for subsequent installations.
Name:
Customer Name
Enter your serial number below. The installer will use this information for subsequent installations.
Serial number:
Cancel
< Back
Next >

Blaze® now contains the drivers needed to accept the DVX009 IR-to-USB adaptor. The following screens illustrate the process of installing the drivers.

When installing Blaze®, you will be prompted as follows

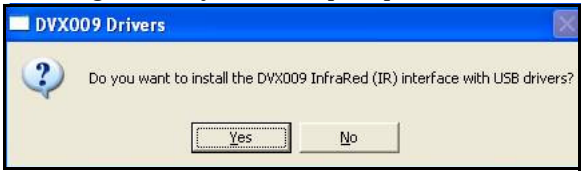

Selecting Yes takes you the first screen of the install wizard

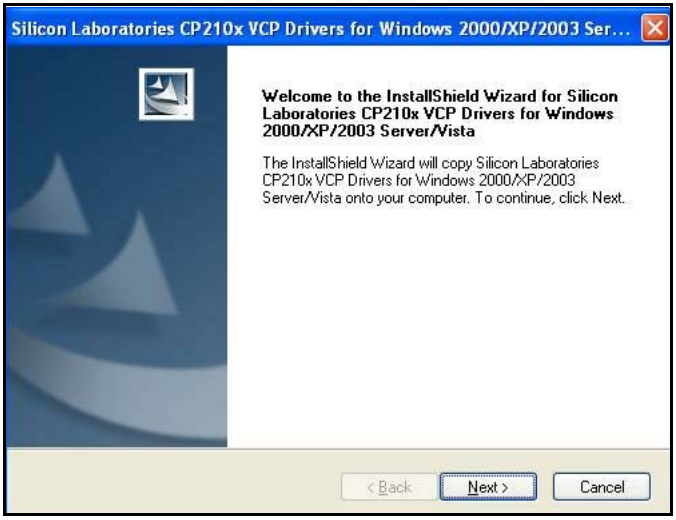
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
Welcome to the InstallShield Wizard for Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista
The InstallShield Wizard will copy Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista onto your computer. To continue, click Next.
< Back
Next >
Cancel

Click Next

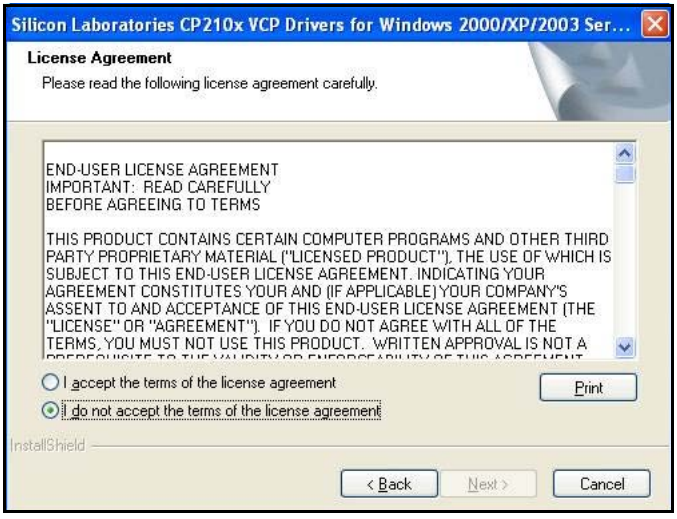
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
License Agreement
Please read the following license agreement carefully.
END-USER LICENSE AGREEMENT
IMPORTANT: READ CAREFULLY
BEFORE AGREEING TO TERMS
THIS PRODUCT CONTAINS CERTAIN COMPUTER PROGRAMS AND OTHER THIRD PARTY PROPRIETARY MATERIAL ("LICENSED PRODUCT"), THE USE OF WHICH IS SUBJECT TO THIS END-USER LICENSE AGREEMENT. INDICATING YOUR AGREEMENT CONSTITUTES YOUR AND (IF APPLICABLE) YOUR COMPANY'S ASSENT TO AND ACCEPTANCE OF THIS END-USER LICENSE AGREEMENT (THE "LICENSE" OR "AGREEMENT"). IF YOU DO NOT AGREE WITH ALL OF THE TERMS, YOU MUST NOT USE THIS PRODUCT. WRITTEN APPROVAL IS NOT A
I accept the terms of the license agreement
I do not accept the terms of the license agreement
Print
InstallShield
< Back
Next >
Cancel

Click "I accept the terms of the license agreement" and then click Next.

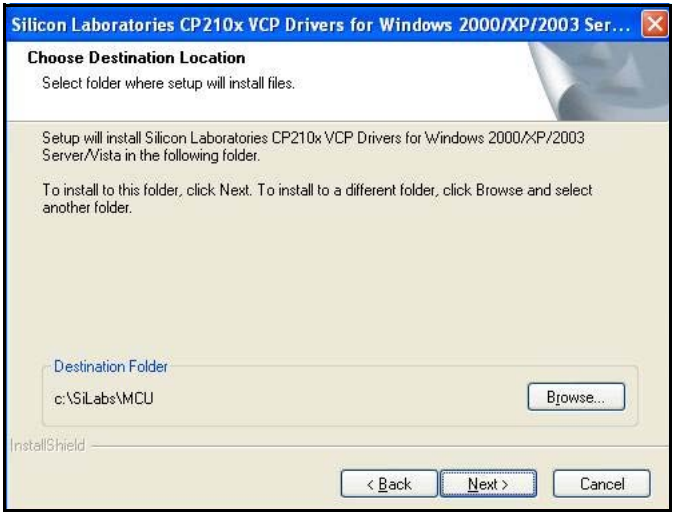
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
Choose Destination Location
Select folder where setup will install files.
Setup will install Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista in the following folder.
To install to this folder, click Next. To install to a different folder, click Browse and select another folder.
Destination Folder
c:\SiLabs\MCU
Browse...
InstallShield
< Back
Next >
Cancel

Click Next

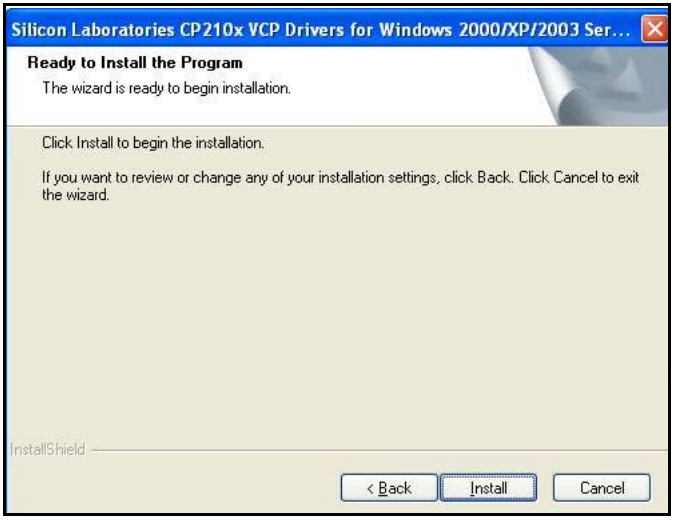
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
Ready to Install the Program
The wizard is ready to begin installation.
Click Install to begin the installation.
If you want to review or change any of your installation settings, click Back. Click Cancel to exit the wizard.
InstallShield
< Back
Install
Cancel

Click Next

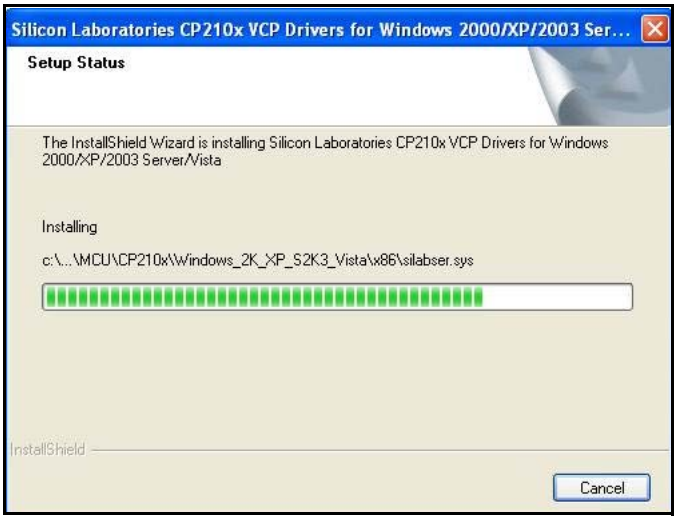
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
Setup Status
The InstallShield Wizard is installing Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista
Installing
c:\...\MCU\CP210x\Windows_2K_XP_S2K3_Vista\x86\silabser.sys
InstallShield
Cancel

Wait for install to finish.

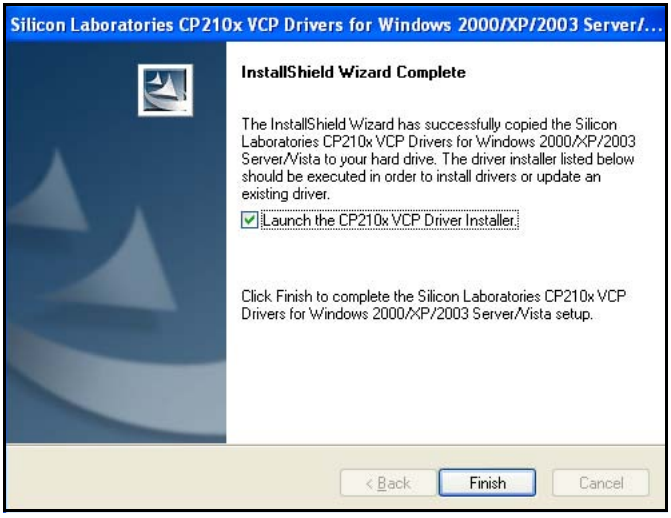
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/...
InstallShield Wizard Complete
The InstallShield Wizard has successfully copied the Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista to your hard drive. The driver installer listed below should be executed in order to install drivers or update an existing driver.
Launch the CP210x VCP Driver Installer
Click Finish to complete the Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista setup.
< Back
Finish
Cancel

Check the "Launch the CP210x VCP Driver Installer" box and click Finish

Click Install

System Settings Change
You must restart your computer before the new settings will take effect.
Do you want to restart your computer now?
Yes
No

When the install is done, click No

Note: If you are reinstalling Blaze®, or installing Blaze® on a machine that already has this driver installed, the display will look as follows:

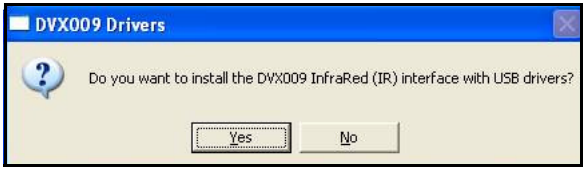

Click Yes to obtain the following screen.

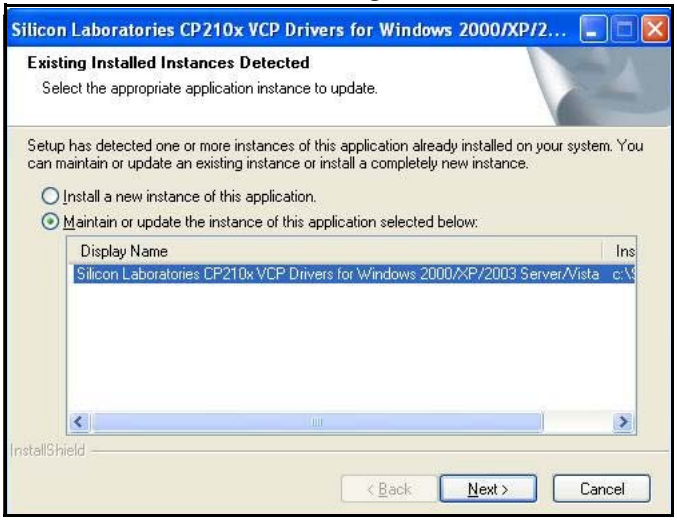
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2...
Existing Installed Instances Detected
Select the appropriate application instance to update.
Setup has detected one or more instances of this application already installed on your system. You can maintain or update an existing instance or install a completely new instance.
Install a new instance of this application.
Maintain or update the instance of this application selected below:
Display Name
Ins
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Server/Vista
InstallShield
< Back
Next >
Cancel

Check the "Maintain or update the instance of this application selected below" and then select the first entry in the listbox. Click Next and continue the wizard.

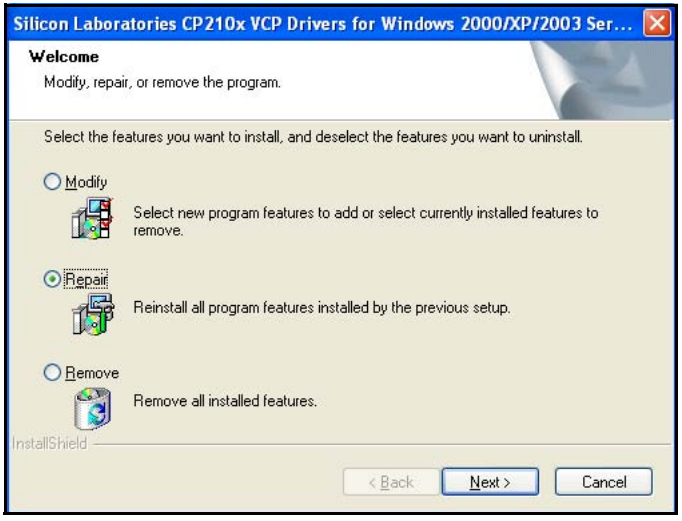
Silicon Laboratories CP210x VCP Drivers for Windows 2000/XP/2003 Ser...
Welcome
Modify, repair, or remove the program.
Select the features you want to install, and deselect the features you want to uninstall.
Modify
Select new program features to add or select currently installed features to remove.
Repair
Reinstall all program features installed by the previous setup.
Remove
Remove all installed features.
InstallShield
< Back
Next >
Cancel

Select 'Repair' and click Next.

703-ATEX/703+ATEX/705-ATEX/705+ATEX Front Panel Indicators

The Spark® 703-ATEX, 703+ATEX, 705-ATEX, and 705+ATEX instruments have two front panel indications.

Green Power Indicator LED. Indicates when the instrument is turned on with 4 indication modes:

1. When powering up, both LED's turn on steady. The instrument is checking stored data in memory. This time is from 3 to 90 seconds.

2. Blinks once every 5 seconds: low power sleep mode. Place in front of the IR port to initiate communication.

3. Blinks twice every 3 seconds: Awake mode, ready to communicate and be programmed.

4. Blinking constantly: Spark® is running and taking data

Red Battery Indicator LED: 4 indication modes:

1. Blinks once every 3 seconds: 8 hours of battery life remaining.

2. Blinks twice every 3 seconds: Only 4 hours of battery life remain

3. (NEW) Quickly blinks three times: IR connection is failing - low battery.

4. (NEW) Blinks once every 10 seconds: The battery MUST be replaced; or no further operation can occur.

Figure 1-16 ***Indicators on Front Panel of 703-ATEX, 703+ATEX, 705-ATEX, 705+ATEX instruments***

CHAPTER

2 *Using Larson Davis Blaze® Software*

Starting Blaze® Software

To start the Blaze® software in Windows®:

Step 1 Click on the **Start** menu on the Task bar at the bottom of the Windows® desktop.

Step 2 Go to the **All Programs** submenu.

Step 3 From the **PCB Piezotronics** submenu (or wherever the program was installed), select **Blaze®**.

Blaze® Main Window

When the Blaze® software is fully loaded, the Blaze® Main window is displayed.

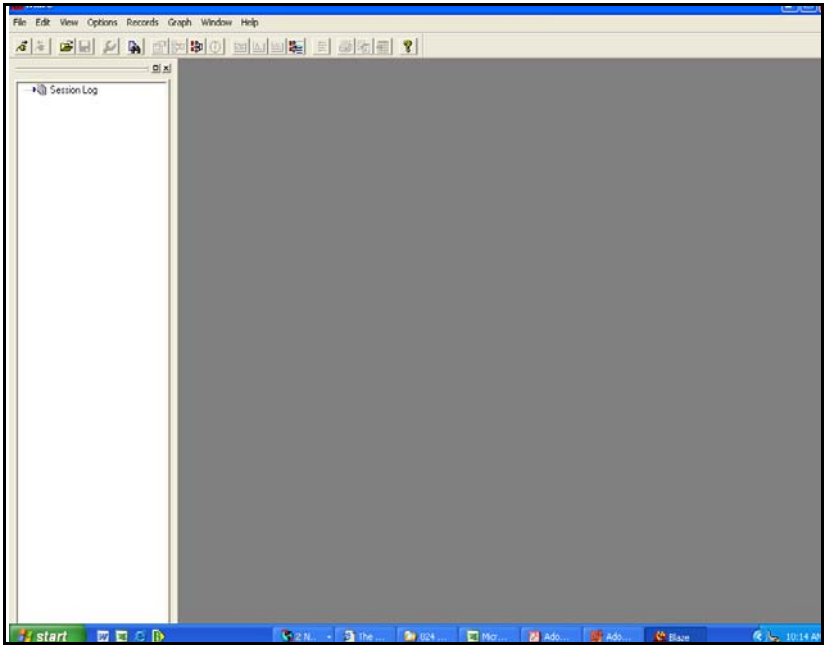

Just below the menu bar is the tool bar.

The tool bar provides quick access to commonly used software functions. The following table describes each toolbar function in detail.

	The connect button will make the connection to the Spark®-ATEX instrument currently in range of the IR port.
	The Disconnect button will terminate the connection between Blaze® and the Spark®-ATEX instrument in range.
	The Open File button will bring up a standard Windows browser window that will allow the user to open an existing database record.
	The Save file button will bring up a standard Windows Save File dialog box, that will allow the user to save the current Blaze® file. The dialog window will also allow the user to select a file name and location.
	The Instrument Manager button will bring up the Instrument manager screen. The user can then setup the instrument, set the clock, download data files, etc.
	The Query Files button brings up a dialog window that will allow the user to search through the existing Spark®-ATEX database records for records containing specific items.
	The Set Result Parameters button will bring up a dialog box that will allow the user to select from different dose settings, change Ln Values, and place general information onto the current record.
	The Merge Records button will allow the user to combine 2 or more downloaded records into a single record.

	The Average File Records button permits the user to select different files and then select a record from each of these files to average together.
	The Modify Time History Interval button will allow the user to change the time history period for the current record.
	The Time History Graph will bring up a time history graph for the current database record.
	The Statistics Graph Button will produce statistics graphs for the current database record.
	The Spectrum Graph Button is not used with Spark®-ATEX.
	The Graph Multiple File Button permits the user to select different files and then select records from each to be plotted on a single graph. This function can also be accessed from the Main Menu by clicking on Window and then on Multi-File Graph in the drop-down menu.
	The Measurement Log Button is not used with Spark®-ATEX.
	The Print button will print the currently displayed record. It will print the current selection, whether it is a Time History Graph, a Statistics Graph, or the text data as displayed on the screen.
	The Print Reports button will give you access to the predefined reports that Blaze® can print.
	The Export Data button will export the currently displayed record as a Comma-Delimited File that can be opened in a spreadsheet application. It will also allow the user to select the output location and file name, and whether or not to automatically launch the viewer application.

	The About button will bring up the Blaze® splash screen with the current revision number.

.

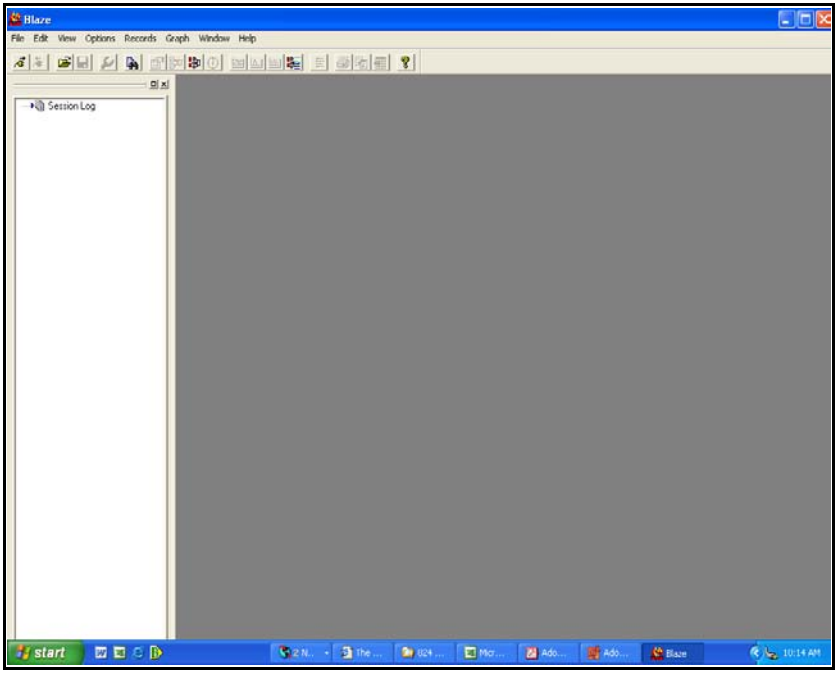

On the left side of the screen you'll find the Session Log. This useful area provides information with respect to the status of an active (connected) Spark®-ATEX instrument. This indicates if the PC is currently connected to a Spark®-ATEX instrument, if the connected Spark®-ATEX instrument is running or stopped; the serial number of the Spark®-ATEX instrument, and if data has been downloaded from the Spark®-ATEX instrument. It also indicates if the unit has been calibrated. The Session Log will be automatically updated when any of these operations has occurred.

Communication Methods in the Blaze® software

Direct Port Access

Direct port access is used to establish the IR connection from your Windows® operating system. This method will work in any of the Windows® operating system, but will only work with the DVX008 external IR port.

Direct port access does not require installing any IR drivers, or installing any additional network communication protocols.

Selecting the Communication Method

After loading the software, which will bring the Blaze® main window to the computer screen, it is necessary to set up the connection to work with the Spark®-ATEX instrument. To do this, use the left mouse key to select **Options/Connections** which will display the Connection Setting dialog box...

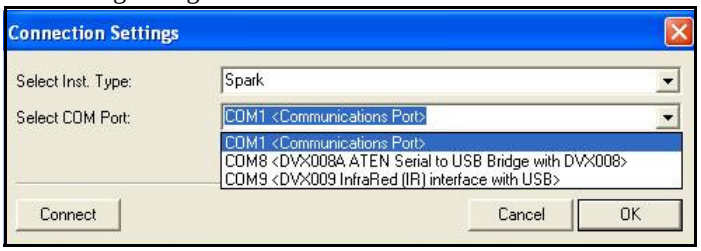

Selecting the Spark®-ATEX Instrument

The Blaze® software can be used with either the Spark®-ATEX instruments, the Sound Track LxT or the HVM100 Human Vibration Meter. This manual is concerned only with it's use with Spark®-ATEX units.

If the data field associated with "Select Inst. Type:" already indicates "Spark", move on to the next section to select the type of IR connection. If not, click on the down arrow to the right of the item in the "Select Inst. Type:" field to open the pull-down menu, click **Spark** and then left click, or press **Enter,** to close the menu.

Select the IR Connection Type

If using a DVX008, select which COM port it is attached to, or select the DVX008A or DVX009 if one of these is being used instead. These all will appear in the Select COM Port pull down menu as the following:

- DVX008 appears as"COMn <Communications Port>"
- DVX008A with DVX008 appears as "COMn <DVX008A ATEN Serial to USB Bridge with DVX008>"
- DVX009 appears as "COMn <DVX009 Infrared (IR) interface with USB>"

Step 1 If connecting to a 706-ATEX/706RC-ATEX, press the **ON** key,

Step 2 to power the unit up. The 703-ATEX/703+ATEX/ 705-ATEX/705+ATEX will automatically turn on when it is placed in front of an active IR port.

Step 3 Aim the IR window on the top of the instrument toward the Larson Davis IR interface module.

Blaze® can only communicate with one Spark®-ATEX instrument at a time.

For the first time setup of the computers IR port, the user can use the Blaze Connection Wizard. The wizard can be started by clicking on Options in the main menu and Connection Wizard. For additional information regarding first time setup of the IR interface module, please refer to Appendix B of this manual.

Although distance and angle tolerance may very from PC to PC, for optimal data transfer performance it is recommended that the instrument be placed a distance between one and three feet from the IR interface module

When using the IR port, the Blaze® software will automatically select the Baud rate and Port.

Step 4 Click the **Connect** button on the Blaze® toolbar

.

During the connect process, information is read from the Spark®-ATEX instrument, which then updates the Session Log with the serial number of the Spark®-ATEX instrument. Run/stop status is updated whenever initiated by the software.

Once a connection has been made, the Session Log will be updated to show that a Spark®-ATEX instrument is connected, along with its serial number. The data and time of the connection is also shown.

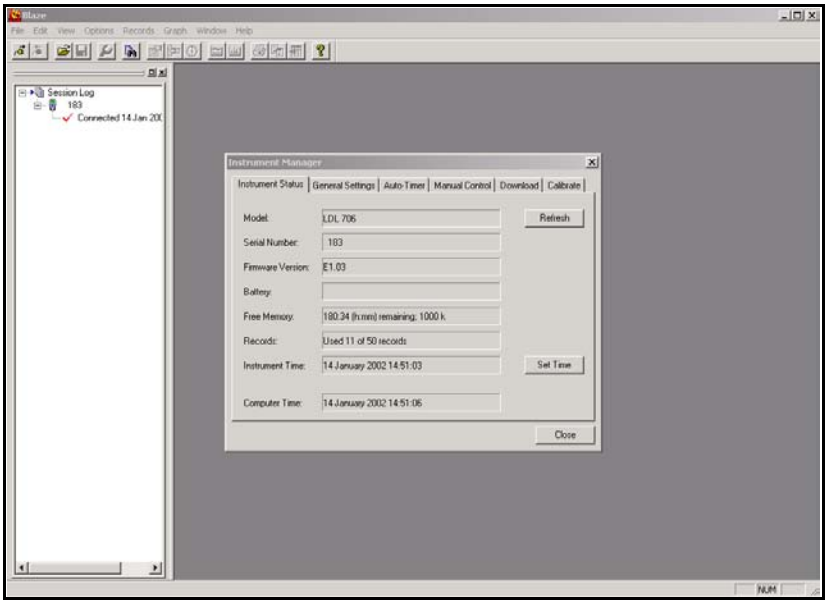

To view the instrument manager window the Spark®-ATEX instrument must be connected.

The Instrument Manager window also appears on the screen. The Instrument Manager contains tabbed pages for performing various Spark®-ATEX instrument functions. The page that appears initially is the Instrument Status page.

Important! You must "disconnect" from the Blaze® software before physically moving the Spark®-ATEX instrument away from the IR device. This is accomplished by closing the Instrument Manager dialog box, and clicking on the **Disconnect** *button.*

It contains information about the currently connected Spark® instrument; the instrument's serial number; the firmware version; the remaining battery voltage (note that full voltage is approximately 3.00V for the 703-ATEX/703+ATEX if using alkaline batteries or approximately 1.5V for 705-ATEX/705+ATEX if using alkaline batteries); the remaining run time, the available free memory in the Spark® instrument, the number of records used (up to 50) and the remaining run time based on the free memory and current data storage selections; the date/time of the Spark®-ATEX

instruments built in clock; and the date/time from your computer.

Before connecting another Spark®-ATEX instrument you must first disconnect the currently connected Spark®-ATEX instrument by clicking on the **Disconnect** button before re-establishing a new connection.

Setting the Spark®-ATEX instrument clock

To set the date and time of the built-in clock of the Spark® instrument do the following:

Step 1 Press **Set Time**.

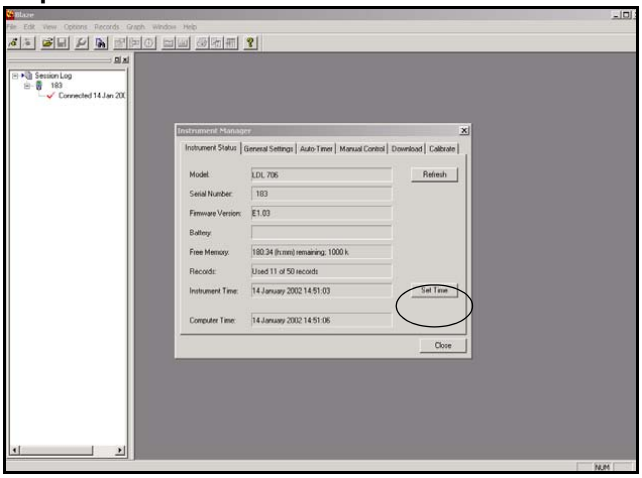

This will open the Instrument Date and Time Window.

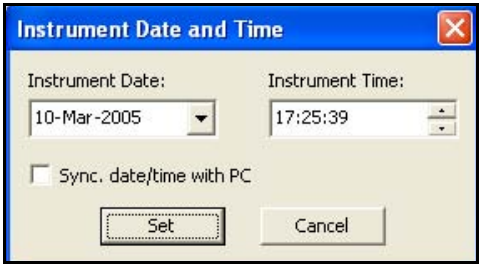

There are two methods of setting the data and time:

- Synchronize data and time with computer

- Set date and time

Synchronize Date and Time with Computer

"Synchronize to computer time", forces the active Spark®-ATEX instrument's internal clock to match that of the connected computer.

Left click the check box to the left of the text "Synch. date/ time with PC" and left click Set. This will bring up the message shown below to indicate that this action has been completed.

Set Date and Time Manually

Do not left click the check box, but use the down arrows for the two data fields, "Instrument Date" and "Instrument Time" to set these values.

To change the date, click on the down arrow in the date pull-down menu. A calendar will appear.

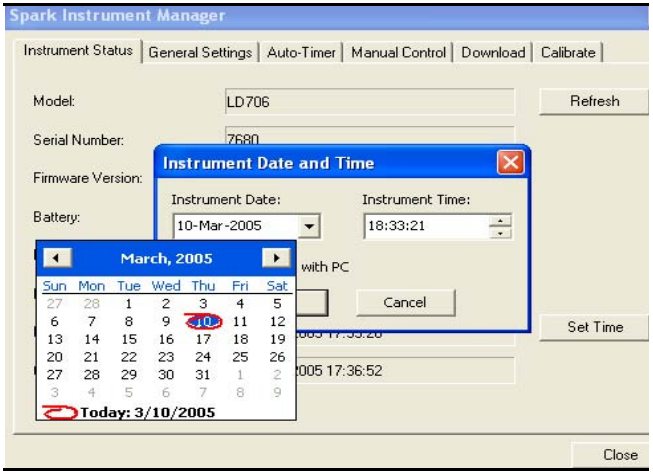

Click on the appropriate date to change the date of the Spark®-ATEX instrument. To change months, click on the left or right arrow at the top of the calendar.

To adjust the time, click in the Time Field on the hour/ minute/second that you would like to change.

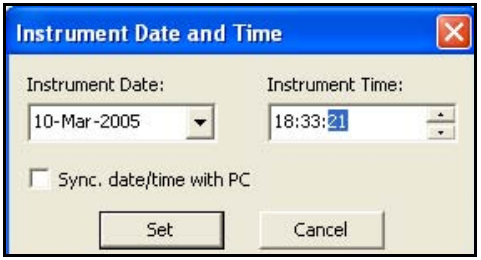

Use the up and down arrows in the time field to adjust the clock.

Step 2 Press **Set** to send the selected date and time to the Spark®-ATEX instruments built in clock.

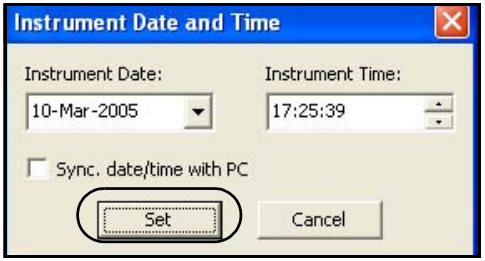

If you inadvertently close the Instrument Manager window, you can re-open it by pressing the Instrument Manager button on the toolbar. The Instrument Manager window will then reappear.

This will bring up the message shown below to indicate that this action has been completed.

The remaining tabbed pages in the Instrument Manager will be discussed in the sections that follow.

Calibrating the Spark®-ATEX instrument

It is always good practice to calibrate your Spark®-ATEX instrument before each measurement. To calibrate, select the Calibrate tab from the Instrument Manger window to show the Calibrate page

.

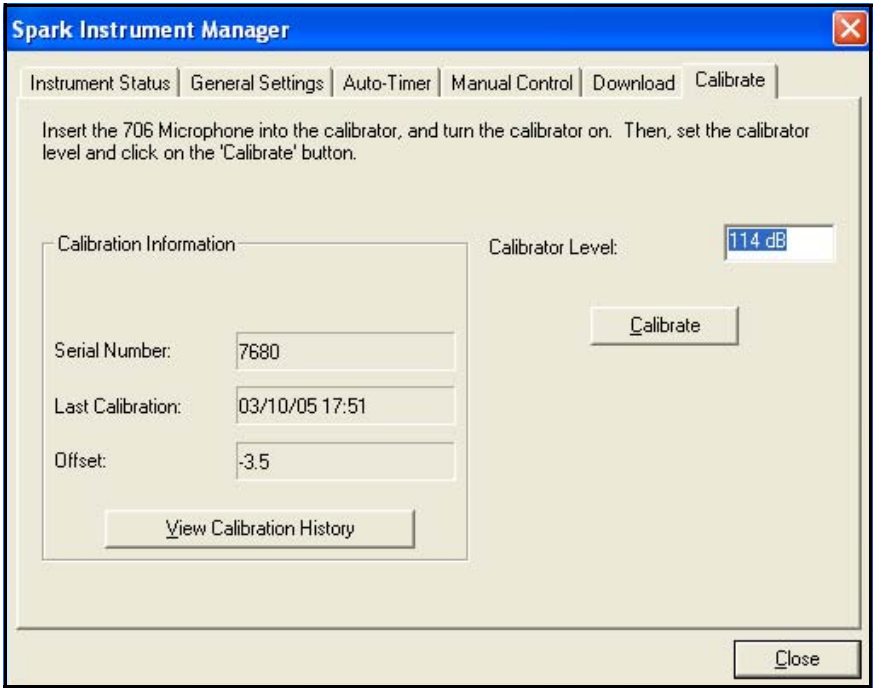

Step 1 First, verify that the Calibrator Level field contains the appropriate output level of your calibrator.

If you are using a Larson Davis Model CAL250, this should be set to 114.0. If you are using a Larson Davis CAL150 or CAL200, the value could be set to either 94.0 or 114.0 depending on the setting of the adjustable level switch. (The instrument will verify that the signal from the calibrator is within the proper range, if the signal is out of range, the calibration will not be changed.)

Step 2 Remove microphone windscreen and insert the Spark®-ATEX instrument microphone fully into the calibrator microphone opening. Activate the calibrator.

Figure 2-1 ***Calibrating the Spark™-ATEX***

Step 3 Press **Calibrate** on the Blaze® calibrate menu to initiate the calibration process.

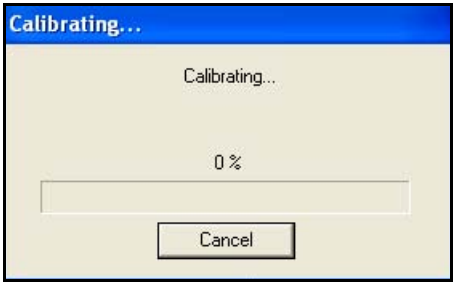

You will see that a bar appears on the screen showing the calibration in progress. When the bar is at 100%, the calibration is complete. The following message appears.

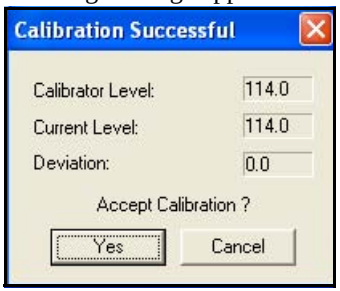

Step 4 Click **Yes** to accept this calibration or click **Cancel** to abort the calibration process.

If you click **Yes**, your Spark®-ATEX instrument is now calibrated. Notice that the "Last Calibration" field has been updated to reflect this most recent calibration.

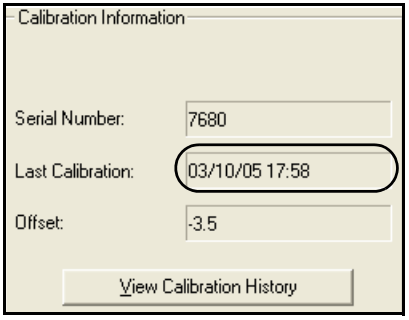

Possible Dialog Boxes

There are two dialog boxes which may appear during the calibration of a Spark unit.

Level Greater than Cal High Range

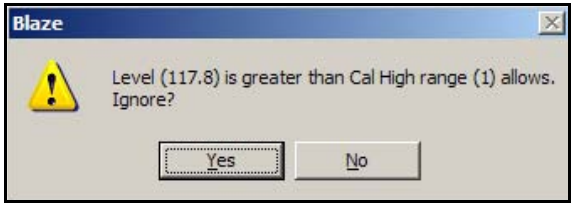

This dialog box indicates that the calibration upper limit value, set at the factory, is too low for the microphone being used. This does not necessarily indicate a problem with the microphone. Selecting **No** will terminate the calibration, but selecting **Yes** will permit the calibration to continue. It will also create a new offset so that there will be no interruption of the calibration procedure the next time the Spark is calibrated using the same microphone.

Current Level Greatly Exceeds the Calibration High Limit

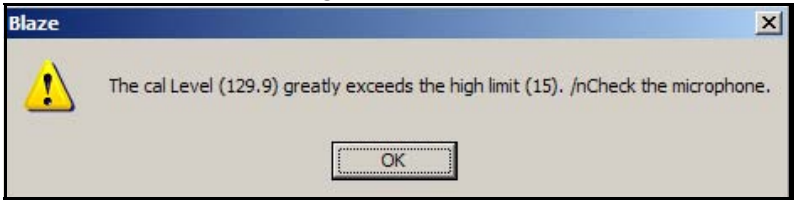

This dialog box appears when the value the instrument is reading is so high (more than 15 dB above the Calibration Level) that it almost certainly indicates a fault in either the microphone or the Spark unit. It is recommended that a calibration be attempted using a different microphone to determine if it is a bad microphone causing the high reading before contacting Larson Davis for technical support.

Calibration Information

The Calibration Information area is located on the left side of the screen, within the Calibration window. The Last

Calibration field contains the date and time a calibration was performed on the connected Spark®-ATEX instrument. The serial number of the connected Spark®-ATEX instrument is shown in the Serial Number field.

Calibration Offset

The offset field displays an "Offset number" each time a calibration is performed. The Offset number generated before leaving the factory is entered into a log for the service technicians to be able to track how the dosimeter has adjusted or corrected itself over time to deal with varying microphone sensitivities. This offset naturally changes from instrument to instrument, depending on those varied microphone sensitivities.

The Deviation Field is very important as it can alert you to problems with your Spark®-ATEX instrument, preamp, microphone, and/or calibrator. A calibration compares the dB level being read by the Spark®-ATEX instrument with a known dB level coming from the calibrator. The difference between the two dB levels becomes the calibration deviation for the Spark®-ATEX instrument which is added to the relative output of the Spark®-ATEX instrument. This is how the instrument "corrects" itself to compensate for the "drift" that the instrument may experience during its lifetime, making adjustments internally to compensate for varying microphone sensitivities due to environmental considerations like heat, cold, humidity, accidental abuse or neglect of the microphone

NOTE: The dosimeter only "remembers" the last time it was calibrated. When connected to Blaze® software this date is recorded as the "pre-calibration" date. By calibrating with the CAL150 and the Blaze® software, the software recognizes the earlier, or most recent calibration, and adds it along with the post calibration that you just performed using the CAL150 and the Blaze® software. If you calibrate every time with the Blaze® software you will always get pre and post calibration information. To get the pre and post calibration's to show up on the summary report, use the Blaze® software at least every other time you do a calibration.

A significant change (over +/- 1.5 dB) in deviation after calibration may indicate an instrument error or drift. It can also indicate an error in the calibration process, like having the calibrator switched to an incorrect output level, or a problem with the microphone as described above. If you happen to change the microphone, you could see a larger difference in your offset and deviation as different microphones have different sensitivities. Under this circumstance do not be alarmed by this large change in offset and deviation, as the instrument will correct itself for the new microphone sensitivity, and will function normally.

Calibration History

Each time a Spark®-ATEX instrument is calibrated, an entry is logged in the calibration history database. The calibration history can be reviewed by pressing the View Calibration History Button. This opens the Calibration History window.

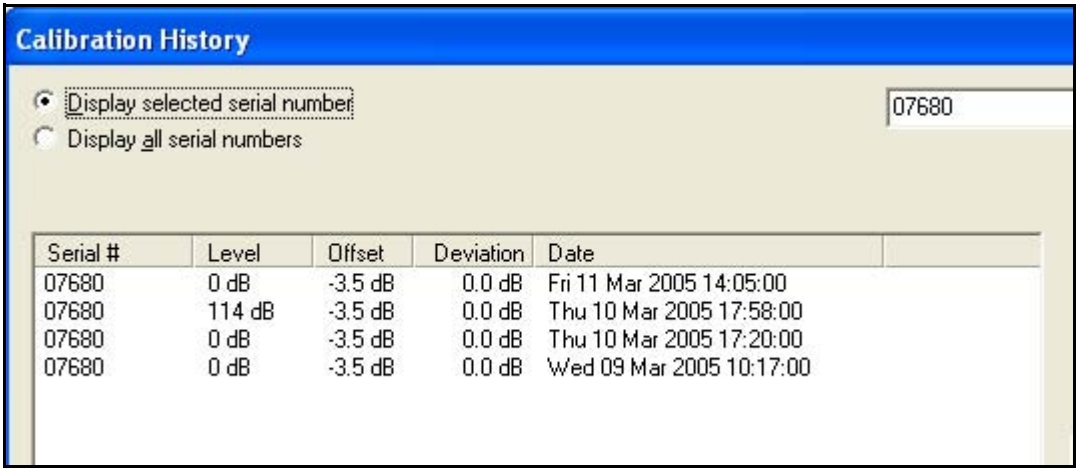
Calibration History
Display selected serial number
Display all serial numbers
07680
Serial # Level Offset Deviation Date
07680 0 dB -3.5 dB 0.0 dB Fri 11 Mar 2005 14:05:00
07680 114 dB -3.5 dB 0.0 dB Thu 10 Mar 2005 17:58:00
07680 0 dB -3.5 dB 0.0 dB Thu 10 Mar 2005 17:20:00
07680 0 dB -3.5 dB 0.0 dB Wed 09 Mar 2005 10:17:00

A deviation of greater than a few dB between calibrations should alert you to a potential problem with your Spark®-ATEX instrument, microphone, or calibrator. This alert can also indicate to the user that the microphone has been replaced with a different one since last calibrating the instrument. Different microphones will usually require different calibration offset values.

In this window, the history of a single Spark®-ATEX instrument can be studied by making a selection from the pull down menu (when the “Display selected serial number" radio button is used). Alternatively, you can view all the calibration histories from each of the Spark®-ATEX instrument’s that have been connected to your PC by choosing the "Display all serial numbers" radio button. The calibration history displays a table. Each row of the table presents information for one calibration. Each row lists the serial number of the calibrated Spark®-ATEX instrument, the dB level of the calibrator used, the Spark®-ATEX instrument offset after calibration, and the date and time of calibration.

The data from the last or most recent calibration done in the Spark®-ATEX instrument is saved and added to the selected calibration log. This allows you to pre-calibrate the instrument either in the office using Blaze® 3.0 software, or in the field using a Larson Davis 706RC-ATEX.

Printing Calibration Data

A calibration history can be included in the printed Summary Report. The option to print calibration information on the Summary Report can be found on the toolbar as a drop down menu after clicking on the Options tab, and can be turned on or off by selecting the appropriate "Print Cal History Info" checkbox.

If there is a merged record with intervening calibrations between the pre and post calibration, the report will indicate the number of calibrations performed between the pre and post calibration. You can refer to the calibration log to view the intervening calibrations if desired. Again, the printing of the pre and post calibration information on the Summary Report can be turned on or off by selecting the appropriate "Print Cal History Info" checkbox in the Options/Settings menu option.

Press **Close** to exit the Calibration History window.

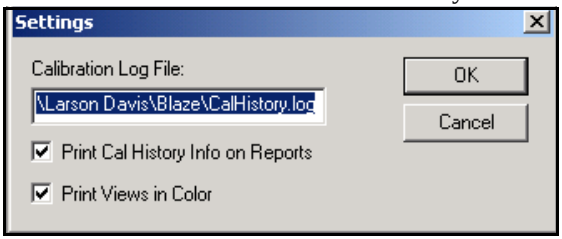

Setting the Spark® -ATEX instrument to Collect Data

To collect data, you should establish the type of data and time periods for which data will be collected. These options are set in the General Settings and Auto-Timer pages.

General Settings

Click the **General Settings** tab to view the Spark®-ATEX instrument settings.

.

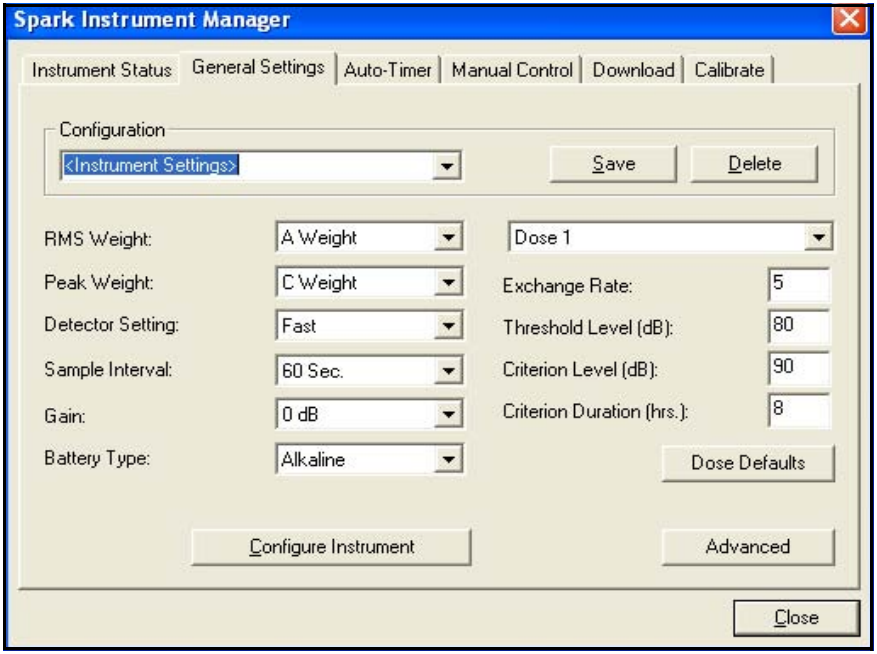

Within this page, the properties for RMS weighting (A or C); Peak Weighting (C or unweighted); Detector rate (fast or slow); Time history sample interval (1, 5, 15, 30, or 60 seconds); and Gain (0, 10, 20, or 30 dB) can be set. You can also establish settings for four separate, simultaneous dose measurements. For each of the four doses, you can establish the Exchange Rate, Threshold Level, Criterion Level, and Criterion Duration. Each of these terms is defined in the glossary located in Appendix B of this manual.

The settings used for your particular dose measurement are dictated by the applicable government body that regulates these issues within your country. In the United States, OSHA (Occupational Safety and Health Administration) defines these parameters. If you are measuring to OSHA regulations, the following is a list of the appropriate settings

- RMS Weighting – A
- Peak Weighting – Unweighted
- Detector Rate – Slow
- Exchange Rate – 5 dB

- Threshold Level – 80 dB
- Criterion Level – 90 dB
- Criterion Time – 8 hours

Modifying the General Settings

The Spark®-ATEX instrument settings can be modified in the General Settings window. Changing settings is accomplished by selecting a choice from the pull-down menu next to each field, or by typing directly into the field.

Step 1 To change the setting of an item with a pull-down menu, click on the down arrow on the right side of the field

.

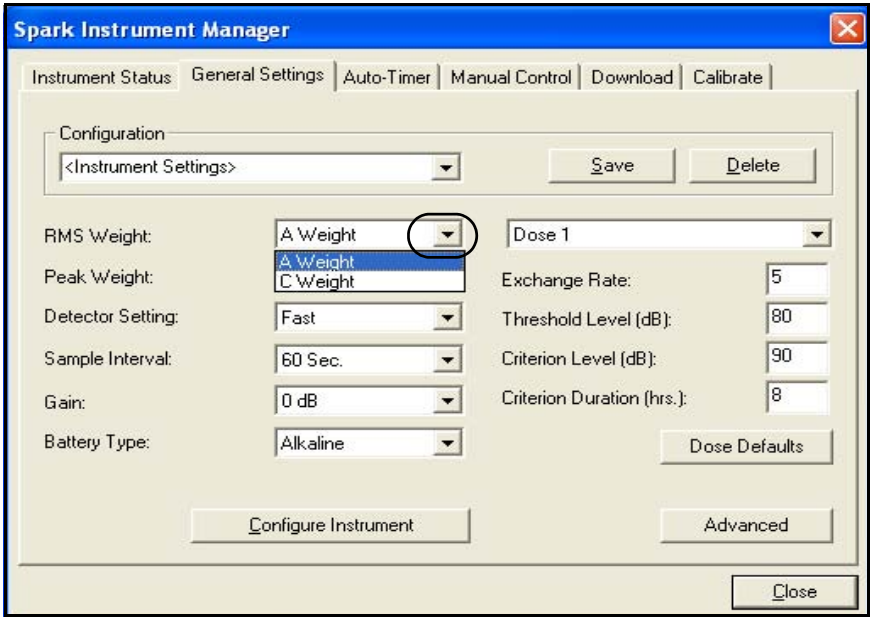

Step 2 Use the up or down arrow on your computer keyboard to cycle through the options and highlight your choice.

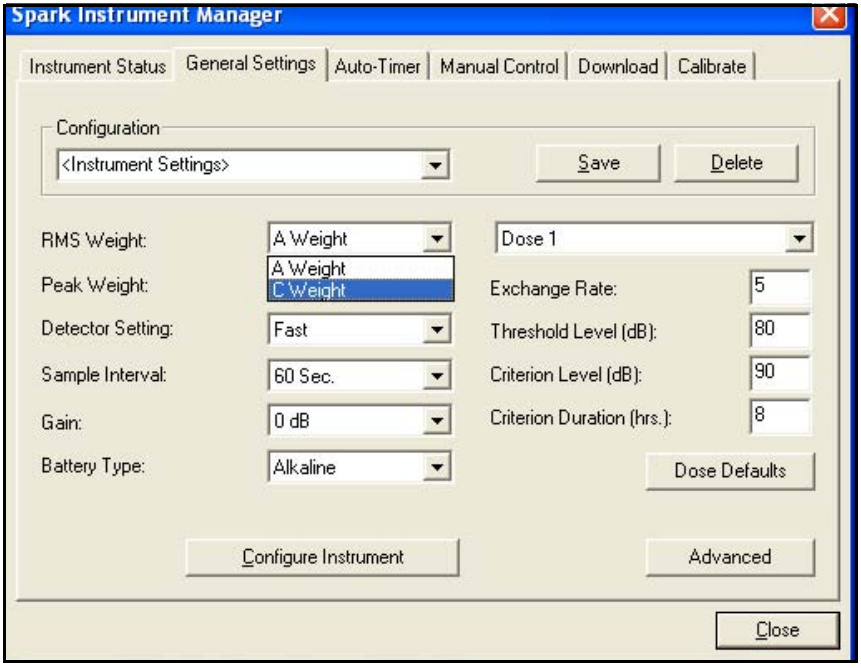

Step 3 Press the carriage return or click the left mouse button to select your choice.

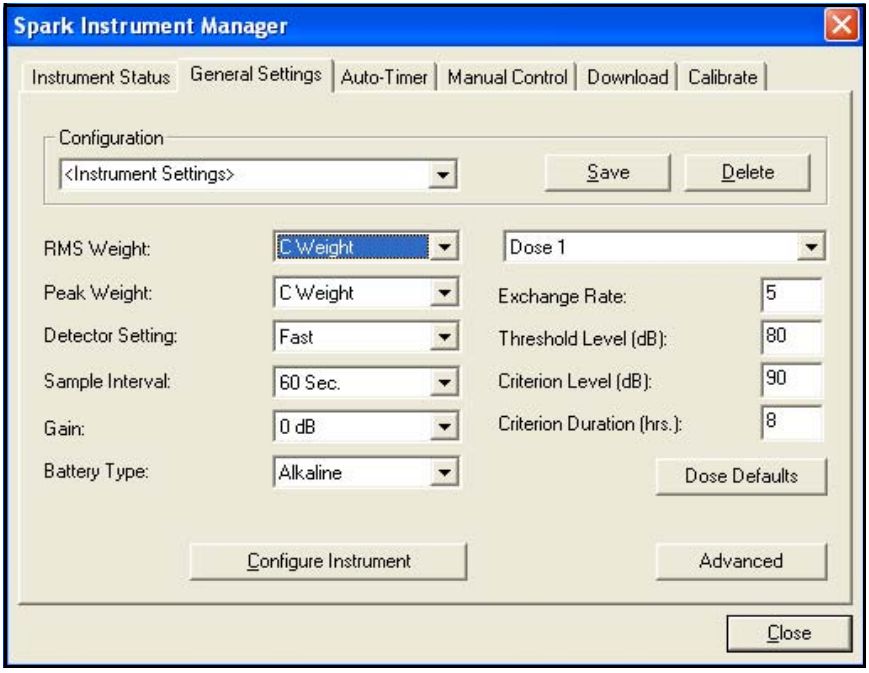

This technique is used to change the following settings in the General Settings tab

- RMS Weighting (A or C)
- Peak Weighting (Unweighted or C)
- Detector Setting (Slow or Fast)
- Sample Interval (1, 5, 10, 30, or 60 seconds)
- Gain (0, 10, 20, or 30 dB)
- Battery Type (Alkaline, NiCd, NiMH)
- Dose (Dose 1, Dose 2, Dose 3, and Dose 4)

Changing the dose settings is accomplished by first choosing the Dose you wish to modify.

Step 1 Click on the down arrow on the right side of the Dose field pull-down menu.

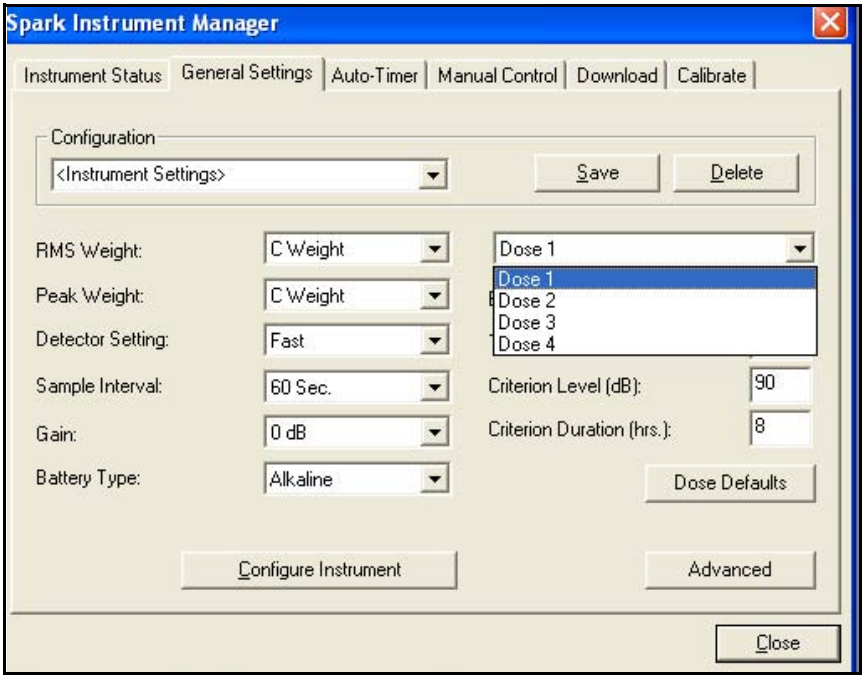

Step 2 Use the up or down arrows on your computer keyboard to choose a Dose number.

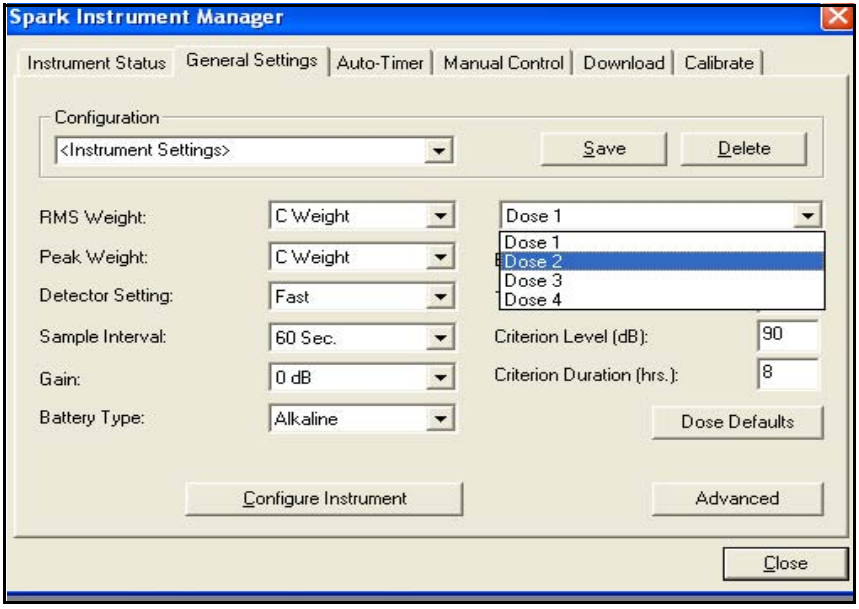

Step 3 Press the carriage return to select your choice, or click the left mouse button for your desired setting

.

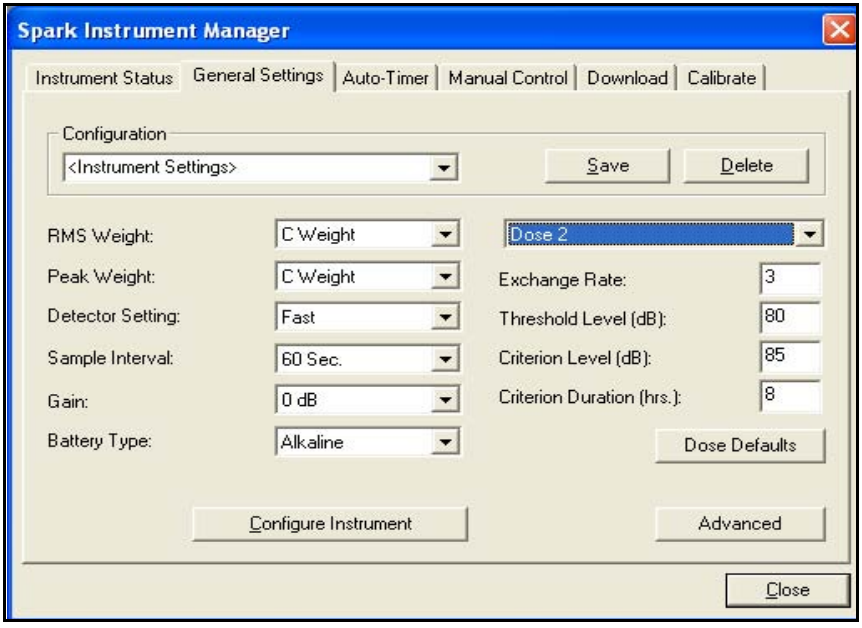

Step 4 Click the left mouse button inside a field (such as Exchange Rate).

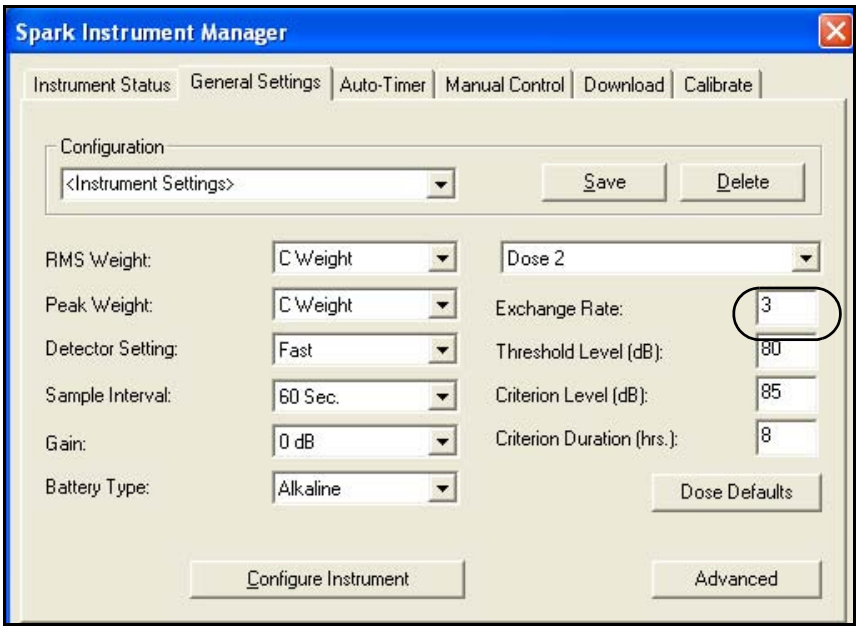

Step 5 Type in the new value

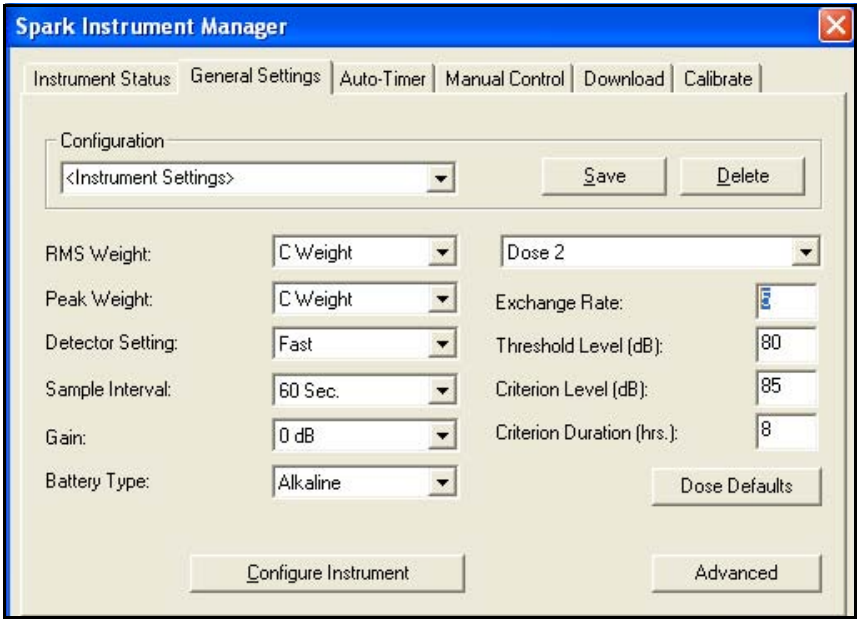

RMS Weighting

The choices are A or C. The instrument detector converts the sound signal into a useful form by first squaring the signal, then taking the mean value, and finally taking the square root (Root-Mean-Square). During this process, certain frequencies can be selectively attenuated (weighted), such as A-weighting and C-weighting, so the resultant level better corresponds to human hearing.

Peak Weighting

The Peak is the maximum sound level during a given time interval when the normal frequency and time weighting is NOT used. The Spark®-ATEX instrument has a Peak detector that responds rapidly to changing sound levels, unlike the normal time weighting (RMS) of the instrument. Peak weighting is the weighting (attenuation) of the peak detector. Possible selections are C weighted or Unweighted. Peak weighting is independent of the RMS weighting.

Detector Setting

The RMS (Root-Mean-Square) detector is used to collect data and is typically set to SLOW for dosimetry measurements. The Spark®-ATEX instrument supports either a SLOW or FAST detector.

Sample Interval

The “Sample Interval of the Time History” determines how often a sample is stored in the Spark®-ATEX instrument.

Time Histories are very helpful if you wish to see how the sound varies during the measurement period. A short Sample Interval (1-second) will provide excellent resolution, but requires more Spark®-ATEX instrument memory. A longer Sample Interval (1-minute) is normally sufficient for work noise exposure surveys.

Gain

For general dosimetry measurements, the gain should be set to 0 dB. Adding gain (using 10, 20, or 30 dB) will allow you to measure lower sound pressure levels. While this feature is very useful for general sound level meter measurements, it is not necessary or advisable for dose measurements.

Battery Type

The battery type selection allows the user to select the type of battery they wish to use. The three selections are, Alkaline, NiCD, and NiMH. The Alkaline battery selection is the default selection, and alkaline's are the factory supplied batteries. The NiCD and NiMH batteries must be user provided. It is important that this selection be accurate so that the remaining battery time indicator is accurate.

WARNING! In explosive environments, only approved alkaline batteries can be used in this instrument. (See page A-9 for approved batteries.)

Dose

The Spark®-ATEX instrument is capable of measuring 4 simultaneous noise dose measurements (Dose 1, Dose 2, Dose 3, and Dose 4). Each dose can have independently set dose parameters (exchange rates, threshold levels, criterion levels, and criterion times). Blaze® software allows you to setup each of the dose parameters for each of the dose calculations. Furthermore, Blaze® is capable of partially recomputing dose combination's after the acquired data has been downloaded into the software. The criterion level and criterion time can be changed after the data is downloaded.

Dose Default Values

Although the dose default values can be changes as described below, the user can reset them all to the default values by pressing the **Defaults** Button.

Exchange Rate

Exchange rate is defined in ANSI S1.25 as "the change in sound level corresponding to a doubling or halving of the duration of sound level while a constant percentage of criterion exposure is maintained". Possible values for this

field are 3, 4, 5, or 6. The current OSHA exchange rate is 5. A value of 3 will produce Leq-like levels.

Threshold Level (dB)

ANSI S1.25 defines threshold as “a sound level below which the dosimeter produces little or no dose accumulation as specified in this standard.” Noise levels below the threshold will not be included in the Spark®-ATEX instrument dose computation. The current OSHA threshold is 80 dB. Outside of the U.S., the threshold level is typically set to 0 dB.

Criterion Level (dB)

Criterion Level is the level of sound that will produce a dose of 100% if continually applied for the criterion time. The current OSHA criterion level is 90 dB.

Criterion Duration (hrs.)

Criterion duration is the time required for a continually applied sound of the selected criterion level to produce a dose of 100%. Criterion duration is typically 8 hours.

S.E.A. Metric

This metric is the summation of the acoustical energy of impact measured in dB (Peak, unweighted) greater or equal to 120 dB. The formula used by Blaze® is:

SEA = 10 log10[$\sum 10^{lw/10}$] where lw is the unweighted Peak value exceeding or equal to 120 dB.

Because the metric is for impact peak data, the Spark-ATEX must take 1 second data even if the desired sample interval is greater than one second. It also must set the Peak weighting to "Unweighted". When the "Store SEA data" check box is checked, only the Unweighted option will be available in the Peak Weighting combo box. In order to satisfy both requirements of required 1 second data and the user's desire for larger sample intervals, Blaze® will download the 1 second Peak data from the Spark-ATEX and calculate the SEA. Blaze® will then compress the 1 second data into the desired time intervals. The SEA data will be displayed in the Summary section of all reports if it is selected. Otherwise, it will not be calculated and will not be displayed. Once a file has been saved, SEA cannot be calculated if it was not done at download time. To calculate and store the SEA data,

connect to the Spark-ATEX, select the General Settings tab, and then click on the "Advanced" button.

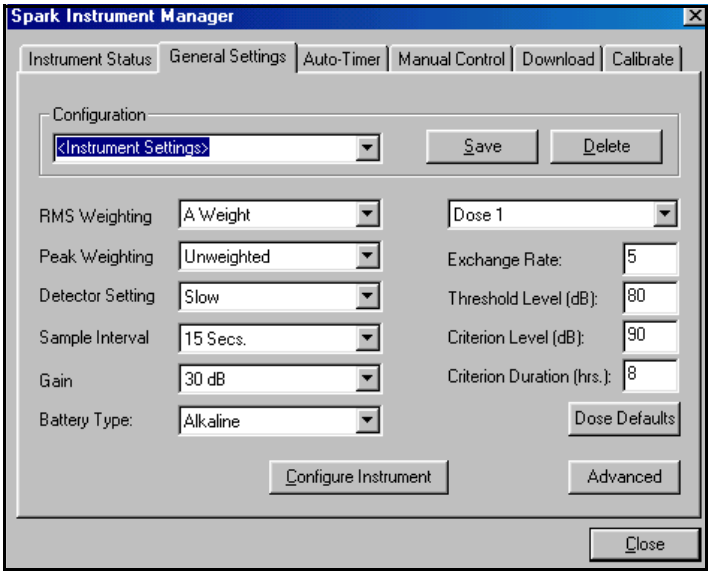

This will display the "Advanced Settings" dialog box (shown below) with the Store SEA check box. It also displays warnings about using the SEA metric.

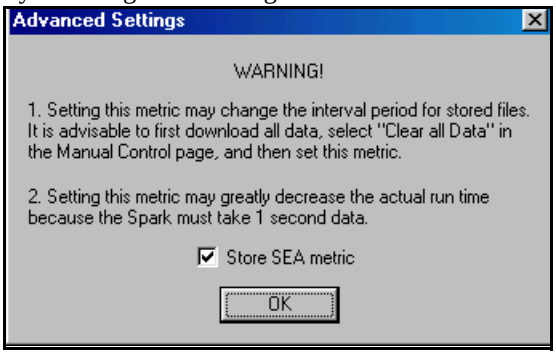
Advanced Settings
WARNING!
1. Setting this metric may change the interval period for stored files. It is advisable to first download all data, select "Clear all Data" in the Manual Control page, and then set this metric.
2. Setting this metric may greatly decrease the actual run time because the Spark must take 1 second data.
Store SEA metric
OK

The first warning message indicates that if you have files stored in the Spark-ATEX that were generated before selecting the "Store SEA metric", the sample interval for the stored files may change when downloaded. This will happen if the stored file(s) was taken with 1 second time interval and then the user does the following steps:

- Selects Show SEA
- Sets the Sample Interval to other than 1 second
- Configures the instrument
- Downloads.

Blaze® will compress the file into the new sample interval and the 1 second data will be lost if you tell Blaze® to delete the files after download.

The second warning is the result of forcing the Spark-ATEX to take 1 second data even though the user desires a higher sample interval. If the user desires 60 second data, the actual run time will decrease by a factor of about 60 because it will use up almost 60 times more memory.

User Defined Configurations

Once you have selected the instrument settings for your particular measurement you can save them as the default or as a custom setup. This allows you to set up a library of alternate instrument setting configurations as needed or required by the applicable governing body. This makes it possible to set up the instrument configurations once, and save them for quick and easy instrument configuration at any time in the future.

Step 1 To save the current parameters as a setup click on "Save". A window will appear to allow you to name the setup.

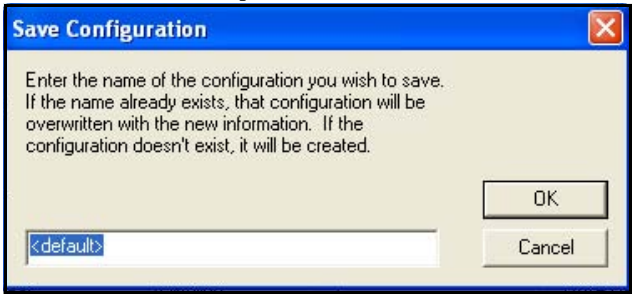
Save Configuration
Enter the name of the configuration you wish to save.
If the name already exists, that configuration will be overwritten with the new information. If the configuration doesn't exist, it will be created.
OK
<default>
Cancel

Step 2 Type in the name of the configuration and click "OK". This will save the new setup and the new name will now show up in the configuration field.

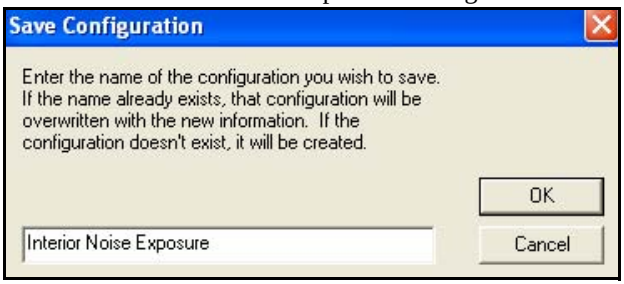
Save Configuration
Enter the name of the configuration you wish to save.
If the name already exists, that configuration will be overwritten with the new information. If the configuration doesn't exist, it will be created.
OK
Interior Noise Exposure
Cancel

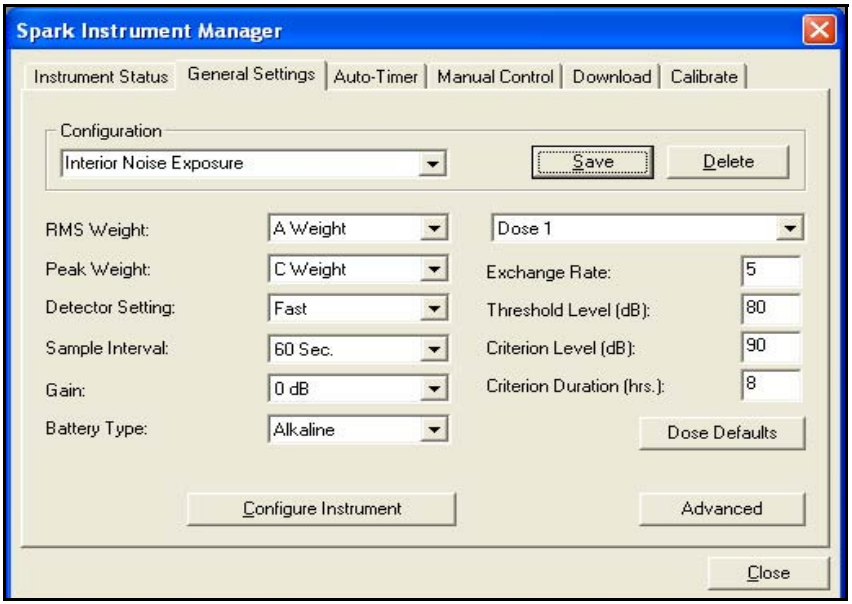

NOTE: You can save as many setups as you would like.

Step 3 Click on the configuration pulldown menu to select a setup. You will notice all of the new setups that have been saved.

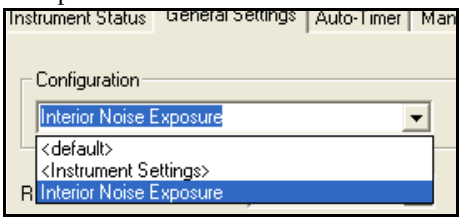

Step 4 To select a setup simply highlight your setup of choice and click on it. It will now appear in the configuration field.

Step 5 To delete a setup, click on the configuration pull-down menu and select the setup you would like to delete. Click on the "Delete" button.

Saving the Instrument Settings

Once you have developed the settings you wish to use, press **Configure** to upload these parameters into the Spark®-ATEX instrument. The following message will appear. Press **Yes** to continue

.

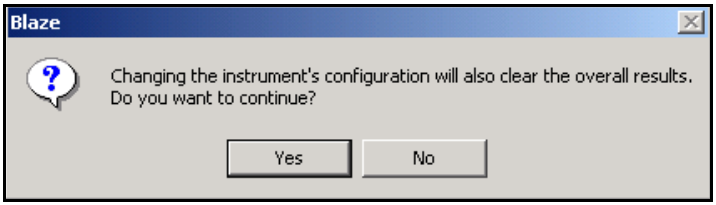

Setting the Auto-Timer

NOTE: Setting a timer mode, or other settings will have no affect on the Spark®-ATEX instrument until the **Set Timer** *Button is pushed.*

The Auto-Timer is used to establish the date and time when you wish to have the Spark®-ATEX instrument automatically turn on and gather data. You also set the amount of time you require the Spark®-ATEX instrument to measure before it automatically stops and turns itself off. The Auto-Timer can be programmed at any time prior to the required date/time. Press the **Auto-Timer** tab to enter the Auto-Timer page

.

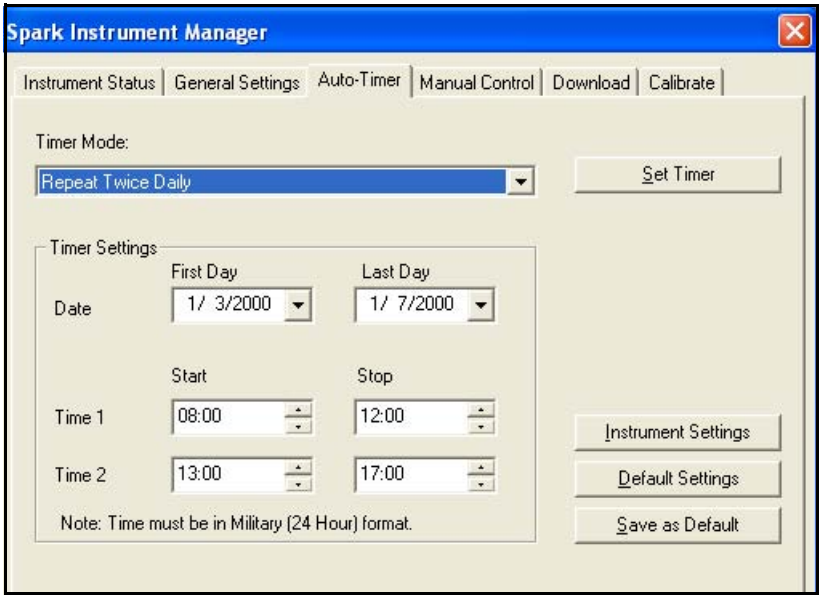

Use the **Timer Mode** popup field to select one of the following timer modes: Timer Off, Block Timer, Repeat Once Daily, Repeat Twice Daily

.

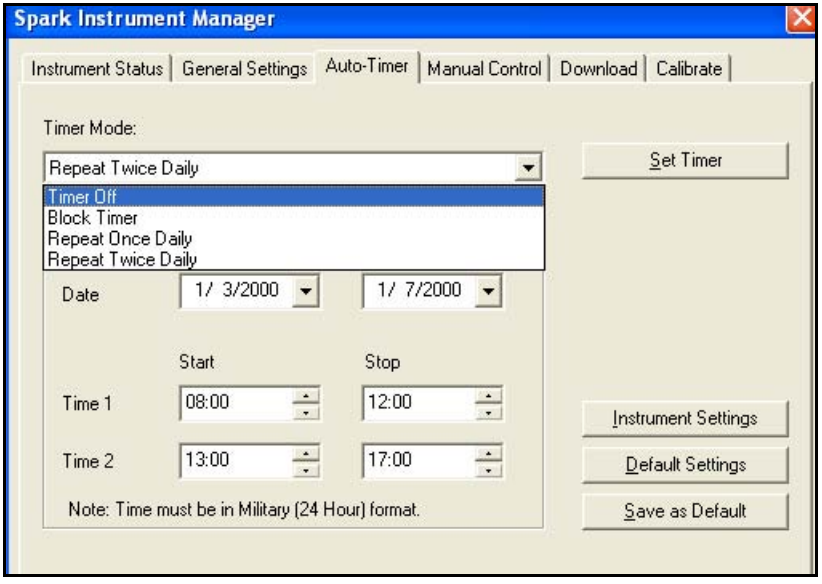

Timer Off

This is used to turn off the automatic timer and must be done if you need to start and stop the Spark®-ATEX instrument manually (this is done in the **Manual Control** tab).

Block Timer

You can establish both a start date and start time and an end date and end time of a measurement by selecting **Block Timer** from the pull down menu.

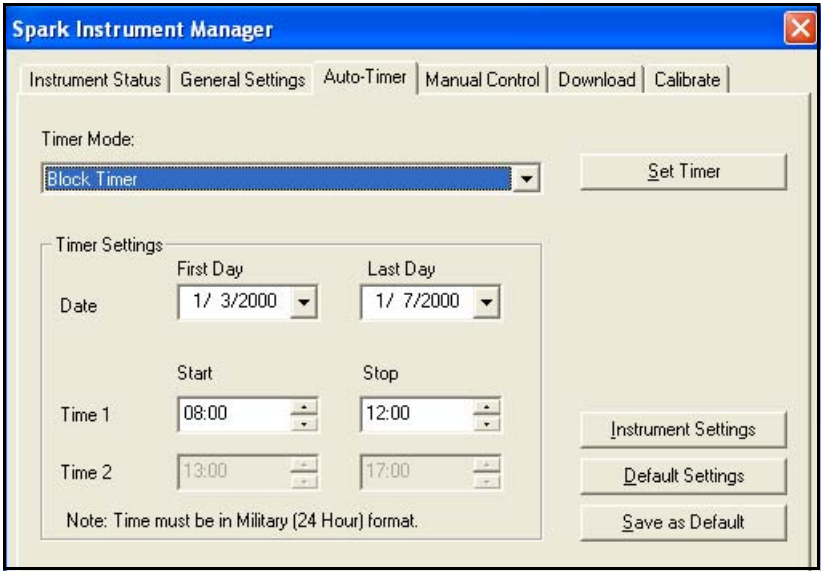

Once the Block Timer is selected, the appropriate Start/Stop dates and times can be selected using the Date and Time

pull-down menus. Select the Dates by clicking in the calendar.

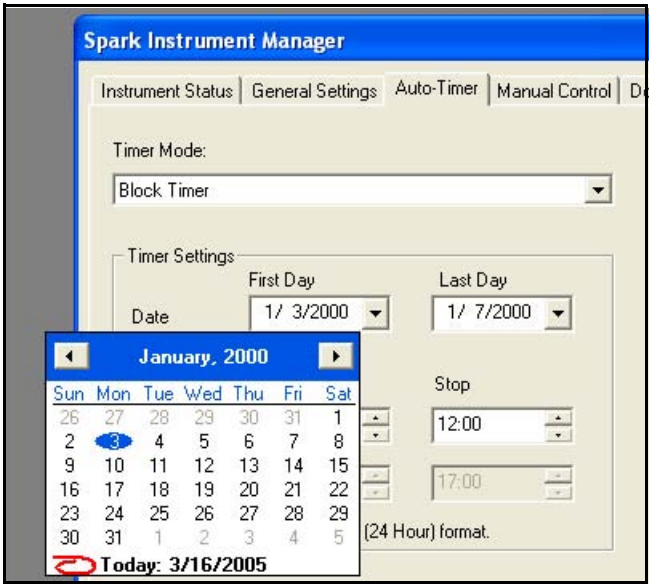

Times are chosen by using the Start/Stop Time fields. Click on the hour and use the up and down arrows to increment to the desired hour. The same process is used for the minute and seconds selection.

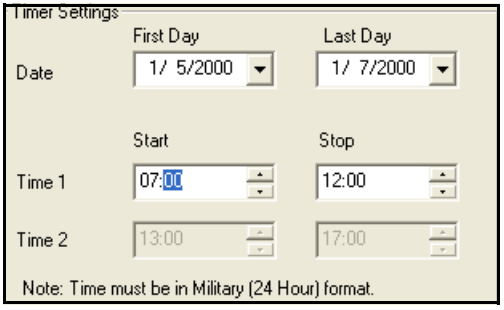

The Spark®-ATEX instrument will run continuously from the Start Date/Time to the Stop Date/Time. Setting the Repeat Once Daily and Repeat Twice Daily Auto-Timers are handled in the same way as the Block Timer.

Repeat Once Daily

Repeat Once Daily mode allows you to select a Start Time/ Date and a Stop Time/Date that spans several days. This mode is selected if you wish to turn on and off the Spark®-ATEX instrument automatically for a daily work shift such as 8:00 A.M. to 5:00 P.M. every day between the start and stop date the meter will turn on and off for this work shift.

While you can set the Spark®-ATEX instrument's timer mode for an extended period of time, be certain there is enough battery life to complete the test. You may need to change batteries in the Spark®-ATEX instrument between shifts.

Repeat Twice Daily

Repeat Twice Daily provides a means for entering two start and stop times for each day. This typically is used when you wish to disable the Spark®-ATEX instrument during the lunch hour. In this case, the start/stop time 1 might be 8:00 A.M. and 12:00 P.M. Start/stop time 2 could then be 1:00 P.M. to 5:00 P.M. The instrument would then stop gathering data between the lunch hour (12 to 1 P.M.).

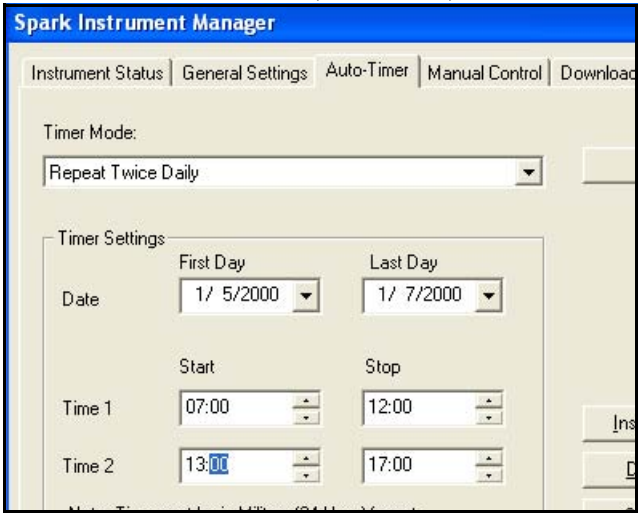

Set Timer

The Set Timer button enables the connected Spark®-ATEX instrument's automatic timer. This button sends all the settings found in the **Automatic Timer** window to the connected Spark®-ATEX instrument including the timer start and stop dates/times, and turns the timer on. At this point, you may exit the Blaze® software as the Spark®-ATEX instrument will be ready to collect data.

Instrument Settings

Pressing **Instrument Settings** interrogates the connected Spark®-ATEX instrument and downloads its Timer settings into the Auto-Timer page.

Default Settings

Default Settings recalls the previously saved Timer defaults and brings them into the Auto-Timer page.

Save as Default

If you would like to establish these Auto-Timer settings to be the "default" values, press **Save as Default**. These will now be the Timer values shown when the "Default Settings" button is pressed.

Manual Control of the Spark®-ATEX instrument

Manual Control provides a means to operate the Spark®-ATEX instrument remotely from the Blaze® software.

Step 1 Press the Manual Control tab in the Instrument Manager window.

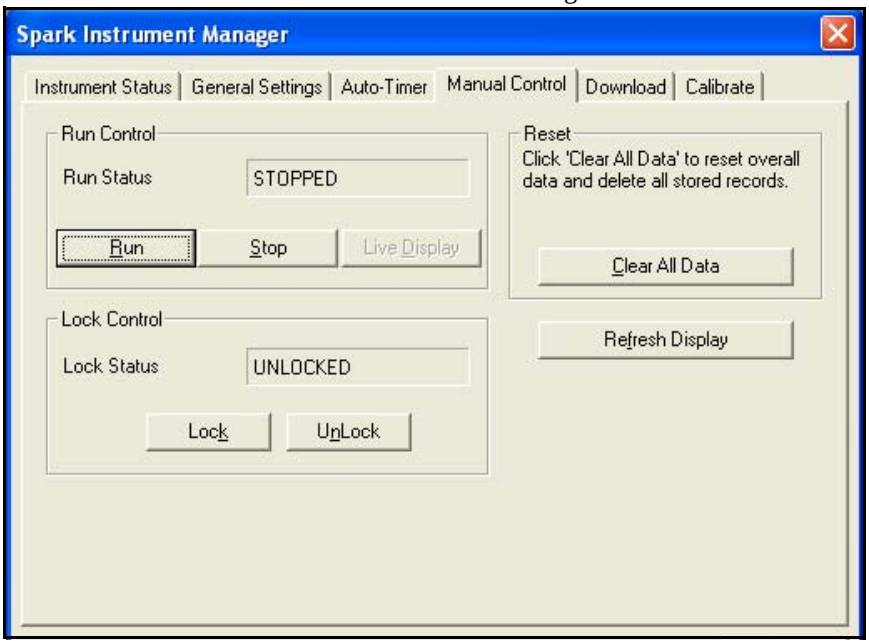

From the Manual Control page, the following operations can be performed:

- Run the Spark®-ATEX instrument
- Stop the Spark®-ATEX instrument
- Reset the data to clear the Spark®-ATEX instrument memory
- View live data (SPL, Leq, Peak, Max) in the live display
- Lock the Spark®-ATEX instrument
- Unlock the Spark®-ATEX instrument
- Refresh the Manual Control screen

Step 2 Press the **Run** button to start a measurement

Notice that the Instrument Status area in the Manual Control page has changed to “RUNNING” to indicate that the Spark®-ATEX instrument is in the run mode. Also note that

the Session Log has been updated to reflect the running status of the Spark®-ATEX instrument.

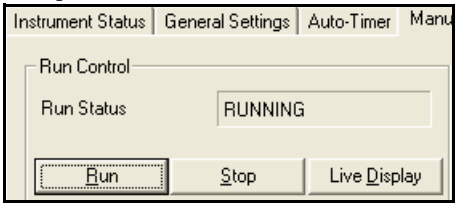

Step 3 Press **Live Display** to see a 50-second window of the running SPL (Sound Pressure Level) time history.

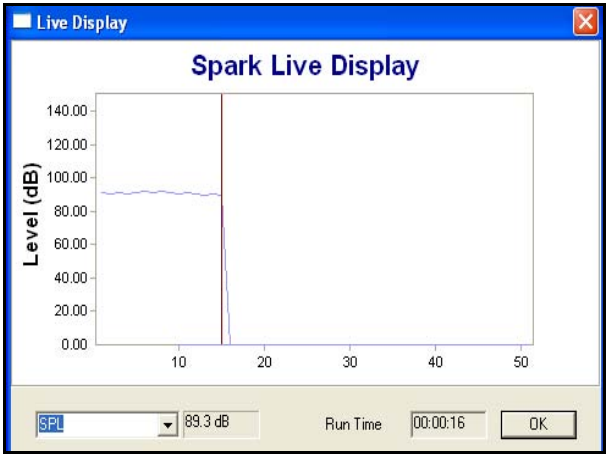

Not only can the graphical representation of the SPL be viewed, but the current SPL value in the lower left field of the Live Display window can also be seen.

Step 4 Click on the pull-down menu at the lower left corner of the Live Display.

Other parameters can also be viewed. Leq, Lmax, and Lpeak can all be viewed instead of the current SPL.

Step 5 Select **Leq.** Now the Live Display window is showing the current Leq level.

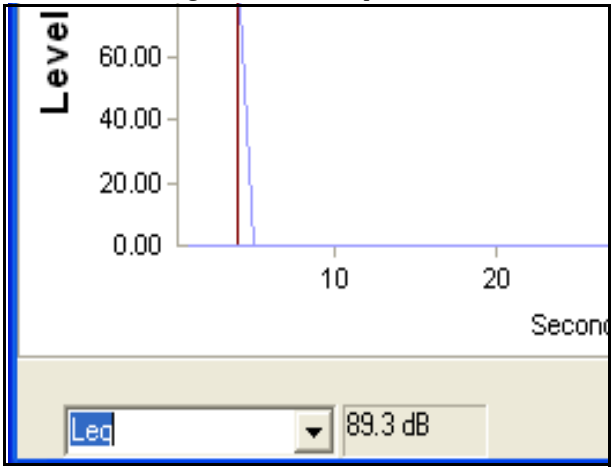

Step 6 Press OK to close the Live Display window.

Step 7 Press **Stop** to halt the Spark®-ATEX instrument.

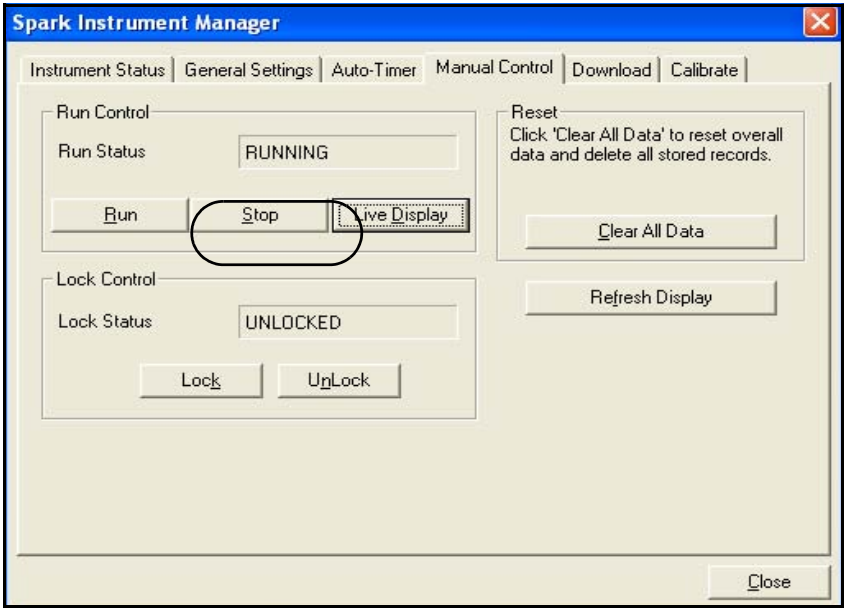

The Instrument Status area in the Manual Control page has changed to “STOPPED” to indicate that the Spark®-ATEX instrument is no longer running. Also note that the Session Log has been updated to reflect the Stop status of the Spark®-ATEX instrument.

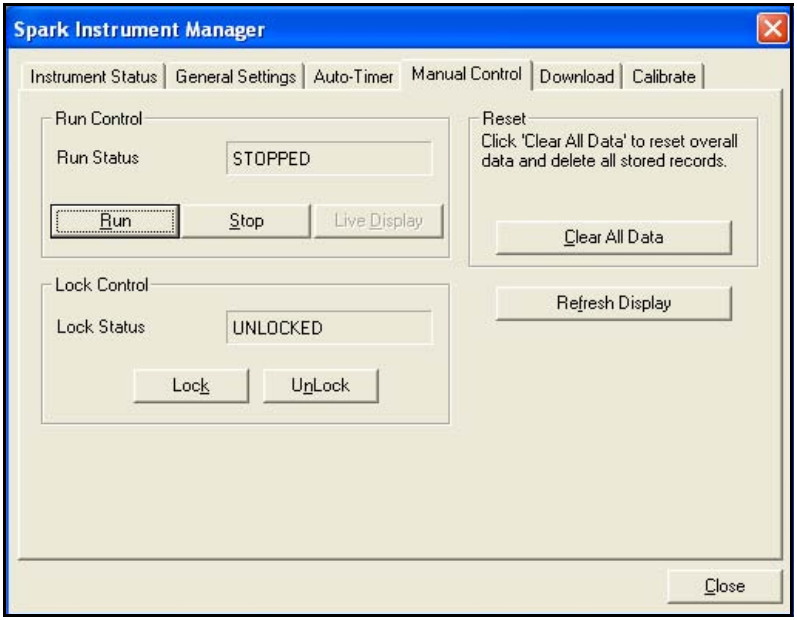

To clear the memory in the connected Spark®-ATEX instrument, press the **CLEAR ALL Data** button. This deletes the measurement data residing in the on-board memory of the Spark-ATEX instrument.

WARNING! Caution should be exercised when using this function, as deleted data cannot be recovered. Data that you wish to save should be downloaded prior to using the Reset Data function.

Setting the Lock Using Blaze®

Spark®-ATEX instruments have a very useful keypad Lock feature. When the Lock is activated, the Sparks®-ATEX display and keypad are disabled. This renders the Spark® -ATEX virtually tamperproof during operation. The Lock is activated, and deactivated by way of a 4-digit user defined password. To set the lock via Blaze®.

Step 1 Press Lock

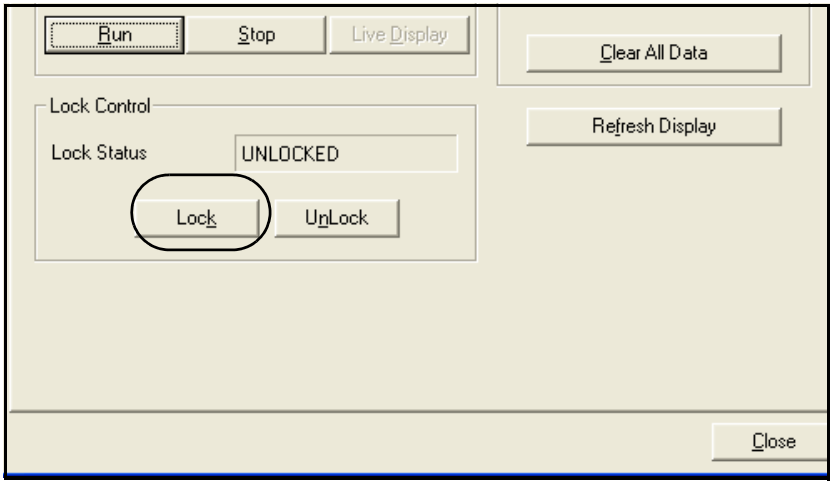

Step 2 The Set Password dialog box appears

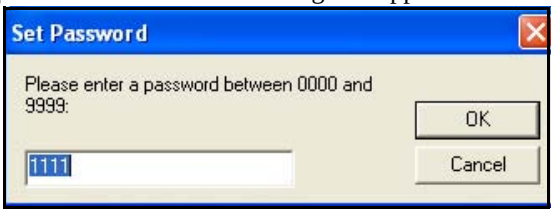

Step 3 Type in your desired password (4 digits maximum).

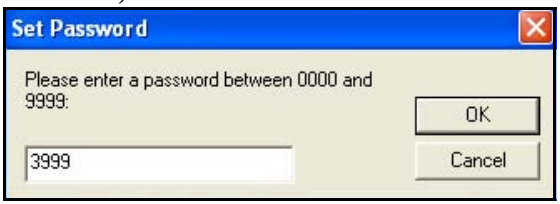

Step 4 The Spark-ATEX instrument is now locked as indicated in the Lock Status field.

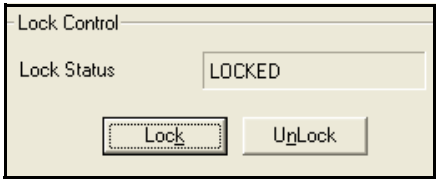

Unlocking the Spark®-ATEX Instrument Using Blaze®

From within the Blaze® Instrument Manager screen, on the Manual Control Tab, select Unlock.

The unit is automatically unlocked when connected to the software.

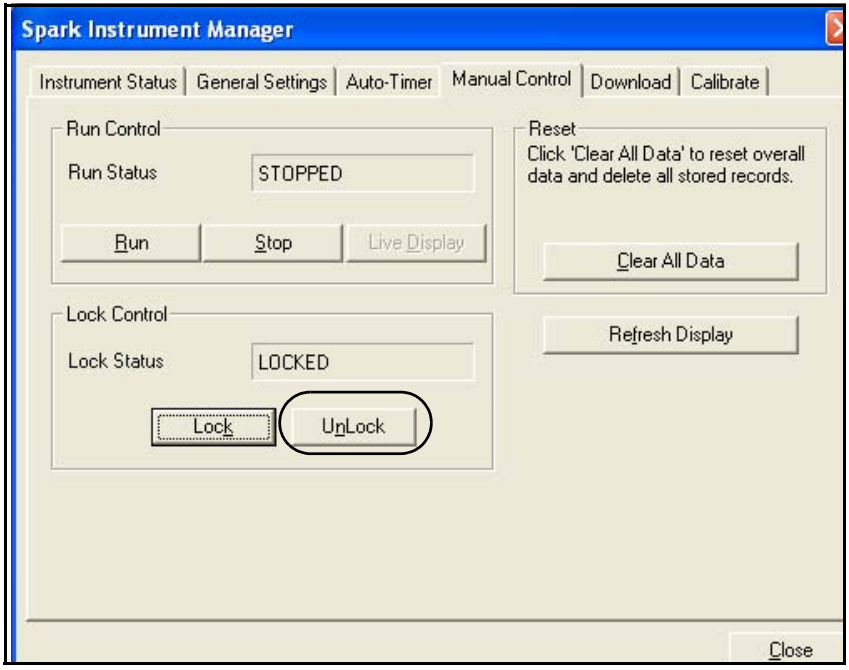

The Spark®-ATEX Lock has now been disabled as indicated in the Lock Status field

.

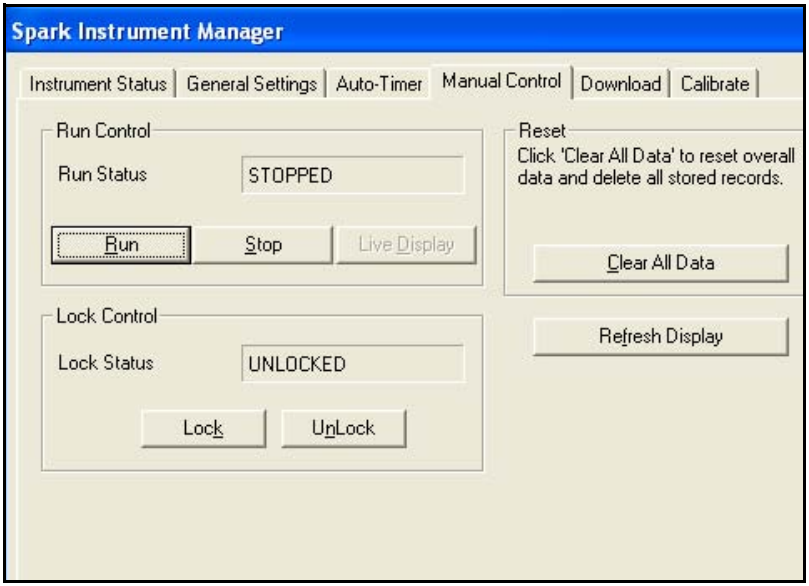

Downloading Data from the Spark®-ATEX

If download fails, see "Troubleshooting Download Problems" on page -2-109

Step 1 Press the **Download** tab to enter the Download page.

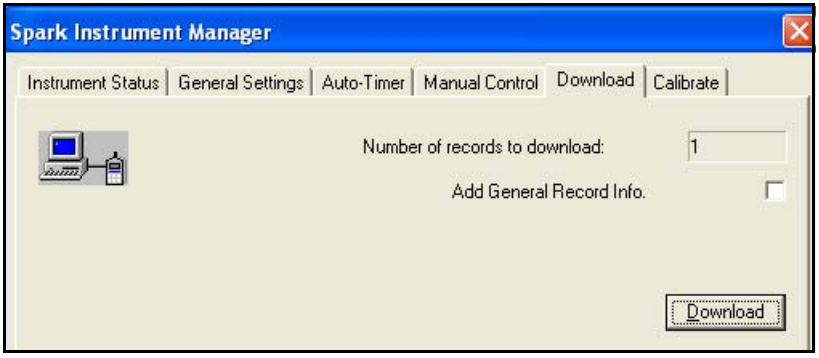

Each data record stored in the Spark®-ATEX instrument contains an Ln Table (statistics table), and a Time History table.

A data record is a measurement segment that has a distinct run and stop segment. This will typically be the work shift you are measuring (8 hours for example). The total number of data records (with its own Ln Table and Time History) is listed in the Download page. In this example, the number is 1.

Adding General Information During Download

The Download dialog box has a check box entitled “Add General Records Info” as shown below.

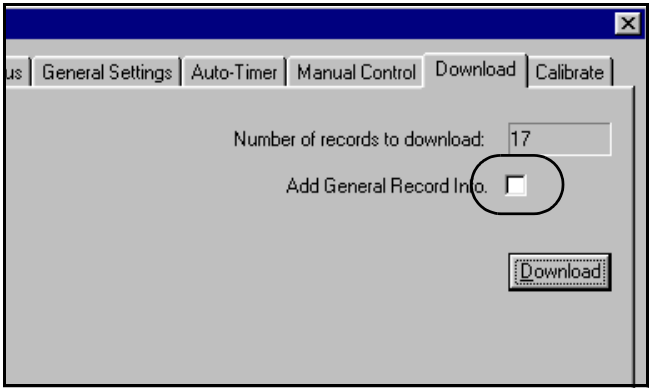

By selecting the **Add General Records Info**. box before downloading, you will be able to add general information to each of the downloaded records during the download process. As soon as the download is initiated, the following dialog box is displayed into which information can be

entered using the computer keyboard. Pressing **OK** will continue the download process.

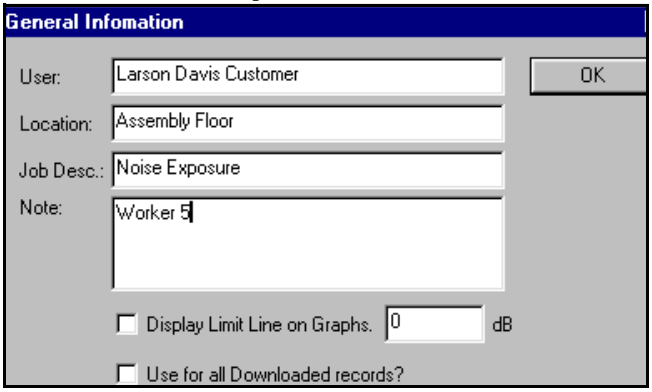

If the **Use for all Downloaded records** box is selected prior to download, this information will be stored with all downloaded records and there will be no further interruptions during the remainder of the download process.

Note: The general information stored during download can be modified later or, if it had not been added during download, it can be added later as well

If the **Use for all Downloaded records** box is not selected, the same dialog box will be opened as each record is downloaded, permitting the user to modify the general information to be stored with that particular record before the next record is downloaded.

Setting a Reference Line

The check box and data field associated with the text "Display Limit Line on Graphs" permits the addition of a reference line to a time history graph as described in the section. Setting a Reference Line on page 2-69

Step 2 Press the **Download** button to download the data from the Spark®-ATEX instrument to the PC.

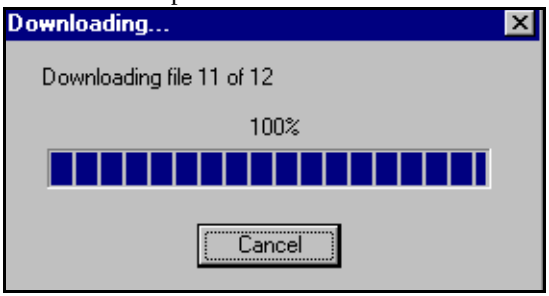

A “Data Transfer in Progress” window will appear on the screen. A horizontal bar will show the progress of the

download for each data record. When the download is complete, the following message will appear

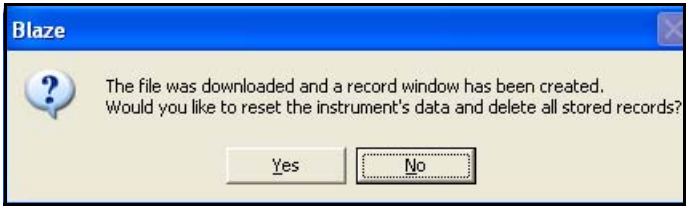
Blaze
The file was downloaded and a record window has been created.
Would you like to reset the instrument's data and delete all stored records?
Yes
No

This will indicate a successful transfer of the data records from the Spark®-ATEX instrument to the PC via the Blaze® software. Notice that the Session Log indicates that one download has occurred (along with the date and time of the download).

If the Spark®-ATEX instrument is running when ***Download*** *is pressed, the unit will stop running and the download will occur.*

If you wish to clear the Spark®-ATEX instrument internal memory at this point, press Yes. Otherwise, select No to view the Blaze® measurement summary window.

You can view the summary regardless of whether or not memory has been cleared.

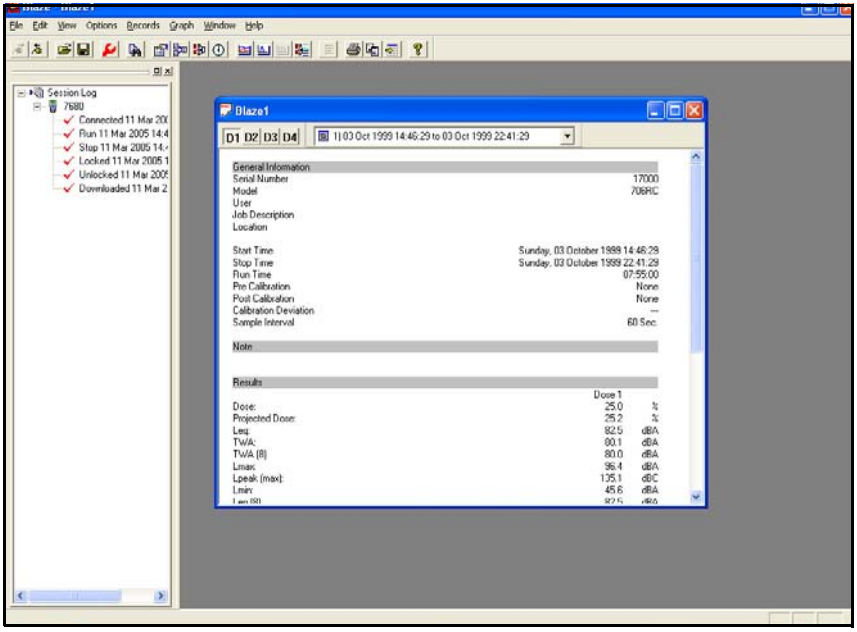

Measurement Summary

This window presents a summary of complete information from the first measurement record. This General Information section lists User, Job description, location and measurement results. This field is blank until information is entered in these fields as described in the Set Parameters section on page 2-52. Other information listed in this General Information section includes the Spark®-ATEX instrument serial and model numbers, the start and stop times for the measurement, total run time, and sample interval of the time history that was gathered.

The Results section contains the Dose, Projected Dose, Leq, TWA (Time Weighted Average), SE, Peak, Lmax, Lmin, and overload status for the active measurement. See Appendix B for a more detailed explanation of these metrics.

Results	Dose 1	
Dose:	---	%
Projected Dose:	---	%
Leq:	48.2	dBA
TWA:	---	dBA
TWA (8)	---	dBA
Lmax:	72.1	dBA
Lpeak (max):	---	dB
Lmin:	45.5	dBA
Lep (8)	50.6	dBA
SE:	0.0	Pa²hr
Overload?		No

Selecting Display of Dose Data

The measurement summary window can display data for all four dose setups simultaneously as shown below.

Results

	Dose 1	Dose 2	Dose 3	Dose 4	
Dose:	25.0	56.2	58.5	67.6	%
Projected Dose:	25.2	56.8	59.1	68.3	%
Leq:	82.5	82.5	82.5	82.5	dBA
TWA:	80.1	82.5	81.2	81.8	dBA
TWA (8)	80.0	82.5	81.1	81.7	dBA
Lmax:	96.4	96.4	96.4	96.4	dBA
Lpeak (max):	135.1	135.1	135.1	135.1	dBC
Lmin:	45.6	45.6	45.6	45.6	dBA
Lep (8)	82.5	82.5	82.5	82.5	dBA
SE:	0.6	0.6	0.6	0.6	Pa^2hr
Overload?					No

The display of these dose data is controlled by the Dose Display toolbar at the upper left of the measurement summary window, shown larger below.

The measurement summary will display data for those doses whose corresponding buttons in this toolbar are highlighted. Each time a button is clicked, it's status will change from highlighted to not-highlighted. If no buttons are selected, it will display the dose selected in the Set Parameter dialog box.

The Modified Results section of the summary contains the Modified Leq and Modified Peak information. This section of the report will only be visible if the Results of the measurements are modified. If no parameters are modified,

then this section will not be visible. These values are derived from editing the Time History.

Modified Results		
Modified Dose		---
Modified Proj. Dose		---
Modified LEQ	41.4	dBA
Modified TWA		---
Modified SE	0.0	Pa^2hr
Modified Lmax	44.0	dBA
Modified Max Lpeak	~0.0	dBC
Modified Lmin	0.0	dBA

The Statistics section contains five Ln values including L10, L30, L50, L70, and L90. These values can be modified so that other Ln values can be computed.

Statistics		
L10	59.5	dBA
L30	59.5	dBA
L50	59.5	dBA
L70	59.5	dBA
L90	59.5	dBA

The Settings section show the dose settings that were established in the General Settings of the Spark®-ATEX instrument. These include the Exchange Rate, Threshold, Criterion Level, and Criterion Duration. In addition, the RMS Weighting, the Peak Weighting, the Detector rate settings are shown.

Settings		
Exchange Rate	3	
Threshold	80	dBA
Criterion Level	80	dBA
Criterion Duration	8	hours
RMS Weighting	A Weighting	
Peak Weighting	C Weighting	
Detector	Fast	
Gain	0	dB

Viewing Other Data Records

The remaining tool bar buttons are now active and used in the reporting functions of the Blaze® software

.

This pull-down menu at the top of the Data Record window, lists the downloaded data records, along with their associated start and stop dates and times.

Step 1 Click on the arrow next to the pull-down menu to view all data records.

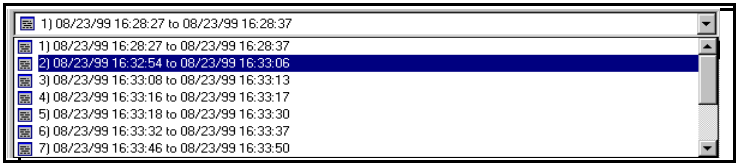

Step 2 A different data record can be selected by using the mouse pointer to highlight the desired measurement.

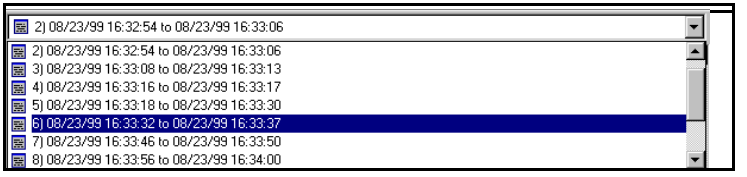

Step 3 Click the left mouse button to activate and display the selected data record.

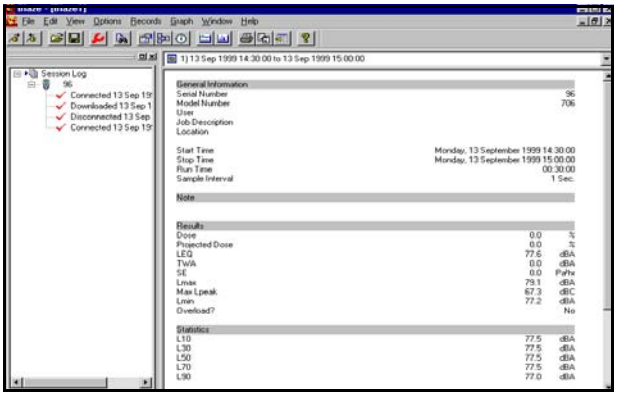

NOTE: The set parameters button will only change parameters for the currently displayed record.

Step 4 Press the **Set Results Parameters** button to view the Set Parameters window.



The Set Parameter window appears

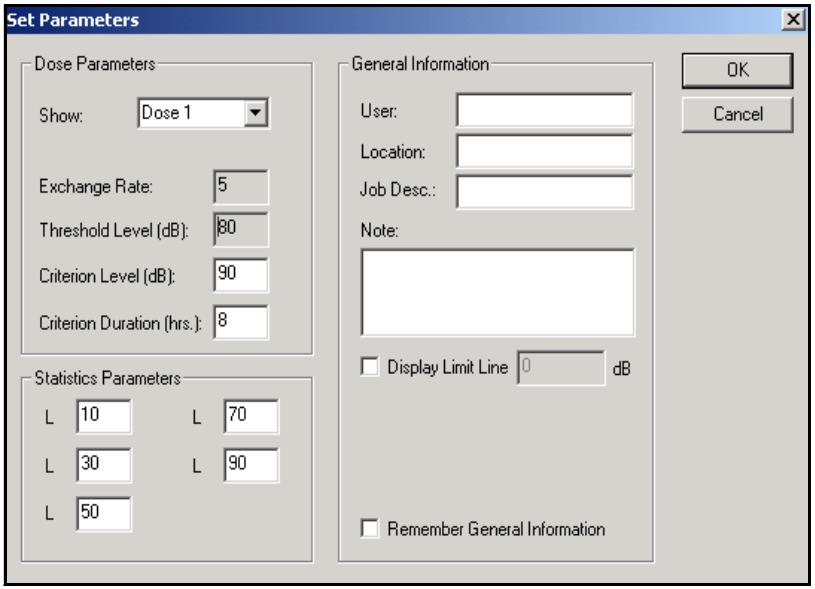

General Information

The General Information area is located on the right side of the window. This contains fields for editing or entering information such as: User, Location, Job Description, and any note you may wish to attach to the current measurement record. Click each field and type in an entry.

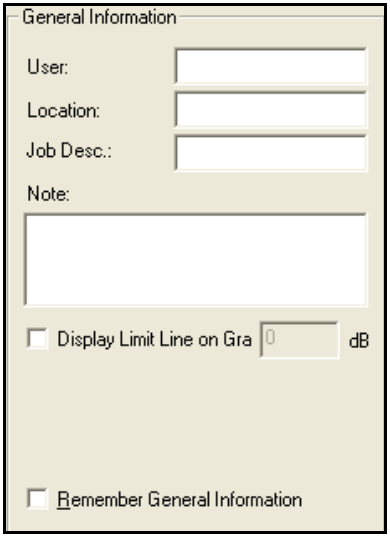

Notice that the General Information area has been updated with the information that was entered in the General Information fields.

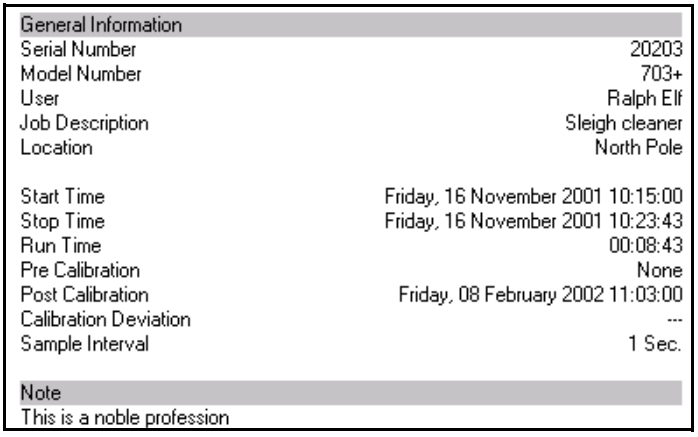

The dose, projected dose, and TWA can be from among the-ATEX 4 Dose calculations originally programmed into the Spark®-ATEX family instrument. In addition, the Criterion Level, the Criterion Duration can be modified, and the selected Dose will be recalculated using those new values.

NOTE: Only one Dose calculation may be displayed on a Data Record at a time. To show multiple Dose calculations, the reports must be printed each time individually for each new Dose Calculation.

Step 1 To select the Dose Parameters, go to the Dose Parameters section, select the pull down list next to the current Dose selection and select from Dose 1, 2, 3, or 4.

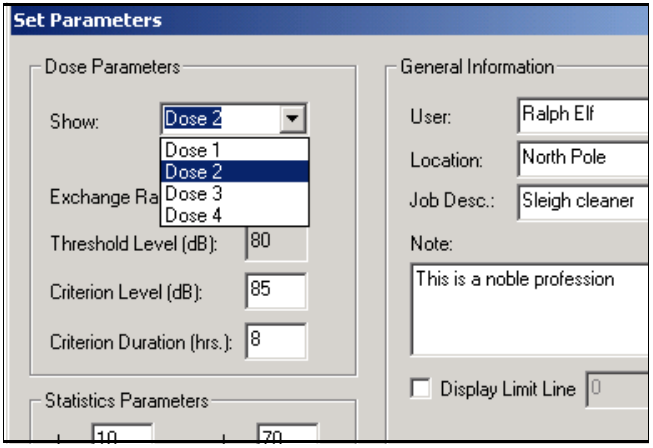

Step 2 Click **OK** to incorporate the new dose selection on the Data Record.

Results		
Dose	15.6	%
Projected Dose	794.3	%
LEQ	108.4	dBC
TWA	104.9	dBC
TWA (8)	76.6	dBC
Lmax	118.6	dBC
Max Lpeak	131.2	dBC
Lmin	59.4	dBC
Lep (8)	91.3	dBC
SE	4.4	Pa^2hr
Overload?		No

Results: These values change, based on the selected dose criterion.

Modifying The Dose Parameters

The selected Dose parameter may be modified for a different Criterion Level and a different Criterion Time.

Step 1 Open the Set Parameters window

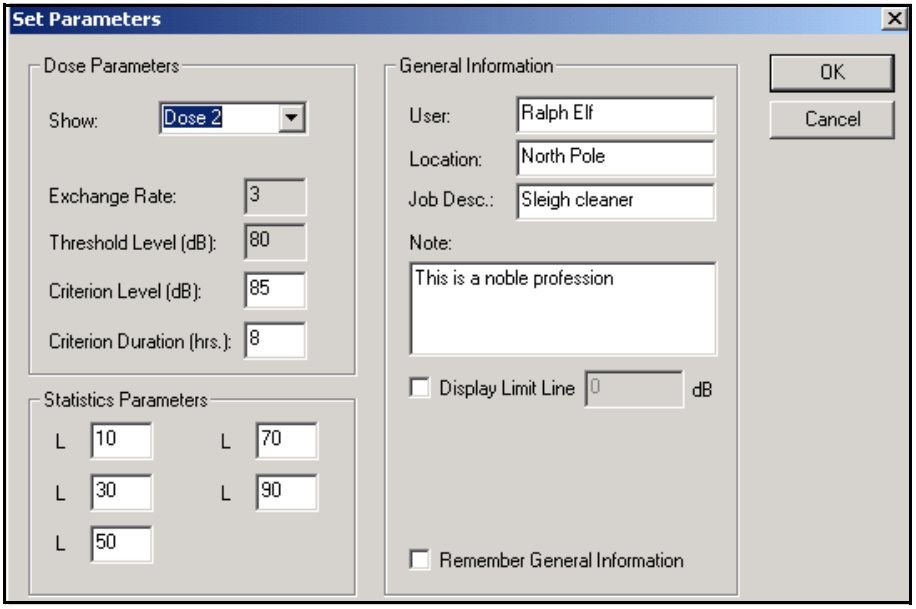

Step 2 Select the parameter you wish to change

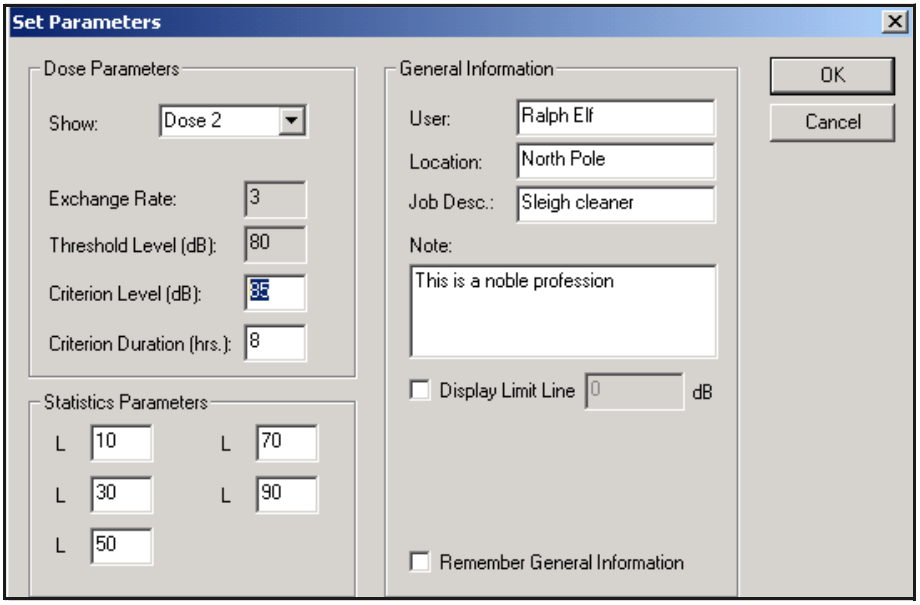

Step 3 Enter a new value and press **OK**

.

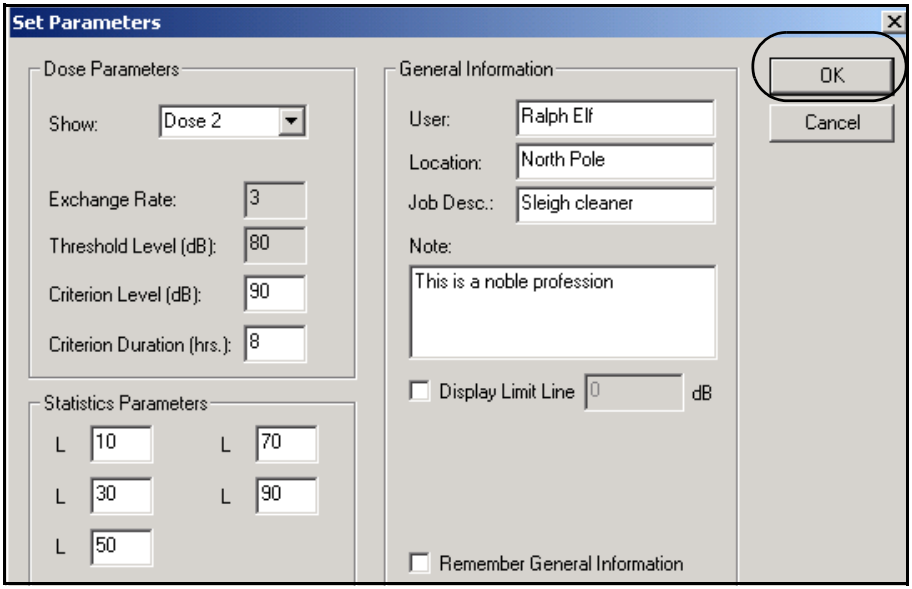

This will return you to the data record window.

Setting a Reference Line in a Time History Graph

Blaze® will allow you to define a limit line that will appear on the Time History Graph, the Summary Report time history graph, the Modified Data Report time history graph, and the Time History Detail Report graph. The limit must be set for each record.

Step 1 Left click to put a check in the check box to the left of the text "Display Limit Line on Graph", which will make accessible a data field for the entry of the value for the amplitude of the limit line.

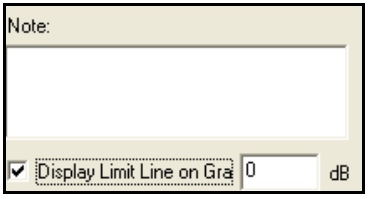

Step 2 Enter a value in the User defined Limit box (in dB).

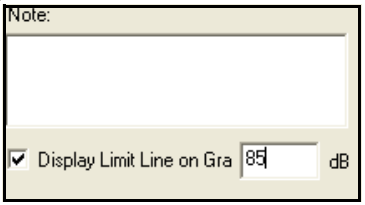

Step 3 Click **OK**.

A horizontal line will now appear when a Time History graph is created, and will also appear on the previously mentioned reports.

Merging Records

NOTE: Only records with matching settings can be merged. (i.e. Interval Period, Dose Settings, Gain Settings, etc.)

Blaze® will allow you to merge multiple data records into one data record. This would allow you to take two measurements, one before lunch and one after lunch and have the results as one continuous record.

Step 1 Click on the Merge Records Button.



Step 2 The Merge Records dialog box will appear

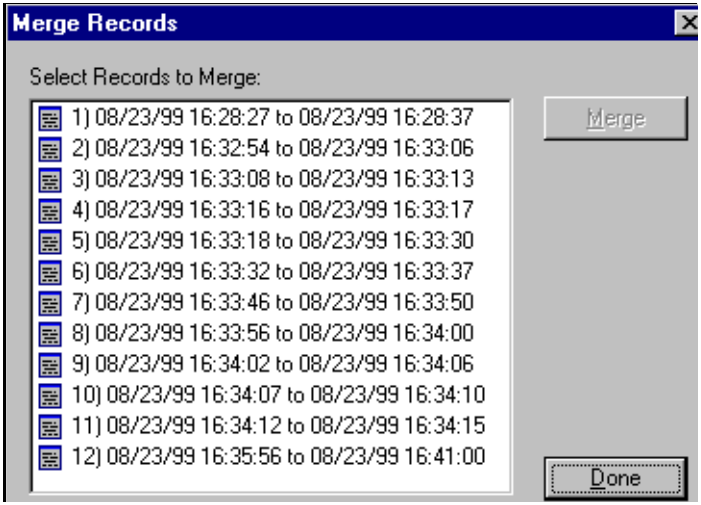

Step 3 Select the records you wish to merge. More than two records can be selected. Use the Left Mouse button to select the first record.

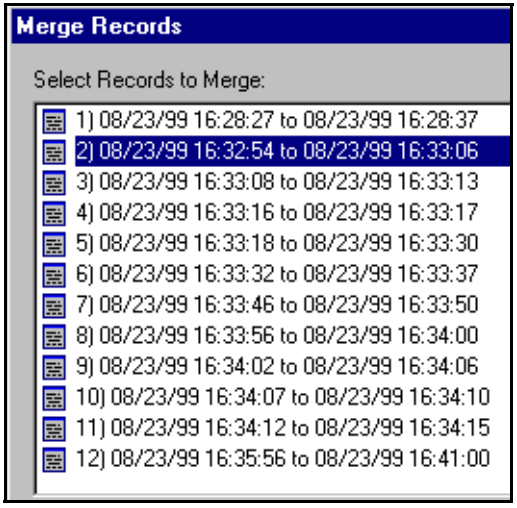

Step 4 Hold the Shift key to select the record or records adjacent to the first selected record. To select a record further down the list without selecting all of the records in-between, use the Control key instead of the Shift Key. See examples below.

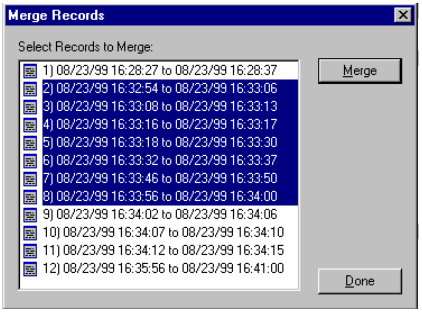

Left Mouse button plus the shift key to select adjacent records.

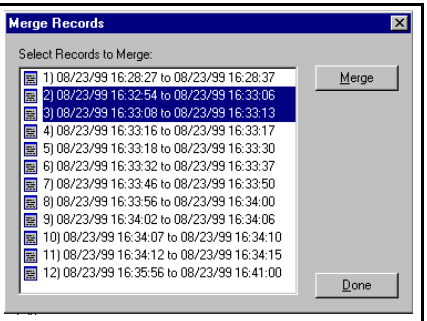

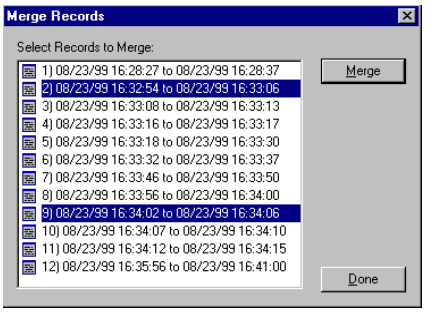

Left Mouse button plus the Control key to select two separate records.

Step 5 After selecting the desired records, Press the Merge button.

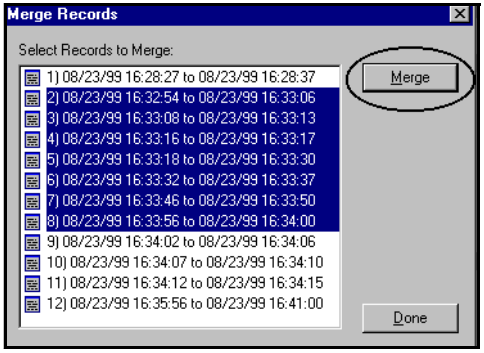

Step 6 The new merged record will now appear in the record list. Press the Done key.

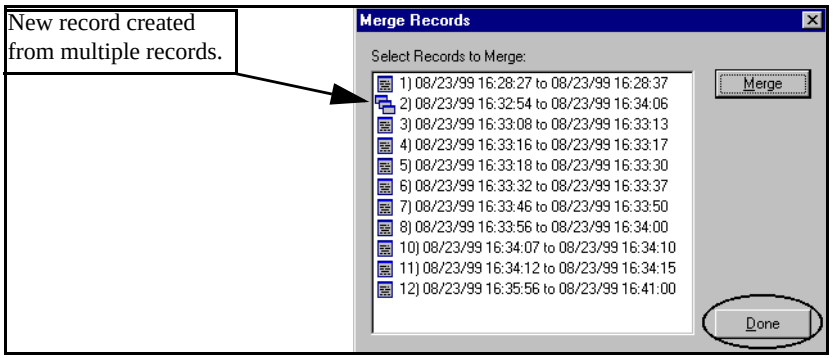

Step 7 To select the merged record for display, go to the records pull down list at the top of the Data Record window. You will now see the new merged record in the list.

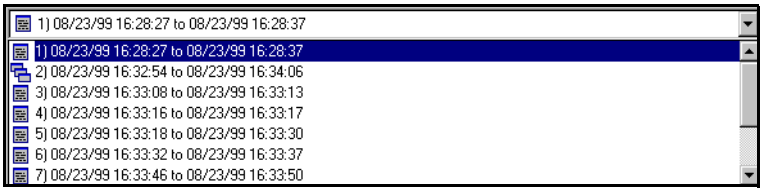

Modifying the Time History Interval

Blaze® will allow you to modify the time history interval that was originally selected on the Spark®-ATEX instrument. The Spark®-ATEX setup allows you to choose from Sample Intervals of 1, 5, 15, 30, and 60 Seconds. You can now combine the selected interval to create a longer Time History record.

Step 1 Press the Modify Time History Interval Button.



Step 2 The Modify Time History Interval dialog box will appear.

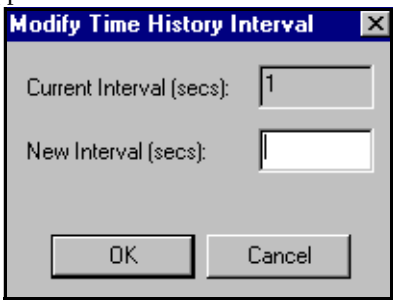

Step 3 The Current Interval will be listed in the first field.

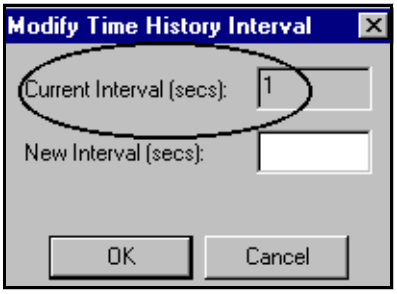

NOTE: The new sample interval must be larger than the original sample interval.

Step 4 Enter the new interval desired. In this example the Current Interval, listed in seconds, is 1 second. I want the new interval to be 10 seconds. I enter a value of 10 seconds in the box.

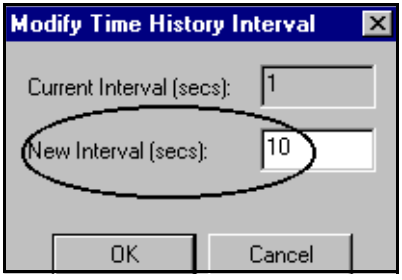

NOTE: The Time History Interval cannot be changed if the Time History has already been modified.

Step 5 Press the **OK** button.

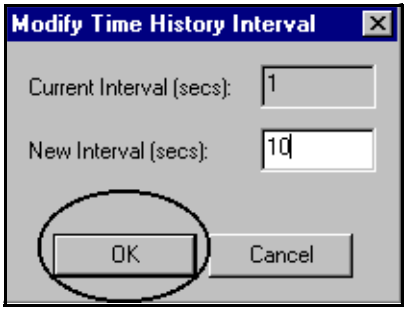

Step 6 Notice that the Sample Interval Time has now been changed in the General Information section of the Data record.

Averaging Time Histories between Different Files

The user can select different files and then select a record from each of the selected files to average together. Left click the Average File Records button to open the Select Blaze® Files dialog box.



This can also be achieved from the Main Menu by left clicking **Records** and then left clicking **Average Records from Files**. Files must be within the same directory.

After the files have been selected, clicking the Open button will display a series of dialog boxes displaying the records saved in each selected file as shown below. The user can select only one record from each file.

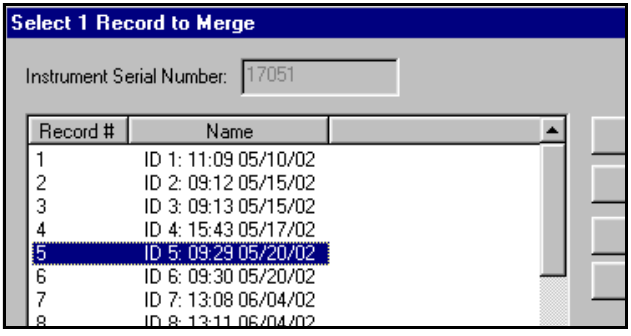

Beginning with the first file selected, once a record has been selected, a dialog box for the next file will automatically be displayed when the Next button is clicked or the entry is double clicked. The Finish button will be grayed out until the last file is opened, at which time it will appear and the Next button will be grayed out. The Back button is grayed out when the dialog box for the first file is open, but it will appear subsequently for the later files in case the user wishes to change the record selected for one of the files earlier in the selection sequence. The serial number of the instrument from which the file was downloaded will be displayed.

Each selected record must have the same sample interval, weighting, detector, gain, peak weighting, and the same parameters for each dose. They must also have the same beginning and ending times. There are two methods which will ensure that these last criteria are satisfied:

A. Set the timers for all Spark-ATEX units to start and end at the same time.

B. Modify existing records by cropping the non-overlapping data from each desired record, save it in a new file and then perform the averaging of records from different files.

The averaged record will be an average of all the Leq and TWA values for the selected records for the time interval as described above with the Lmin, Lmax and peak values, if present, set appropriately). The new record can be saved in a new blaze (.blz) download file.

Time History Graph

Step 1 Click the **Time History** button to view a time history of the current measurement record.



The Time History graph of the Leq, Max, and Peak Data can now be viewed.

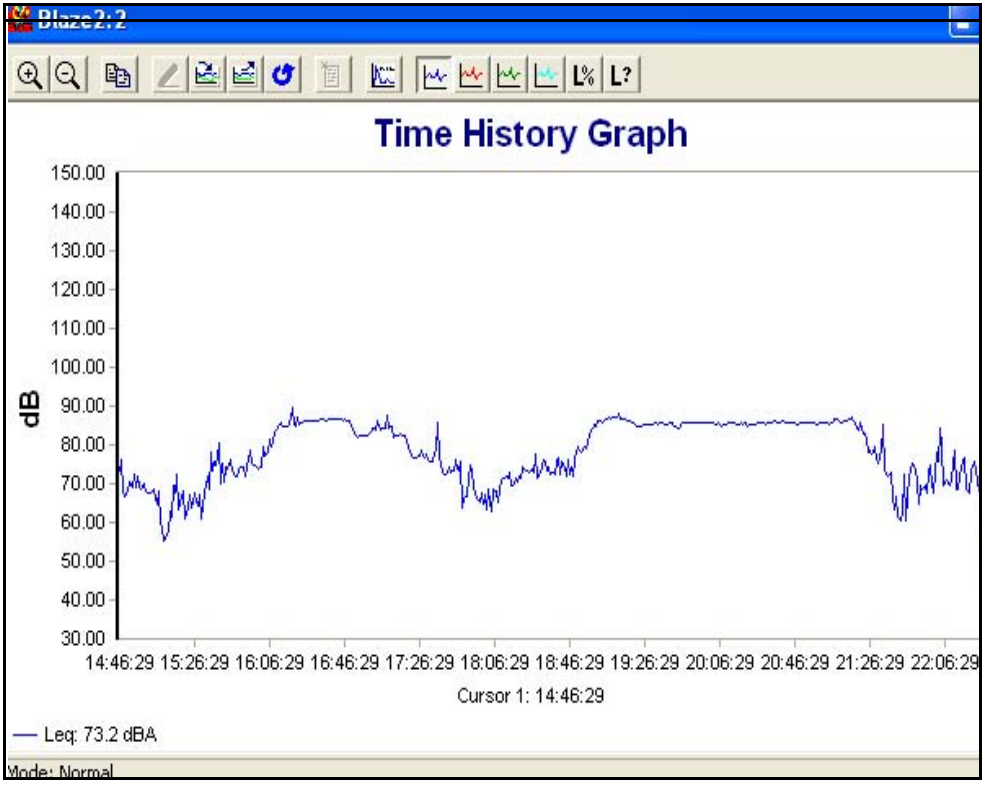

If the microphone is disconnected, the instrument will place a note in the status byte of each time history record until the problem is corrected. This will let the user know that the measurement was corrupted.

New tools are associated with the Time History graph

.

The Time History toolbar includes a number of useful functions including:

	The Zoom In button allows the user to draw a box around a specific part of the data, and Blaze® will zoom in on the specific data.
	The Zoom Out button reverses the action of the Zoom In button, and takes you all the way out to 1:1.
	The Copy To Clipboard button copies the graph to the clipboard to make it available for pasting to another document.
	The Edit Time History data section allows the user to add or subtract an amount from a region selected by the cursors. It will bring up the following dialog box, where the amount can be entered as a positive or negative value. 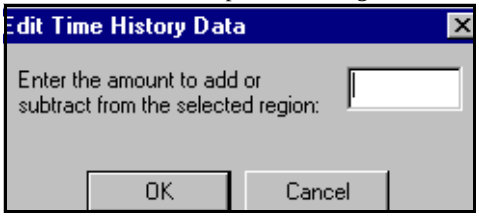 After entering a value, press **OK**. The value will then be added to the area defined by the Left and Right cursors.
	The Included Selected data button will include the data selected by the Left and Right Cursors.
	The Exclude Selected data button will exclude the data selected by the Left and Right Cursors.
	The Restore all data button will restore all excluded and edited data back into the Time History graph.

	Creates a new record from the selected data.
	This button will allow you to add a note to the Time History graph.
	The Leq button will display the Leq trace on the Time History Graph. It will have a dark blue trace.
	The Max button will display the Max trace on the Time History Graph. It will have a red trace.
	The Peak button will display the Peak trace on the Time History Graph. It will have a dark green trace.
	The TWA button will display the TWA trace on the Time History Graph for the currently selected Dose Calculation. It will have a light blue trace.
	The Ln Data button displays a dialog box used to set the Ln value, and its interval, to display on a time history graph
	The Set Ln button toggles the display of the selected Ln value on the graph with the selected interval

Zooming

The Zoom In function allows you to investigate details of the Time History by “magnifying” selected sections of the measurement.

Step 1 Click on the “+ magnifying glass” on the Time History toolbar to select the zoom tool.

Step 2 At a desirable place within the Time History graph, click and hold down the left mouse button and draw a box around the desired zoom location.

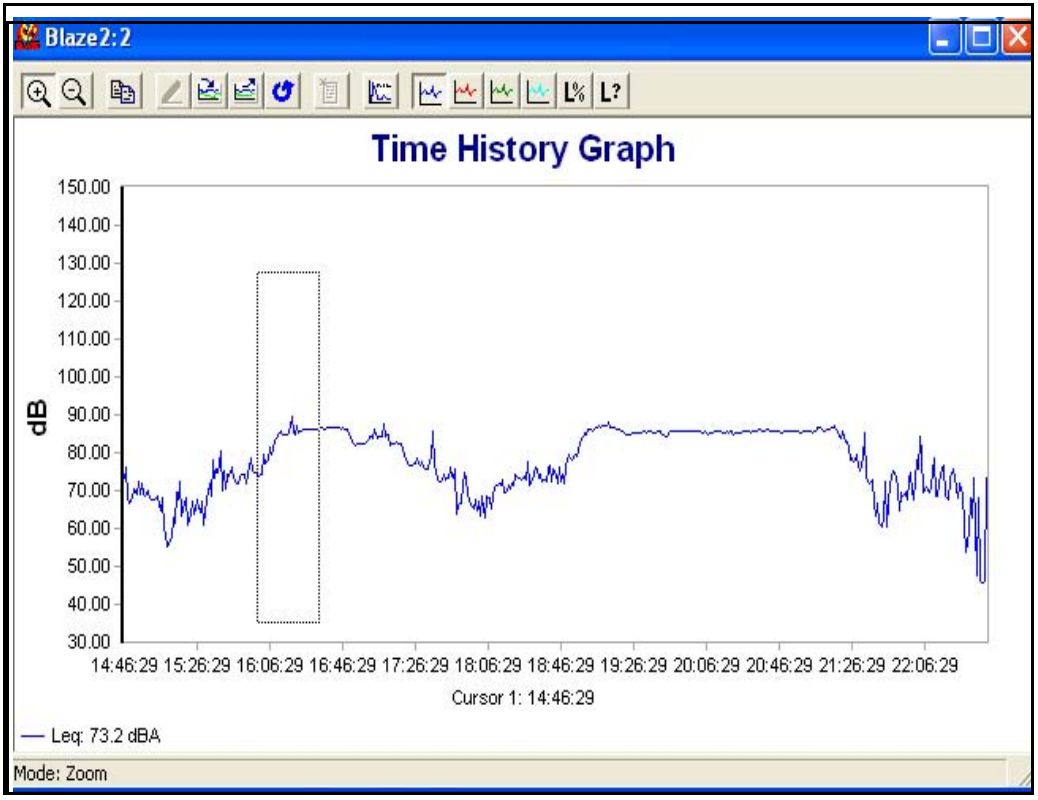

Step 3 Release the left mouse button to execute the zoom.

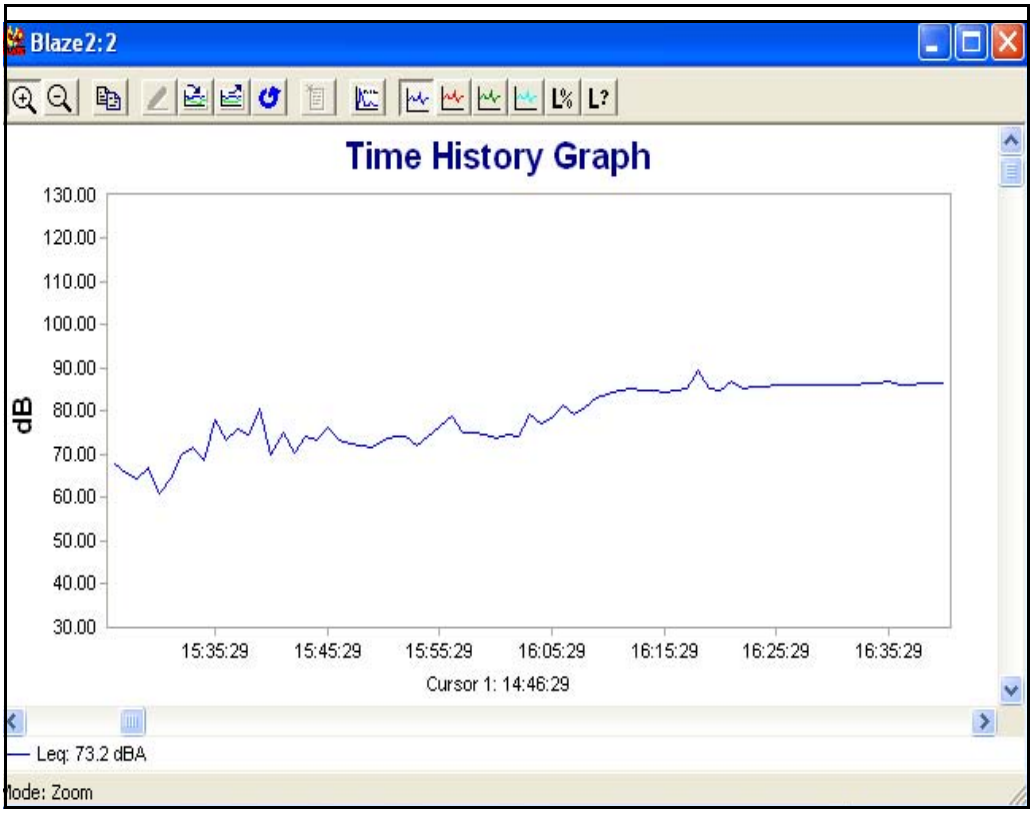

Further zooming can be achieved by repeating the above procedure.

Zoom Out

Zoom out returns a “zoomed” Time History to its original unexpanded scale.

Step 1 Click on the “- magnifying glass” on the Time History toolbar to select the Zoom Out tool.

Step 2 You will be automatically zoomed out to the original Time History graph.

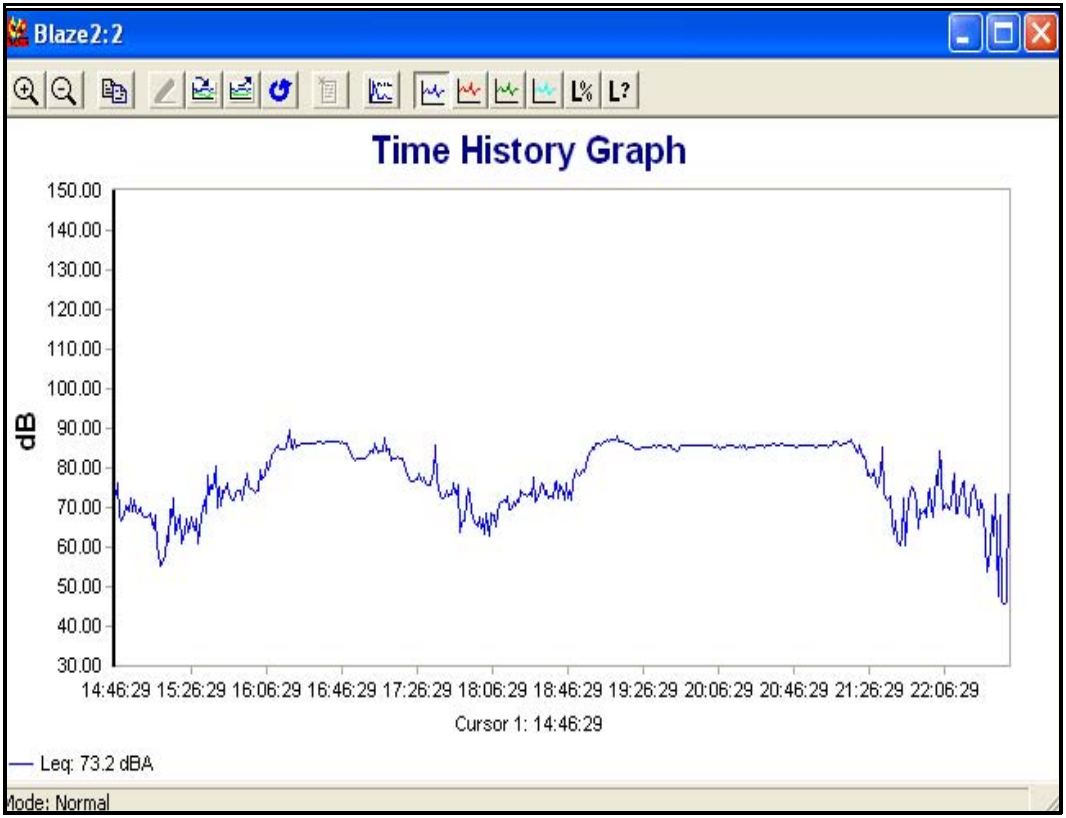

Editing the Time History

NOTE: The Cursor placement can be fine tuned by using the Left and Right arrow keys instead of the mouse.

The Time History can be edited, and the overall Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin recomputed. You can select areas to be removed from the time history using the cursors. You can also add or subtract a dB offset from within a selected section to understand the effects of noise reduction measures, hearing protection, increased noise sources, etc. Time History Editing is a powerful tool for understanding the cause and effect of such changes.

The following editing functions are available in Blaze®:

- **Exclude** a section(s) in the Time History recomputation

- **Include** a previously excluded section(s) into the Time History recomputation
- **Restore** the Time History to its original unedited state
- **Define the Amount** (in dB) to add/subtract from a selected Time History section

When excluding data from a record, you may choose to include the time span for the excluded data in the Leq and TWA calculations or you may choose to compress the time by excluding the time as well as the data for the excluded range(s) in the record. This is done by selecting the appropriate radio button under the "Include/Excluded Time" heading as shown.

Modifications made to the time history remain separate from the original time history data. After making changes to the time history, each measurement record will then contain two time histories: the original time history and the modified time history. As changes are made to the time history, a new Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin will be calculated for the modified data. The results of modifications to the time history are displayed both in the Time History graph window and the Modified Results section of the Measurement Summary window.

Setting a Reference Line

Blaze® will allow you to define a limit line that will appear on the Time History Graph, the Summary Report time history graph, the Modified Data time history graph and the Time History Detail Report graph. The limit must be set for each record.

Step 1 Click on the Set Preferences button.

Step 2 Enter a value in the User defined Limit box (in dB) in the Set Preferences dialog box.

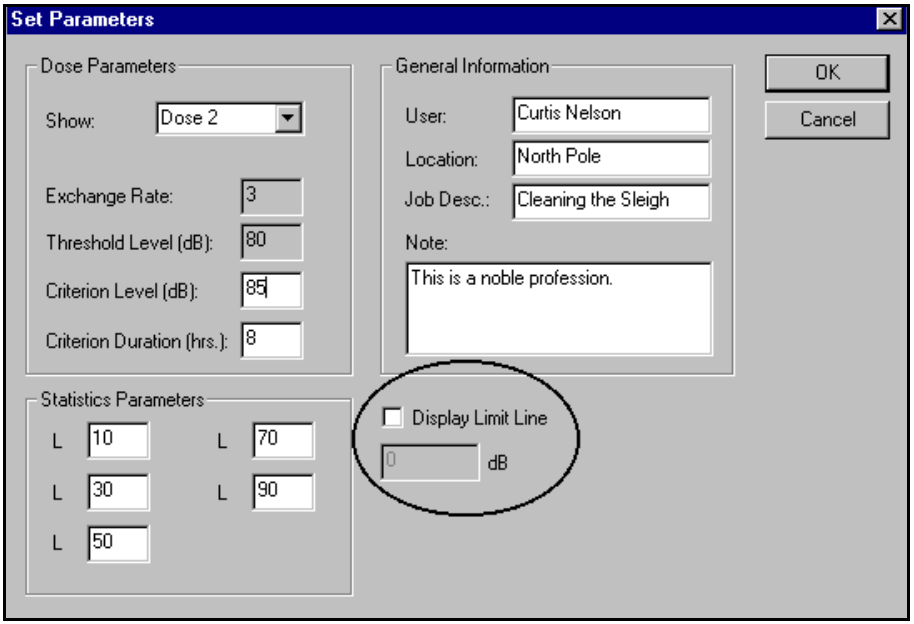

Step 3 Click on **OK**.

A horizontal line will now appear when a Time History graph is created, and will also appear on the previously mentioned reports.

Excluding Sections from the Record's Time History

This powerful analysis feature provides the ability to exclude a section(s) from the overall Leq and dose calculations. It allows you to exclude anomalous data (like a slamming door) that skews the overall Calculations.

Time History can be edited, and the overall Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin will be recomputed. This is achieved by selecting or highlighting a section of the time history, then recomputing the Leq without the highlighted section's contributions. To exclude a section:

Step 1 Within the time history graphic, click the left mouse button (above the line graphs) to select the left most area you wish to remove from the overall Leq computation.

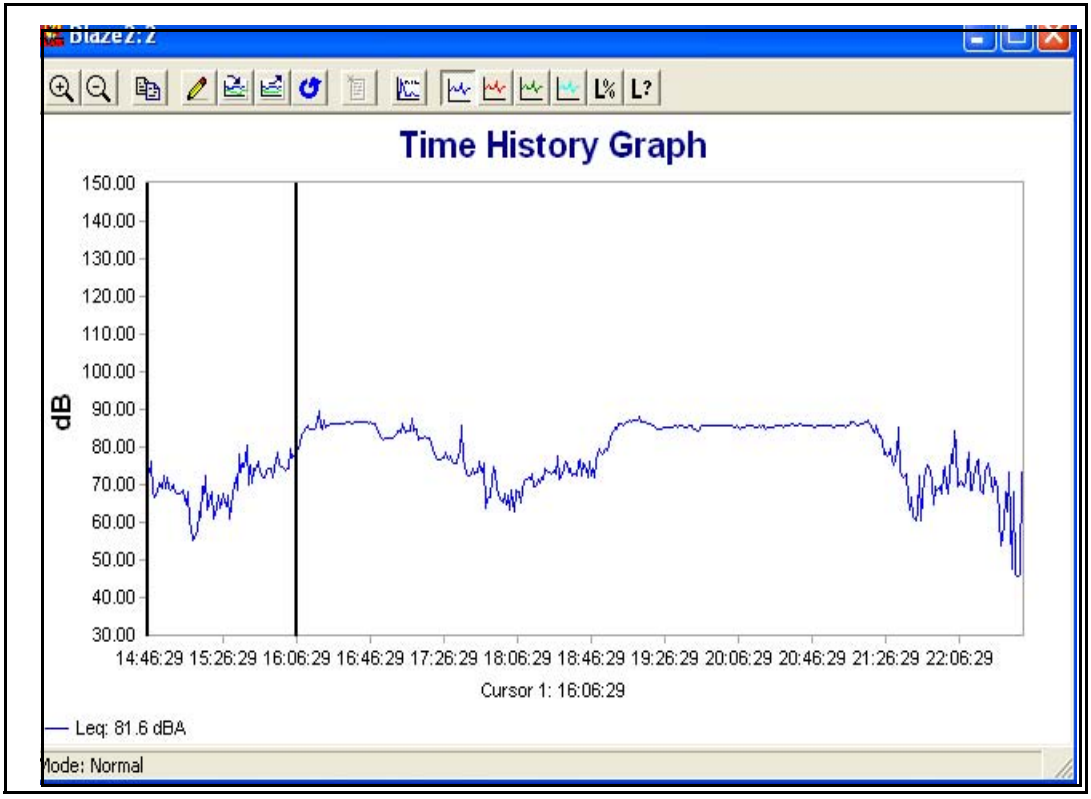

Step 2 Move the mouse to the right most point you wish to remove from the Leq calculation, then click the right mouse button (above the line graphs).

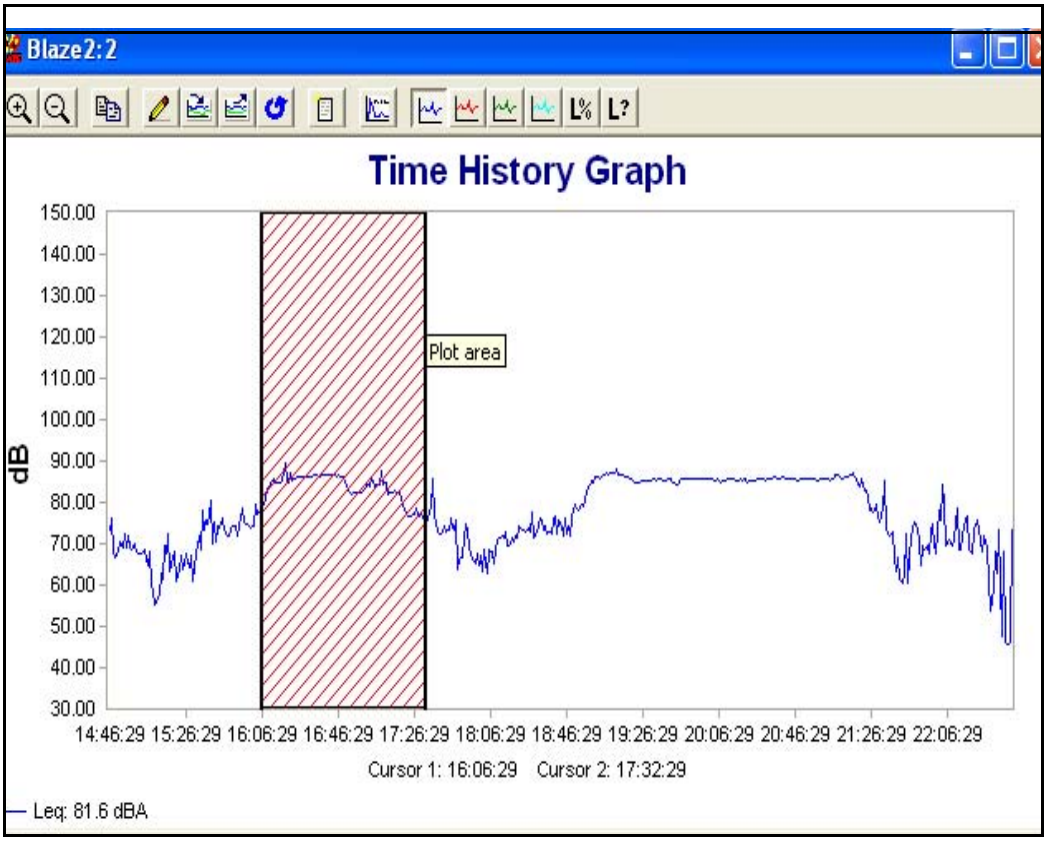

Step 3 Press the **Edit Exclude** button on the toolbar.

The Exclude dialog box will appear.

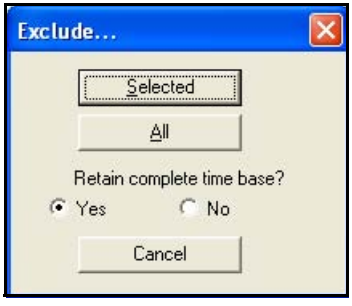

Exclude All *removes the entire Time History from the Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin computation.*

Step 4 Click the **Selected** button.

The selected section will now be removed from the overall calculations. You can view the effect this had by looking at the Modified Results area of the Measurement Record. You can do this by closing or resizing the Time History window. Compare the results with the Modified Results to see the effect of removing the section from the Time History.

Results		
	Dose 1	
Dose:	25.0	%
Projected Dose:	25.2	%
Leq:	82.5	dBA
TWA:	80.1	dBA
TWA (8)	80.0	dBA
Lmax:	96.4	dBA
Lpeak (max):	135.1	dBC
Lmin:	45.6	dBA
Lep (8)	82.5	dBA
SE:	0.6	Pa²hr
Overload?		No
Modified Results		
Modified Dose:	17.4	%
Modified Proj. Dose:	17.6	%
Modified LEQ:	81.1	dBA
Modified TWA:	77.5	dBA
Modified TWA (8):	77.4	dBA
Modified Lmax:	96.4	dBA
Modified Lpeak (max):	135.1	dBC
Modified Lmin:	45.6	dBA
Modified Lep (8):	81.0	dBA
Modified SE:	0.4	Pa²hr
Statistics		
L10	86.0	dBA

In this case, the dose changed from 25% to 17.4%. The Leq changed from 82.5 to 81,1. If you wish, additional modifications can be made to the Time History by repeating Steps 1-4.

Adding/Subtracting dB Values from Selected Sections

Closely related to the Exclude option is the Edit Value button. With the Edit button you can increase or decrease the dB level over a section of the Time History graph.

To edit a section:

Step 5 Press the Edit Value button.

The following Edit dialog box will appear:

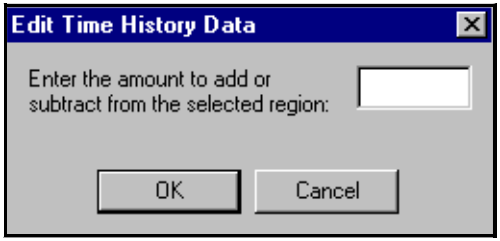

Step 6 Enter the dB level you wish to add or subtract from the interval or interval region in the ± field. Enter a minus to enter a negative number.

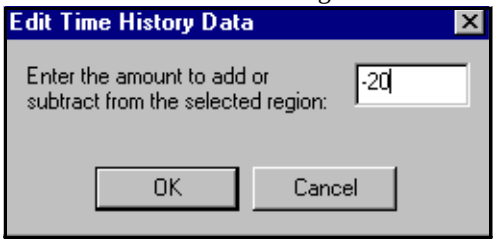

Step 7 Press **OK** to execute this operation

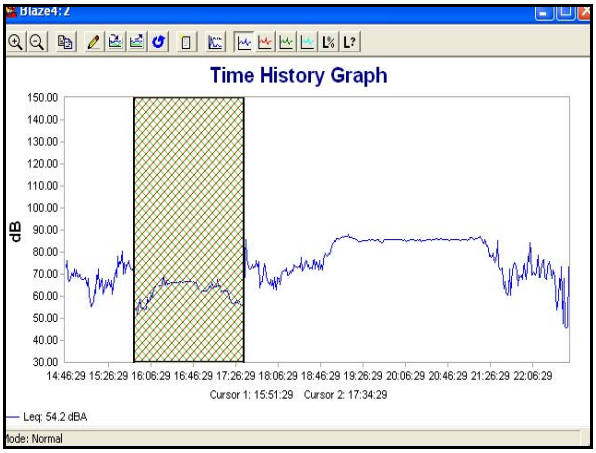

The overall Time History is re-displayed with the edited section altered. This appears as an offset in the Time History. The overall Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin will also be recomputed based on this modification. You can view the effect this had by

looking at the Modified Results area of the Measurement Record. You can do this by closing or resizing the Time History window. Compare the Results with the modified results to see the effect of removing the section from the Time History.

Results		
	Dose 1	
Dose:	25.0	%
Projected Dose:	25.2	%
Leq:	82.5	dBA
TWA:	80.1	dBA
TWA (8)	80.0	dBA
Lmax:	96.4	dBA
Lpeak (max):	135.1	dBC
Lmin:	45.6	dBA
Lep (8)	82.5	dBA
SE:	0.6	Pa²hr
Overload?		No
Modified Results		
Modified Dose:	17.8	%
Modified Proj. Dose:	18.0	%
Modified LEQ:	81.1	dBA
Modified TWA:	77.6	dBA
Modified TWA (8):	77.6	dBA
Modified Lmax:	96.4	dBA
Modified Lpeak (max):	135.1	dBC
Modified Lmin:	43.8	dBA
Modified Lep (8):	81.1	dBA
Modified SE:	0.4	Pa²hr
Statistics		

Edit Include

Edit include is used when you wish to restore a previously excluded section into the overall Leq, dose, Lmax, and Lpeak calculation. This is useful if you have excluded multiple sections of the Time History and wish to recover a single section or two while leaving other exclusions intact. This is achieved by selecting the excluded section and then using the Include tool.

Edit Restore

Restore removes all changes to the Time History and brings it back to its original, unedited state.

Create a New Record

Creates a new record from the selected data. Calculates new values based on the data selected between the cursors on the time history graph. Use your left and right mouse buttons and select the data of interest. This assists in evaluating how reduced levels would affect the overall dose and time weighted average.

Step 1 Within the time history graph, click the left mouse button to select the left most area you wish to include in the new calculation.

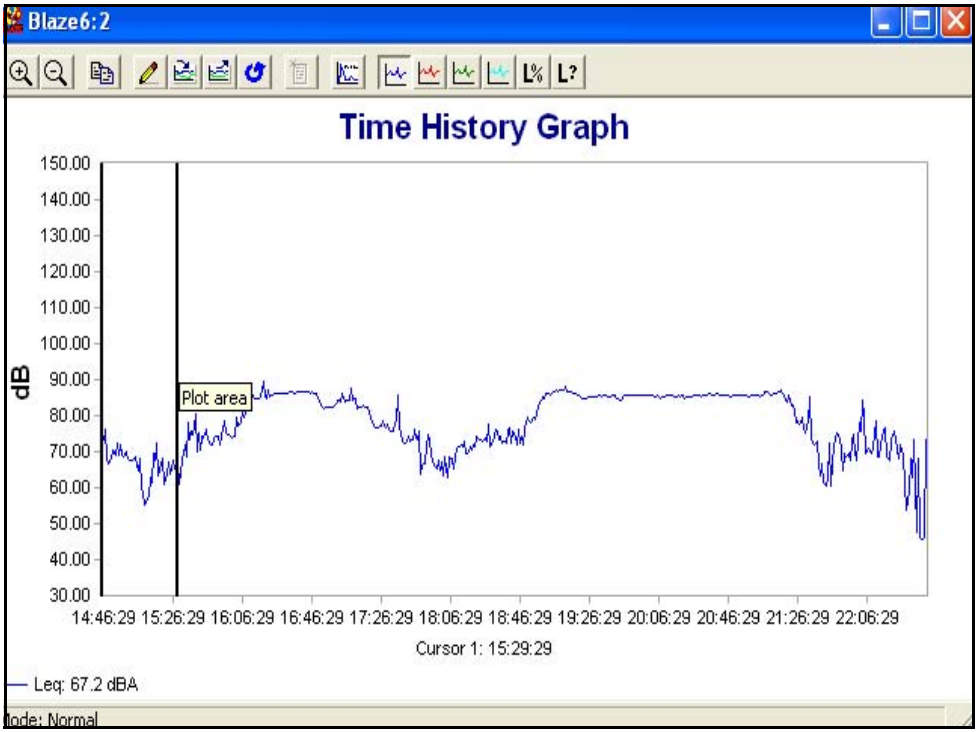

Step 2 Move the mouse to the right most point you wish to include in the new calculation, then click the right mouse button.

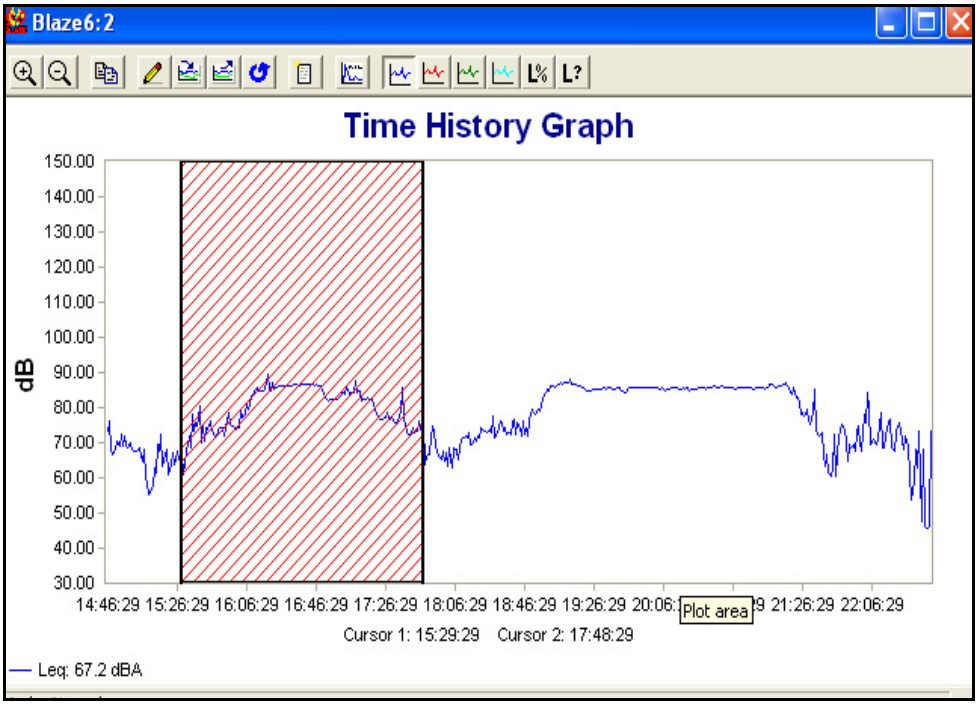

Step 3 Press the **Create New Record** button on the toolbar.

A new record appears showing the new calculated results highlighted between the cursors.

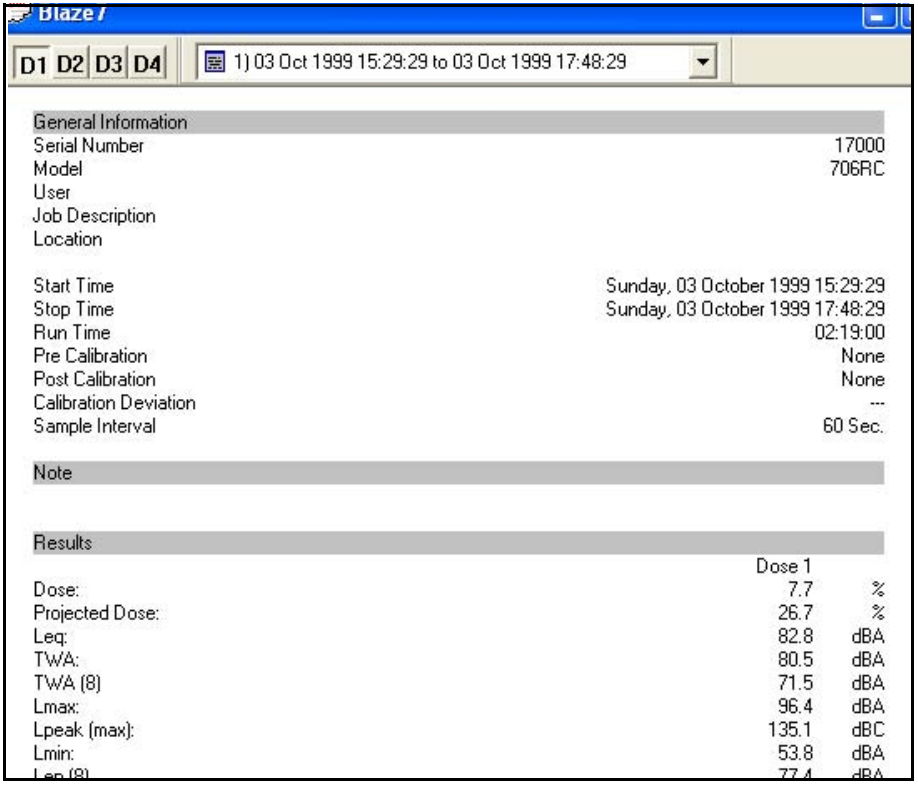

Add Note

A note can be added to the time history graph to identify problem areas or noise sources. As many notes as you want can be added.

Follow the steps below to add notes to the time history graph.

Step 1 Press the **Add Note** button on the toolbar.

Step 2 Within the time history graph, move your mouse to the area of the graph where you would like to add a note. Click the left mouse button to activate the "Annote Graph" window.

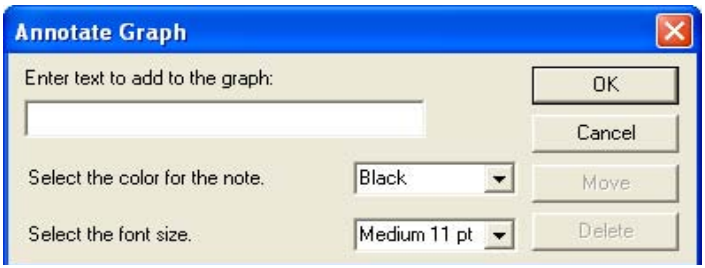

The note will appear on the graph and will only be printed on the Summary report.

Step 3 Type in the text you would like to appear on the graph. You can also select the color and size of the text. Click "OK" button when you are finished.

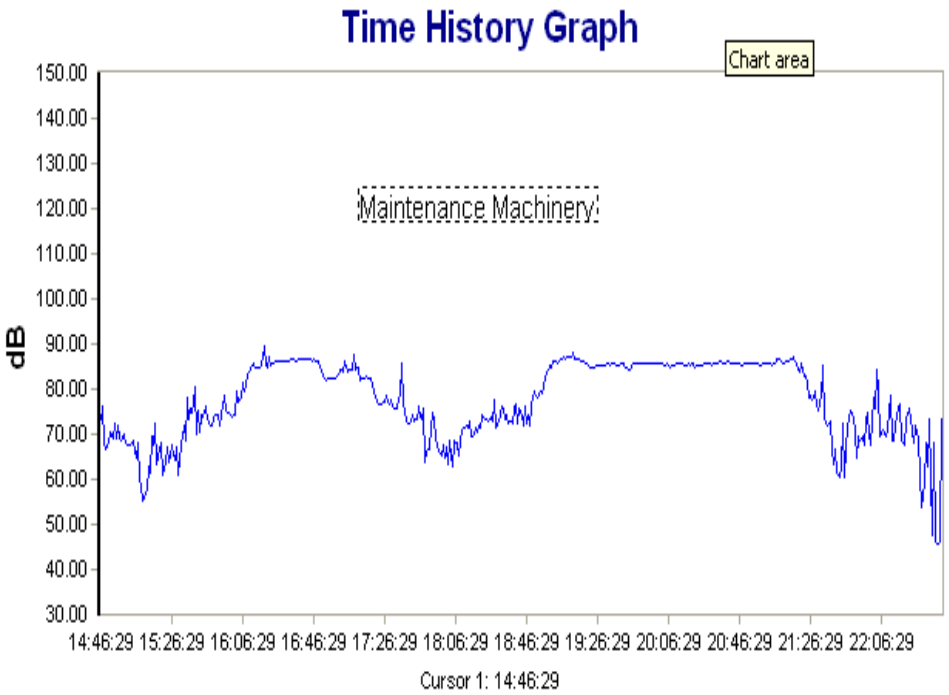

To Move or Delete Note

Step 1 Click on the text to be moved or changed. The "Annotate graph" window will appear.

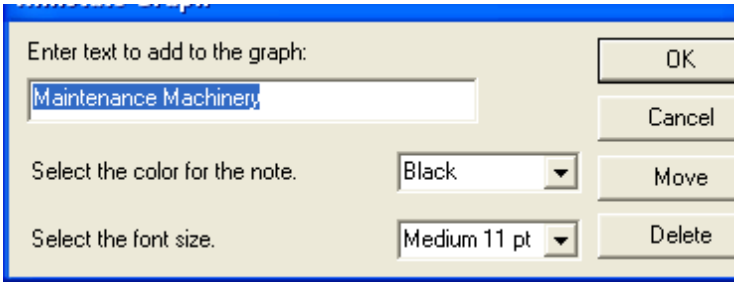

Step 2 To change the text, enter new text and click the "OK" button. To move text, click the "Move" button and then click on the graph at the new location. The text will be moved automatically to the new location on the graph. To delete text, click on the text to be deleted, then choose the "Delete" button and the text will disappear.

Graph Records from Different Files

This is a display-only feature; the file cannot be saved. The records to be plotted must have the same sample interval, weighting, detector, gain, peak weighting and the same parameters for each dose. The records from different files may have overlapping data. The graph will begin with the minimum start time of all the records and end with the maximum end time of all the records. By default, the graph will display the Leq from each of the records but the user may select other parameters (Lmax, etc.) to graph. Only one data type will be graphed at a time.

To select the data to be plotted, click the Graph Multiple Records button to bring up the Select Blaze Files dialog box.

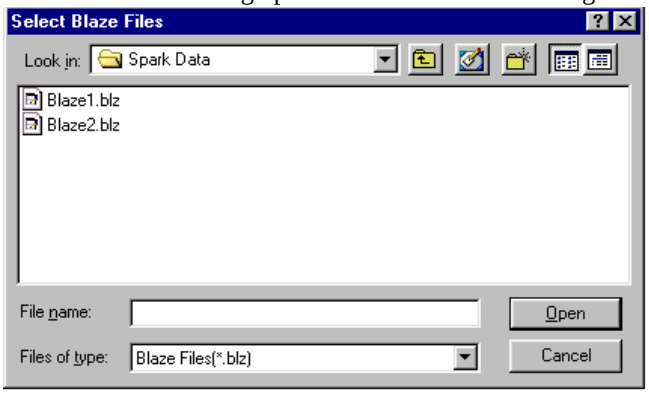

Highlight the files from which records will be selected for plotting and press **Open**. This will present the "Select Records to Graph" dialog box listing the records saved under the first of the selected files.

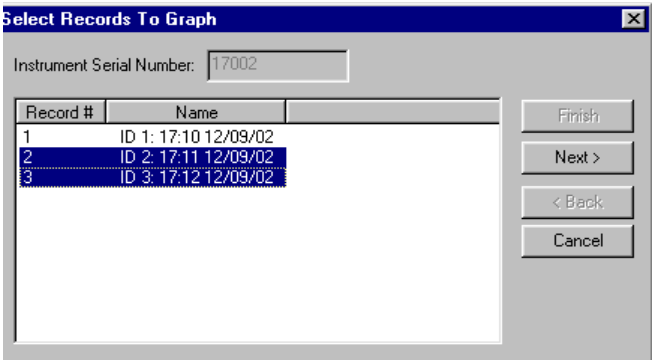

Highlight the records you wish to plot from this file and press **Next**, which will open a similar dialog box listing the records saved under the next of the files which had been selected in the Select Blaze Files dialog box. This sequence will continue until the dialog box listing the records from the last selected file is displayed, at which time the Next button will be grayed out and the Finish button displayed. Clicking on **Finish** will initiate the initialization of the graph as indicated by the following display.

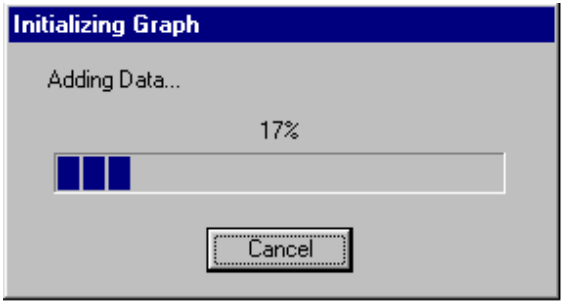

When the data has been initialized, the multiple graph will be displayed as shown below.

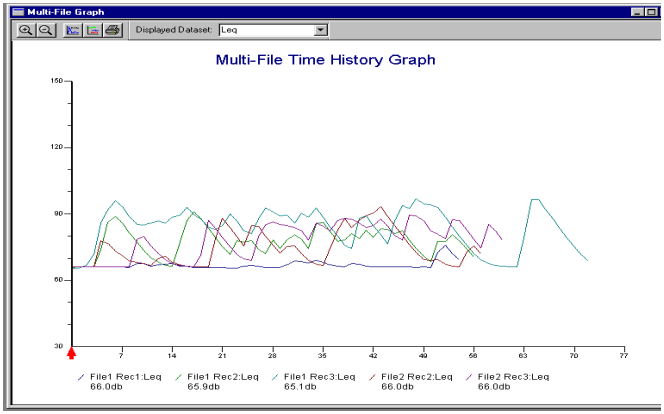

The Multi-File Time History Graph has the following toolbar associated with it.

The first five buttons perform the same functions as described in the section above.The sixth button performance is described below.

	The Show Actual Time button shifts the origin of each graph such that they are shown on an absolute time axis rather than overlaid as they are in the display which first appears. Repeatedly clicking this button will toggle the display between overlaid graphs and graphs using an absolute time axis.

The Displayed Dataset field is used to select which data are to be graphed. The default value is Leq. Left clicking the down arrow to the right of the field will open a drop-down menu listing the possible datasets which can be displayed.

The graphic above does not show all the possible datasets; left clicking the down arrow to the right will reveal additional choices. The complete set of choices are:

- Leq
- Max
- Peak
- TWA1
- TWA2
- TWA3
- TWA4

Highlight the desired choice with the cursor and left click to make the selection.

Adding Notes

To add notes to the Multi-File Time History Graph, left click the Add Note button, place the cursor at the position on the

graph where the note is to begin and left click to open the Annotate Graph menu.

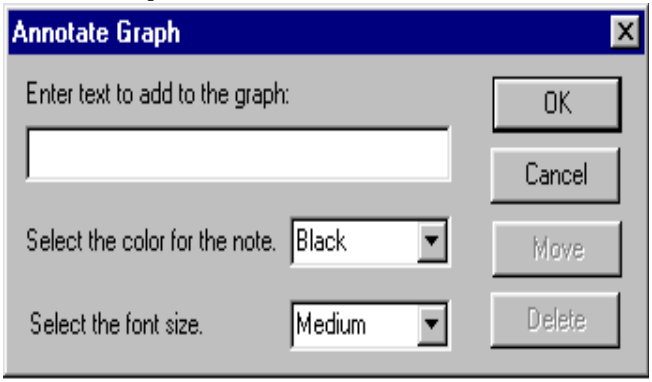

Type the text for the note in the field provided, select color and font size and click **OK** to print the note on the graph. Note that the background color on the Add Note button turned light when clicked to indicate a "pressed button" state which remains in that state after adding the note. This means that another note can be added by clicking another location on the graph. Thus, a series of notes can be added in succession until the Add Note button is clicked again to disable that function, as shown below.

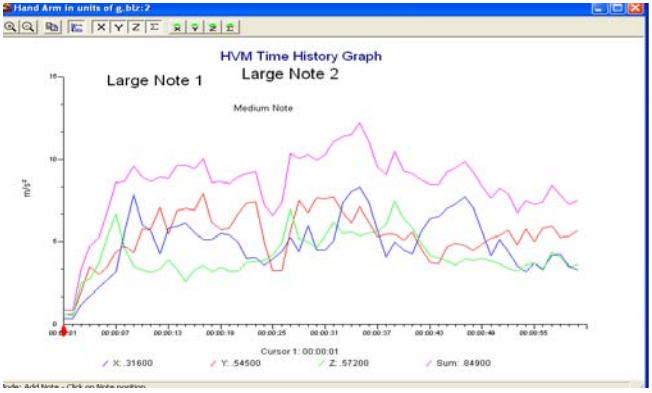

Show Graph in Actual Time

The following graph shows overlaid plots of two records which were measured at different times as they would appear on the default Multi-File History Graph.

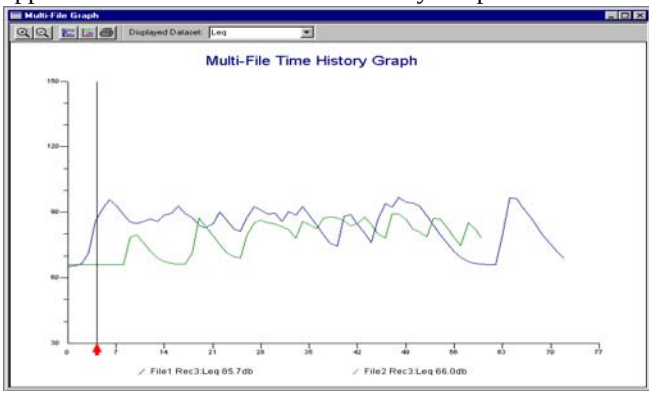

Left clicking the Absolute Time Graph button will produce a display of the same two time history files using the same time axis for both.

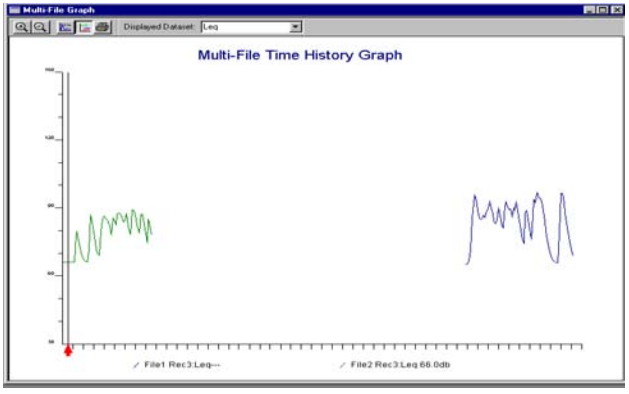

Left click the Absolute Time Graph button to return to the overlaid plot format.

The Statistics Graph

The Statistics graph shows how often each dB level from 60 dB to 150 dB occurred during the measurement. (or whatever the range is - based on gain.)

Step 1 Click the Statistics Graph icon from the main toolbar.



The Statistics Graph for the current measurement record will appear.

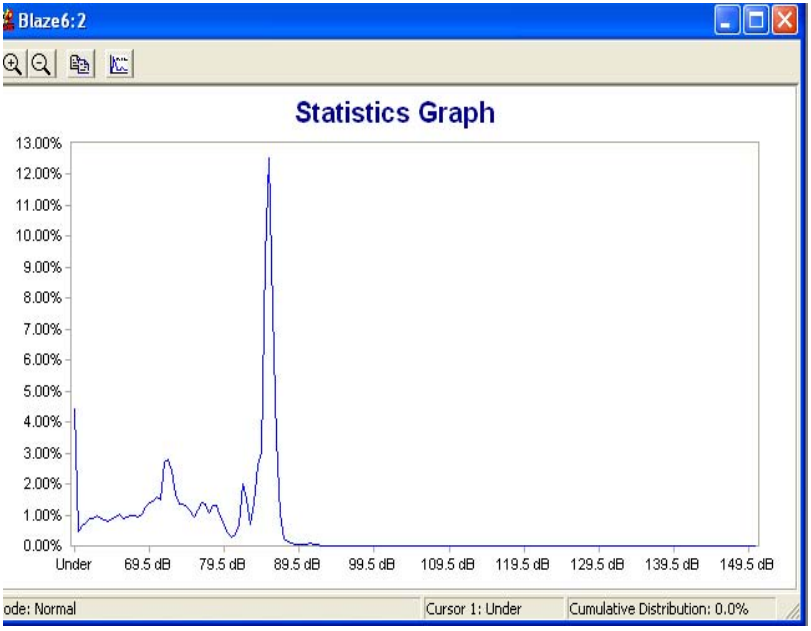

On the horizontal axis, each tic mark on the grid represents a dB level.

Step 2 Click on a grid line using the left mouse button, or the arrow keys.

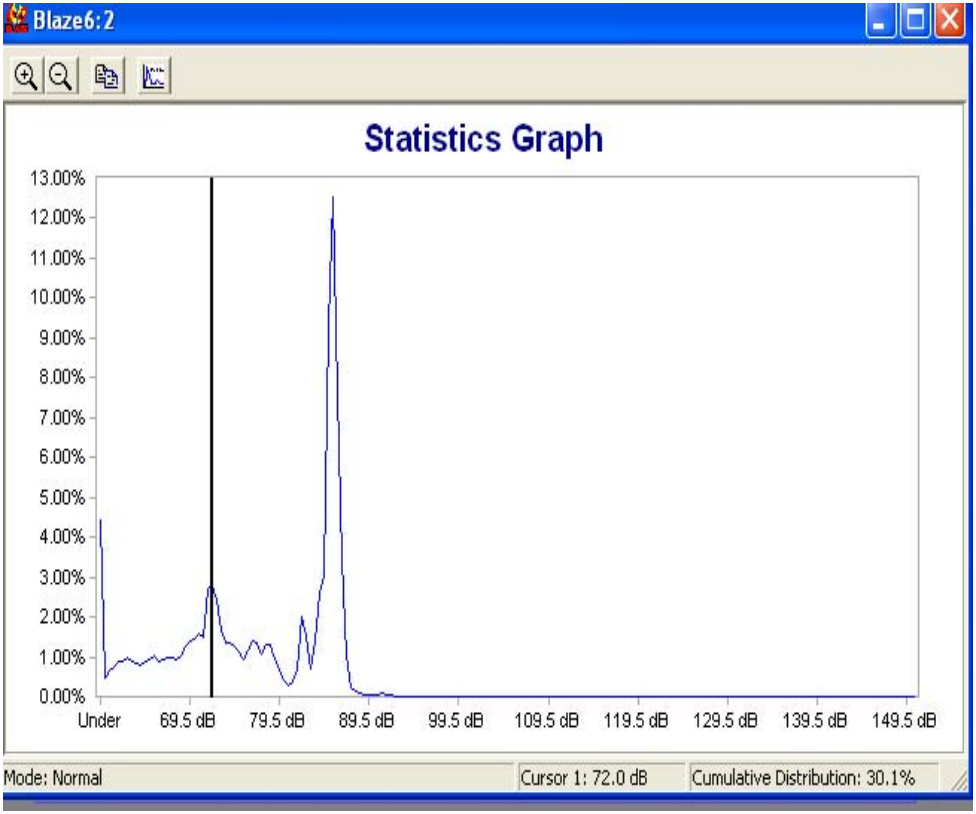

This displays the selected dB level, the percentage of time the dB level occurred during the measurement, and the cumulative distribution up to that dB level.

Zooming the Statistics Graph

Here the Zoom in function allows you to investigate details of the Statistics Graph by "magnifying" selected sections of the measurement.

Step 1 Click on the "+ magnifying glass" in the Statistics Graph toolbar to select the zoom tool.



Step 2 At a desirable place within the Statistics Graph graph, click and hold down the left mouse button to anchor the start zoom selection point. Then drag the mouse to the end zoom selection point drawing a box around the data to be examined.

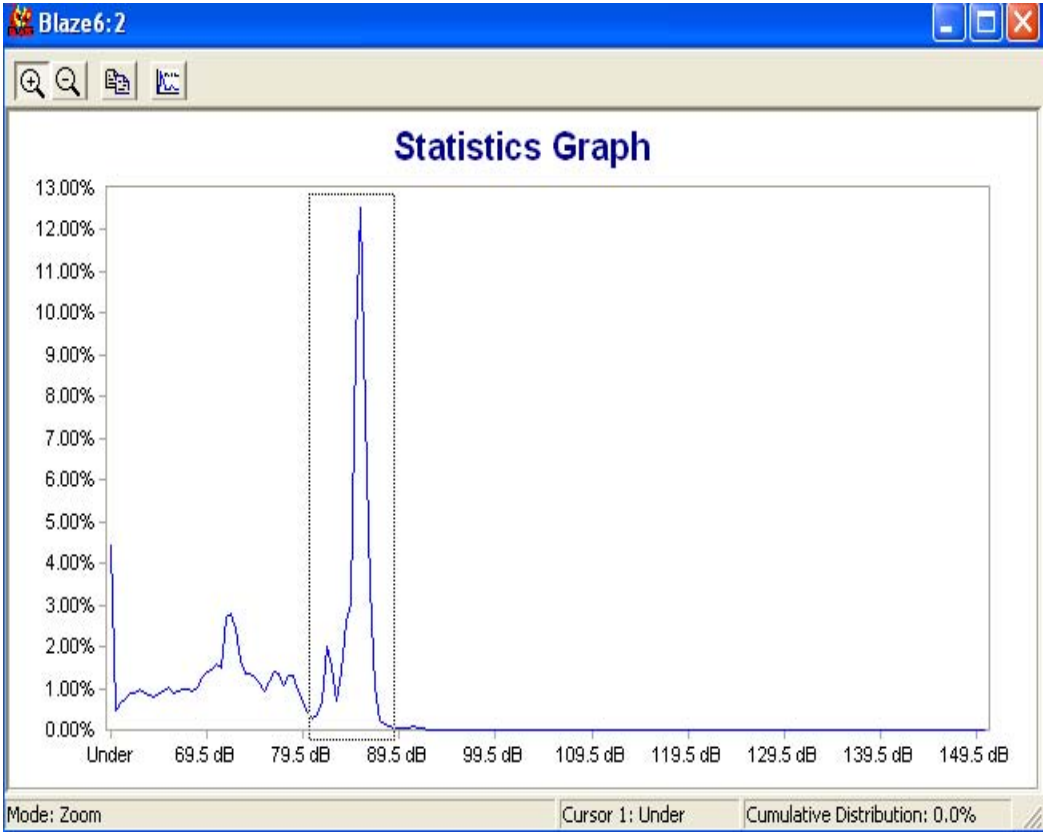

Step 3 Release the left mouse button to execute the zoom.

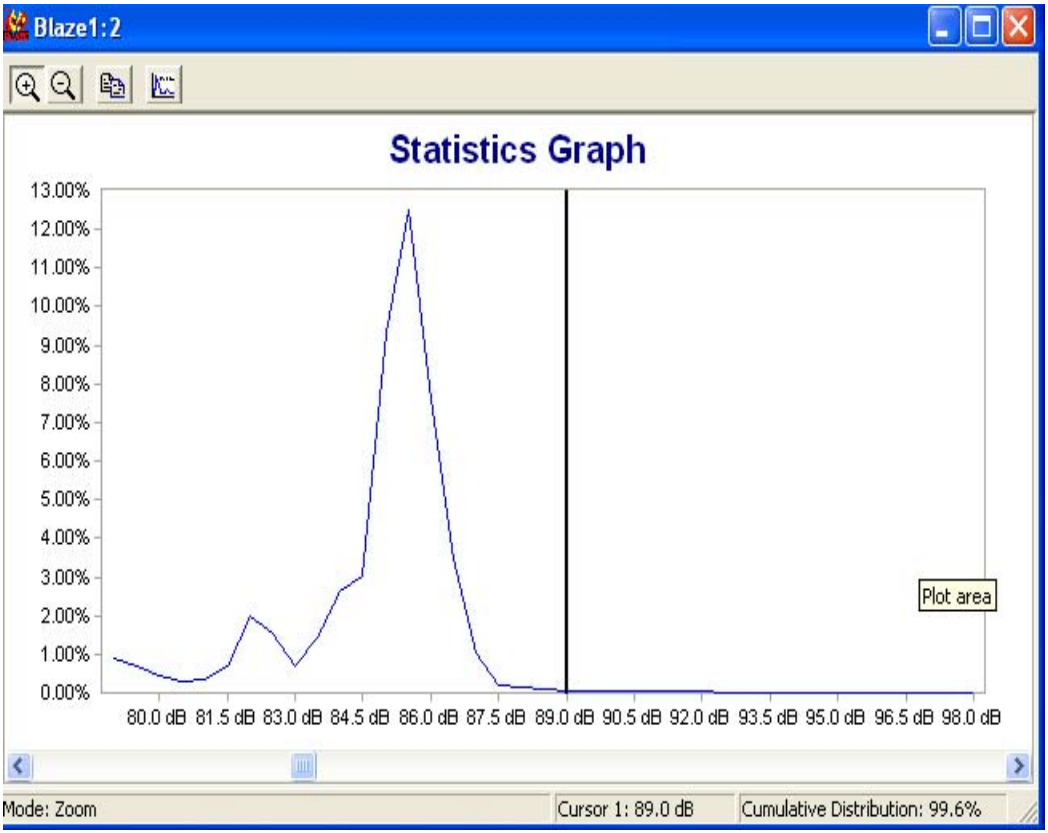

Further zooming can be achieved by repeating the above procedure.

The dB levels that are displayed directly under the statistics graph show which portion of the graph is currently displayed. The Underflow level displays the percentage of time all dB levels were under 60 dB. The Over-flow level displays the percentage of time all dB levels were over 150 dB. As the graph is scrolled, the dB labels change to identify the low and high dB levels displayed in the graph.

Zooming Out the Statistics Graph

Zoom Out returns a "zoomed" Statistics Graph to its original unexpanded scale.

Step 1 Click on the "magnifying glass" in the Statistics Graph toolbar to select the Zoom Out tool.

Step 2 You will be automatically zoomed out to the original Statistics Graph graph.

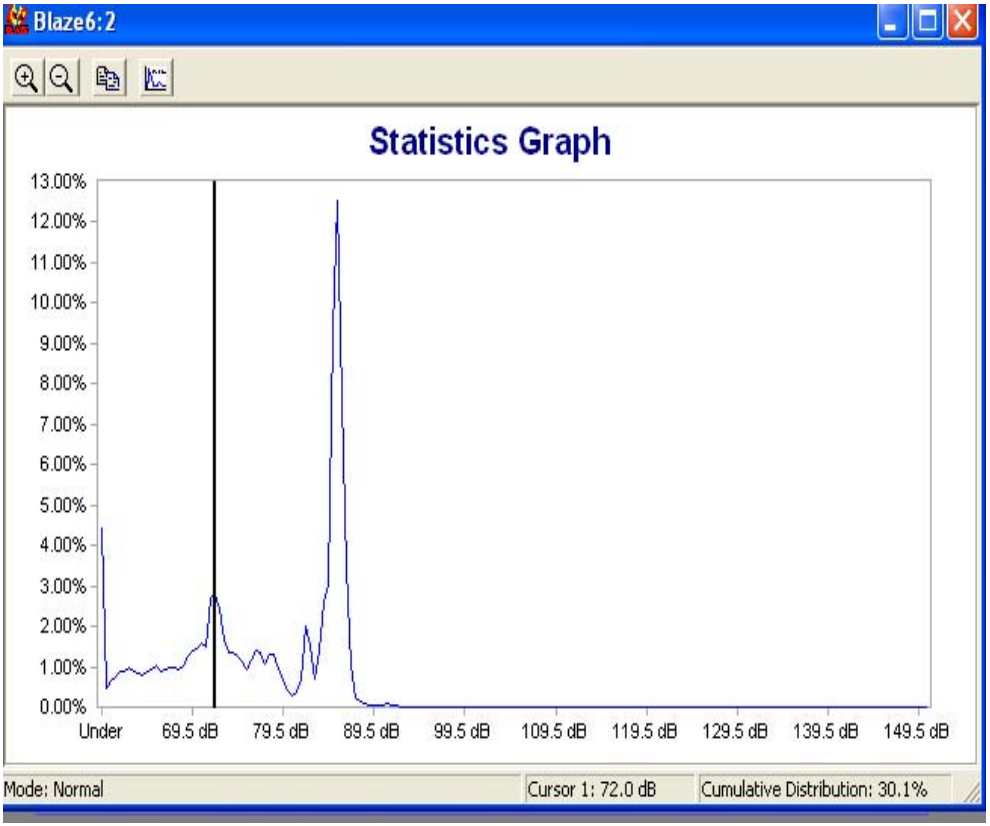

Adding a Note

A note can be added to the statistics graph by clicking on the **Add Note** button on the toolbar.

Follow the steps as outlined on in the section Add Note on page 2-78.

Ln Data

The Spark-ATEX creates an Ln table every five minutes. Blaze® will now store these tables so that a selected Ln value can be displayed on the Time History graph both on the screen display and in the Summary report. When displaying the Time History graph on the screen, there are two new buttons at the right end of the Time History toolbar as shown below.

:

Time History Display

Pressing the L? button displays the dialog box (shown below) which is used to set the Ln value to display and the Ln interval. The choices for the Ln Interval are 5, 10, 15, 30 and 60 minute intervals. For example, if the user desires to plot values every 15 minutes rather than 5 minutes, he will select 15 in the "Ln Interval" drop down list.

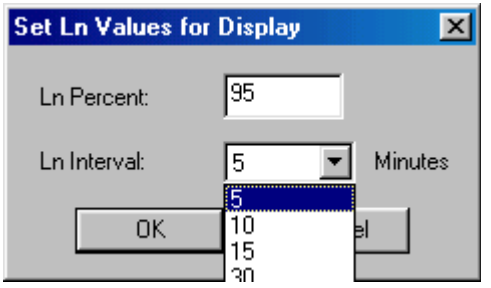

The L% button toggles the display of the selected Ln value on the graph with the selected interval (5 minutes by default). An example of a Time History graph with the L90 trace is shown below.

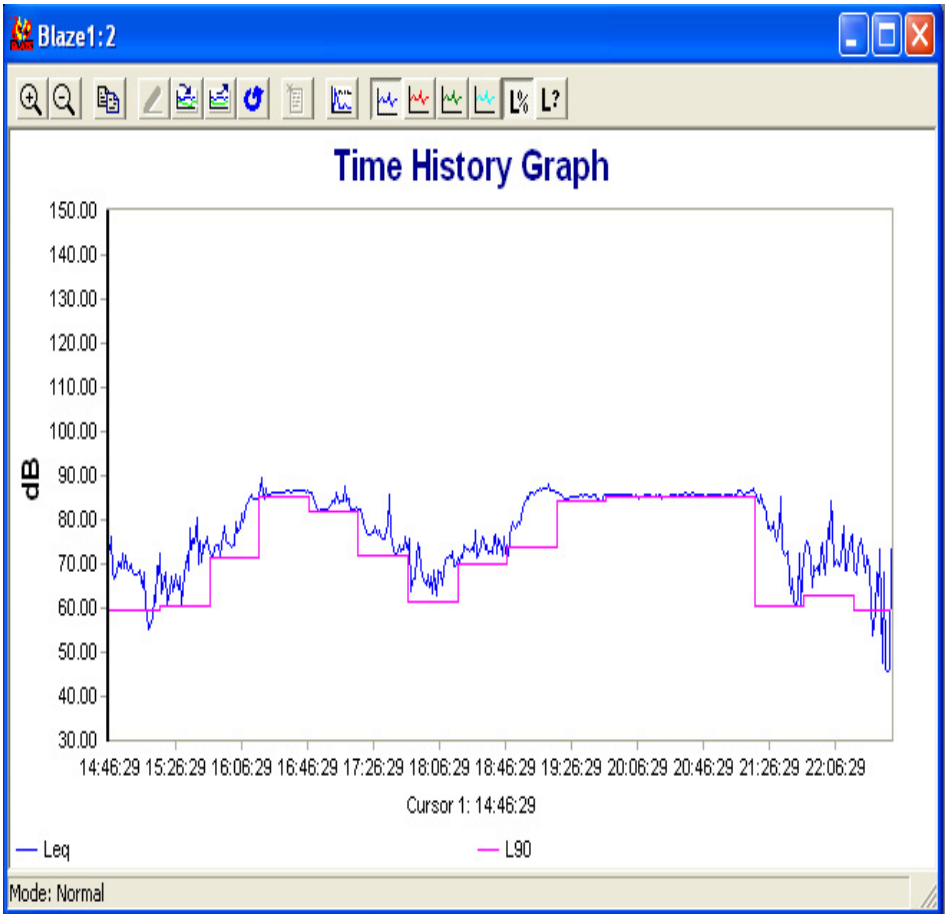

Summary Report Display

To display the Ln values on the Summary report, first select the Summary Report icon in the Print dialog box. This will show the Ln Data specific controls. Checking the Show Ln Data box will enable the Ln Percent edit box and the Ln Interval drop down list. The entered and selected values will be used to display the Ln line on the Time history graph in the Summary report.

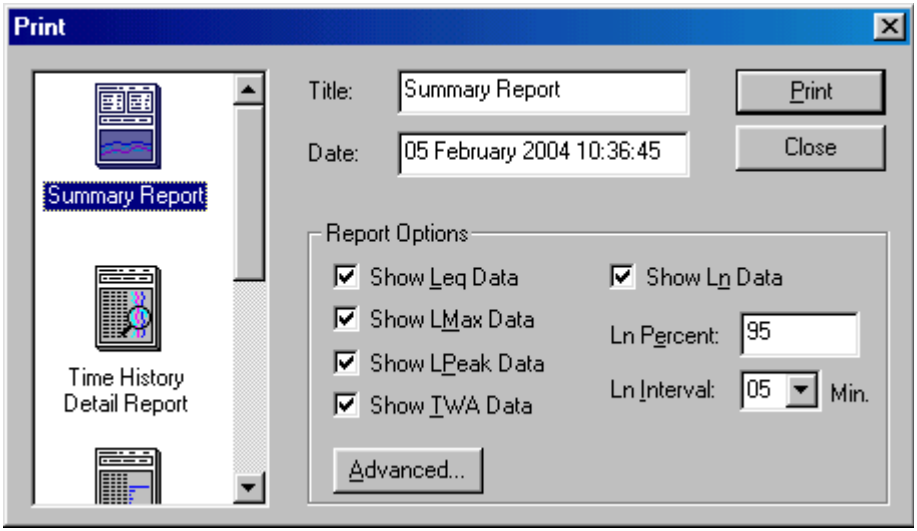

Ln Data Export

Ln data may be exported. Blaze® uses the L percentile values set in the "Set Parameters" dialog box which is opened by selecting the "Set Parameters" menu item under the "Records" menu. To export the Ln data, check the "Show Ln Data" box as shown below and select the desired Ln time interval from the "Ln Interval" drop list. The export file will list the date, time and five L values at each selected interval.

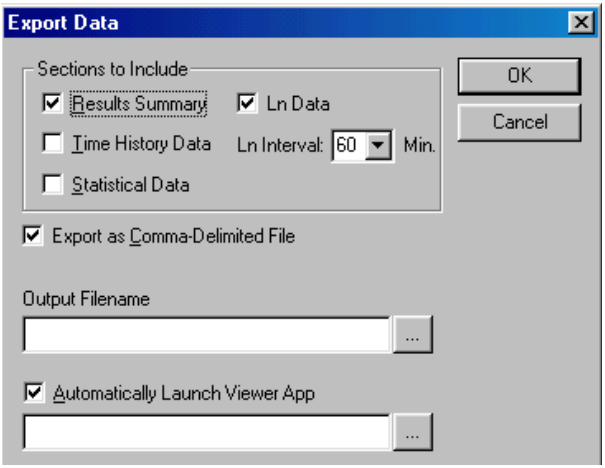

Please note that the Ln values are based on a "Base dB" value dependent on the gain. The Base dB value at 0 gain is 60 dB and at 30 gain is 30 dB. Thus if gain is set at 0 in a quiet environment, the Ln graph will always be at 59.5, which will generally be above the Leq because the Spark normally has a noise floor below the Base dB at the given range. This will look strange on the graph but it is a result of improperly setting up the Spark. In a quiet environment, the gain should be set at 30.

Printing Reports

Blaze® has a number of excellent canned reports that you may wish to use for your own record keeping. The reports include:

Summary Report

The Summary Report is a one-page report that prints measurement settings, measurement results, and a time history graph that is condensed to fit the page. A detailed graph or an averaged graph for the summary report may be printed by selecting the appropriate radio button in the "Advanced Print Options" window.

Modified Data Report (Not Available with the 703-ATEX/705-ATEX)

This report is also a one-page report and prints information about the 706RC-ATEX, 706-ATEX, 705+ATEX or 703+ATEX including serial number, when the measurement was performed, and measurement type. It also shows the modified and original Dose, Projected Dose, Leq, TWA, SE, Lmax, Max, Lpeak, and Lmin. The lower part of the report shows the Edited Time History Graph with Leq, Max, Peak, and TWA for each interval.

Time History Detail Report (Not Available with the 703-ATEX/705-ATEX)

This report prints information about the Spark®-ATEX instrument such as serial number, when the measurement was performed, and measurement type. The detail portion of the report provides a tabular display of each interval with its beginning time, Leq, Max, Peak, and TWA values with a bar graph on the right side. This report can be very long, depending on the time history interval that was used.

Statistics Report (Not Available with the 703-ATEX/ 705-ATEX)

The statistics window is a tabular report and bar graph that prints a row for each dB value from 60.0 dB to 150.0 dB (or whatever the range is) and the percentage of time that each dB level occurred during the measurement. The Statistics Report resolution can be increased (by selecting Fractional Display) from the Print window before printing the report. The Statistics Report usually spans several pages.

Step 1 First, verify that a measurement record you wish to print is open.

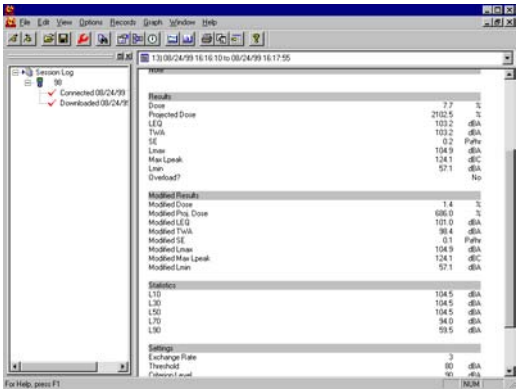

Step 2 To Print the data, select Print Reports from the File menu, or press the Print Reports Button on the toolbar.

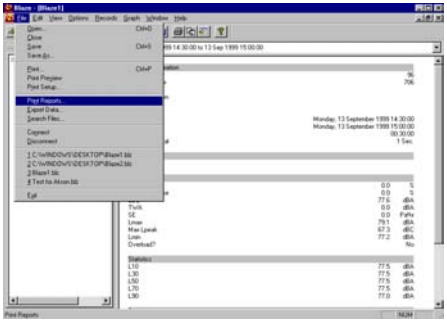

The following Print window appears

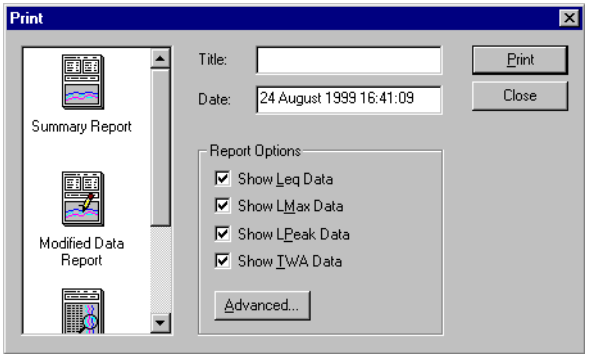

NOTE: The TWA printed is the TWA for the currently selected Dose.

Here you can select the report you wish to Print, add a title to the printout, edit the date which appears on the report, and select which data you would like to show on the report.

Step 3 Select the report style that you wish to Print by clicking on it. You can see report samples in Appendix D of this manual. Add a Title or change the Date if desired.

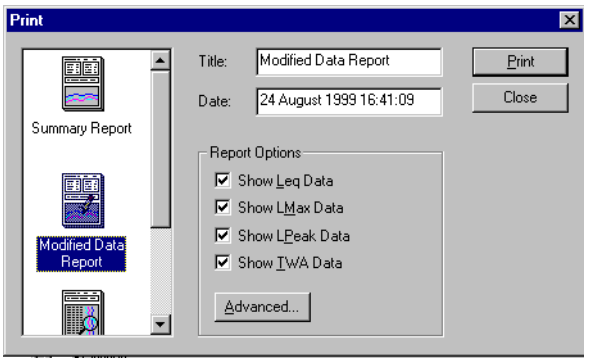

Advanced Print Options.

Step 1 Press the Advanced button on the Print Dialog Box.

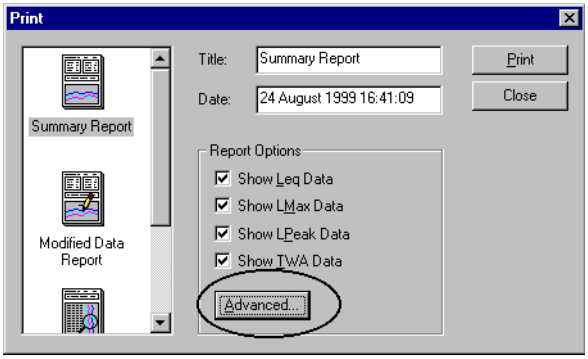

Step 2 The Advanced Print Options dialog box will appear.

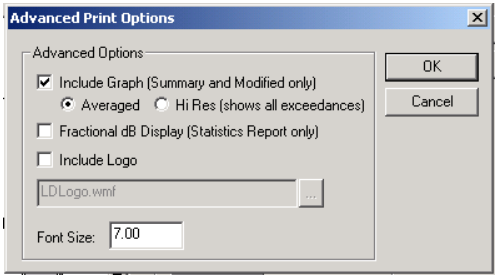

Step 3 This dialog box will allow you to include a graph (either an averaged graph, or a detailed graph showing all exceedances) for the summary report. You also have the option to include a "Fractional dB Display (Statistics Report only)" and the option to include a logo. To choose any of these adjustments, simply check the appropriate box in the "Advanced Print Options" window.

Step 4 To select a logo, press the browse button next to the logo file name field. This will bring up a standard windows file tree where a new logo can be selected.(Logo is in a Windows Metafile format.)

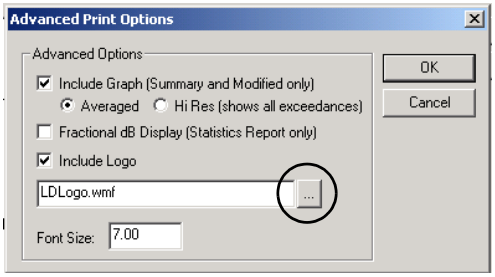

After all adjustments have been made, and the report is selected, press the Print button.

The report will be printed to the default printer. To select a different printer, change the default printer using the Control Panel found in Microsoft Windows®.

Printing Windows

Reports can also be printed from other areas within Blaze®. You can print from within the Measurement Record window, Time History window, or Statistics window. This action will print items in the active window.

First ensure that the window or screen you wish to Print is active.

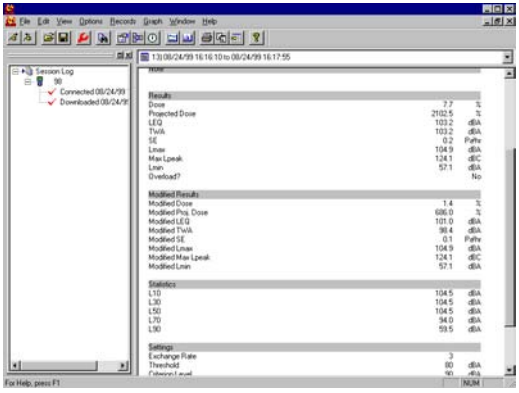

Then select **Print** from the File Menu or press the print button in the tool bar. You can also choose Print Preview to observe what will be sent to the printer.

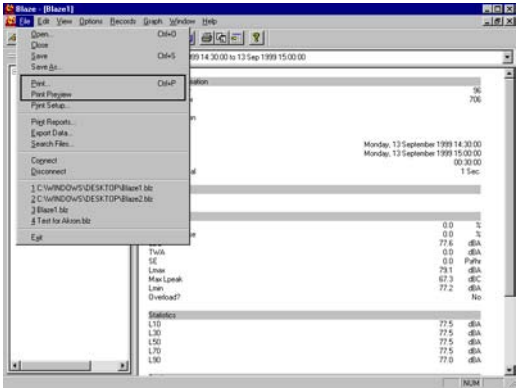

Exporting Record Data

You may wish to export a measurement record to a text file, which can be manipulated in another program such as a spread-sheet or for use in a report. To export data from an open measurement record:

Step 1 First, open the measurement record you want to export:

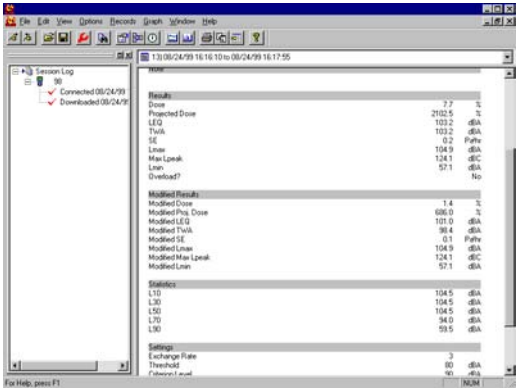

Step 2 Click on the File menu.

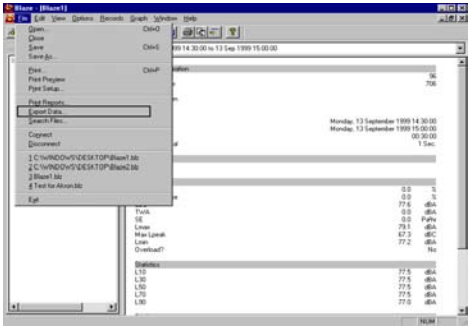

Step 3 Select Export Data or select the export data button from the toolbar…

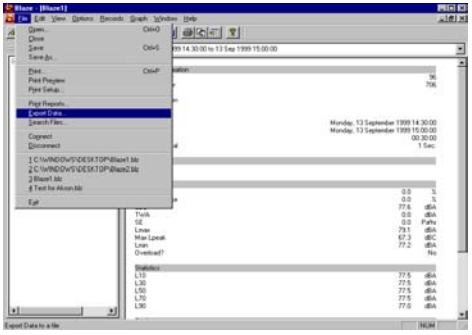

The following dialog box will appear.

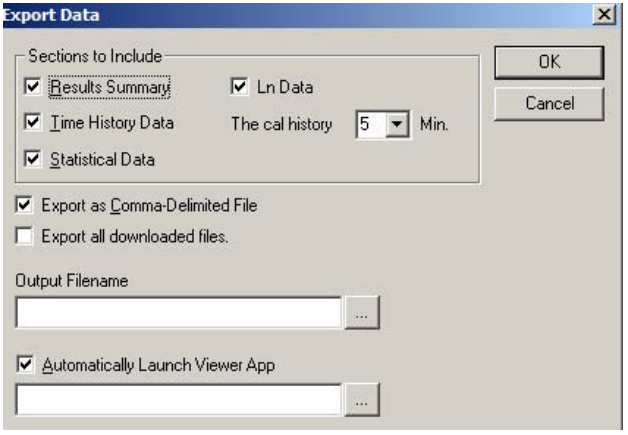

Step 4 Choose the data from the measurement record that you wish to export by clicking the appropriate check box. Your choices are:

- Results Summary
- Time History Data
- Statistical Data

Comma-delimited is for spreadsheet programs; others are useful for exporting into word processors.

Step 5 You can create an easily parsed text file by clicking the "Export as a Comma-Delimited File" check box.

Step 6 You can select to export all downloaded files.

Placing a check in the “Export all downloaded files” check box will export all downloaded files to separate .csv or .txt files at the same time. These will be stored to the file name defined in step 3 with _001, _002, etc. appended sequentially to that file name.

To choose the name of the text file you wish to create, and the location where you require to be it stored:

Step 7 Click on the Output Filename selection box.

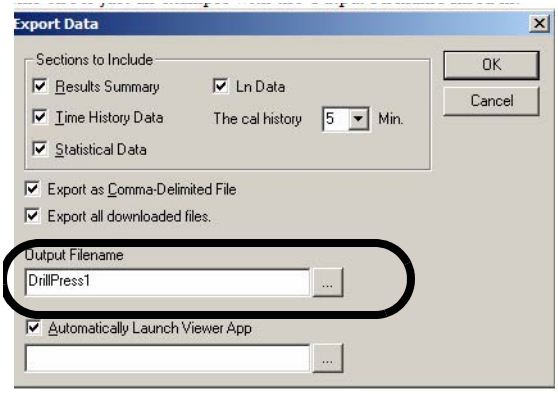

Step 8 Select a location and filename as you would with any other Windows application, then click **Save**.

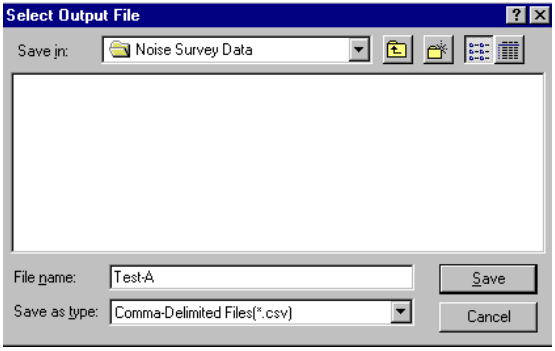

The text file has been created and resides in the Windows directory you selected.

Blaze® can automatically send the export file to an application (such as a spreadsheet or word processor) by enabling the "Automatically Launch Viewer Application" feature. When this feature is selected the application you have chosen will automatically run and display the exported text file.

Step 9 Check the "Automatically Launch Viewer Application" check box.

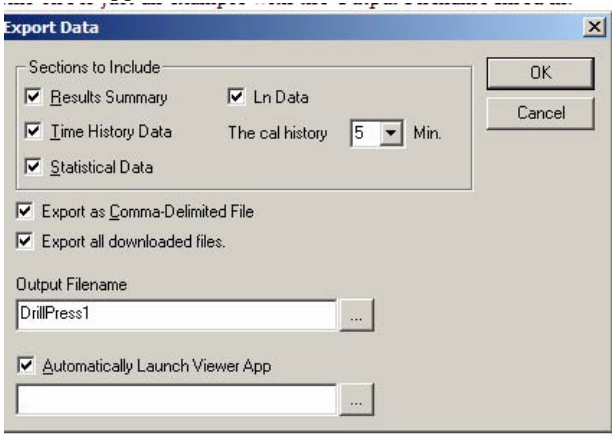

If the check box is checked, and the edit field is left blank, the default viewer for the file type (.csv or .txt) will be invoked to read the created file.

Step 10 You can then browse to the application you want to "launch" by clicking the selection box to the right.

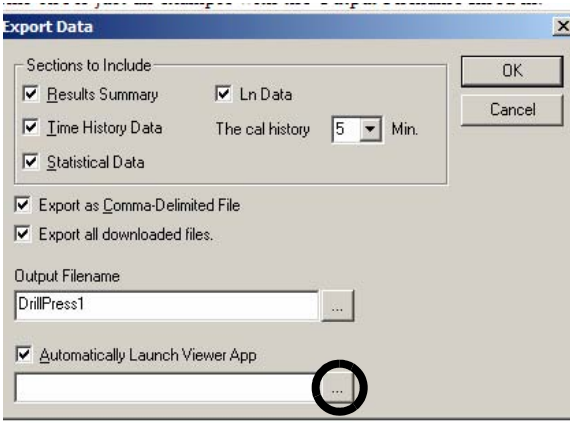

Step 11 Choose your desired application to view the exported data.

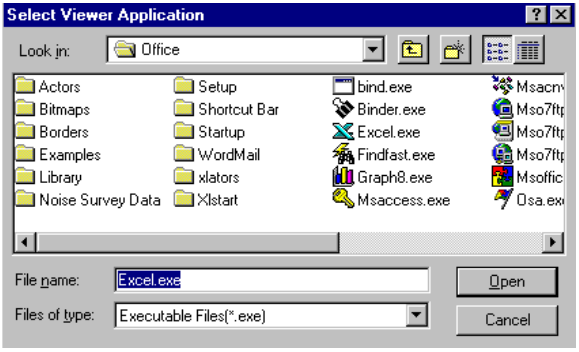

Step 12 Select **OK** to export the file and launch the viewer application.

Searching the Blaze® Database

Blaze® incorporates a powerful search function which will allow you to search through saved Data Records on specific items.

Step 1 Select the Query Files button from the Tool bar.

Step 2 The Query Files dialog box will appear.

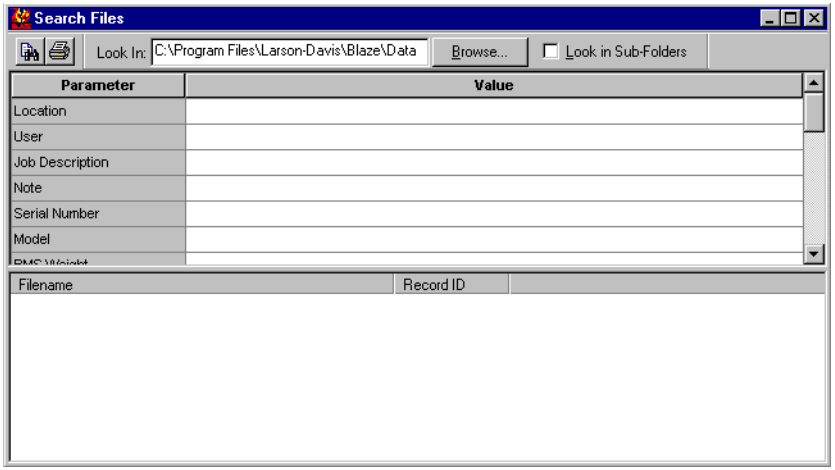

Step 3 Use the Browse button to select the file folder you wish to query.

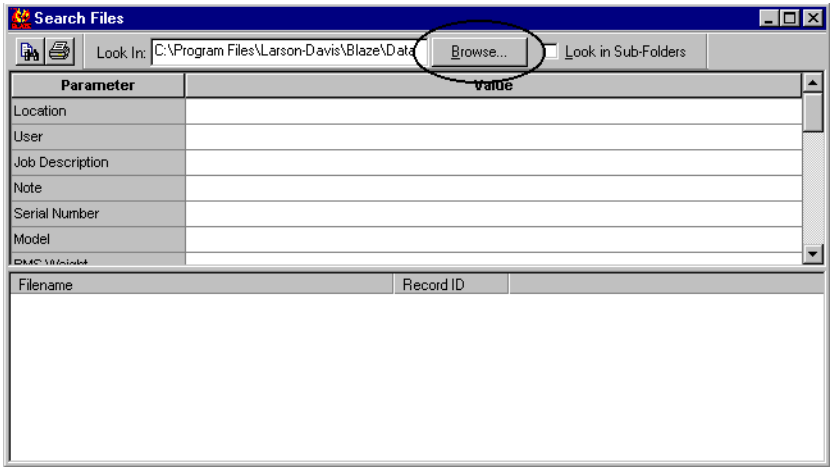

Step 4 Select the folder that contains your Blaze® Data Records, and press the OK button. (Check the Search Sub-folders box if you wish to search the sub-folders as well.)

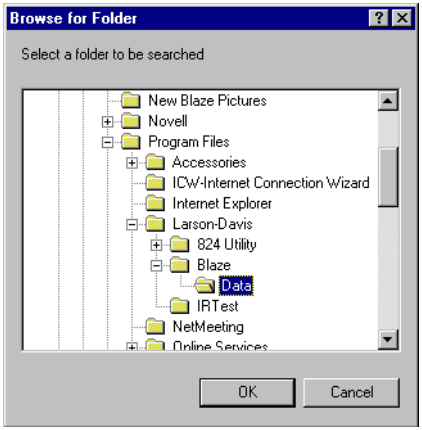

Step 5 Enter the parameter value you wish to search on. Searches can be performed on multiple values, or on one value.

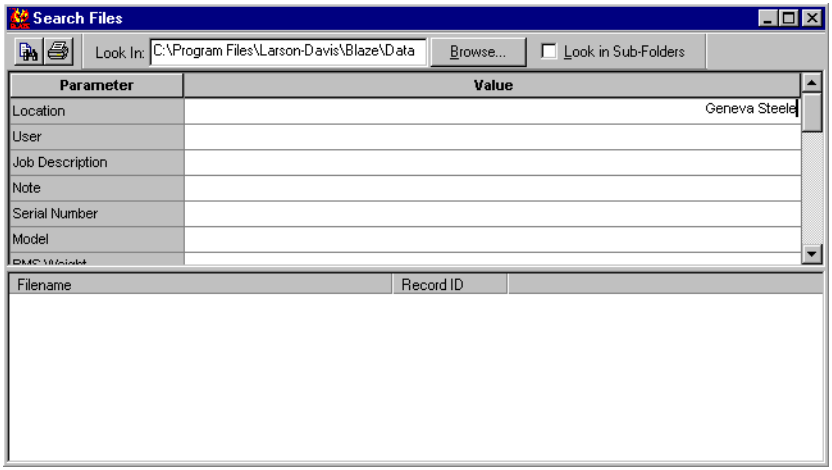

NOTE: If the search is performed on a level such as an Leq, the search will identify records that are at or above the specified level.

The search above was performed specifically on records taken at the Location of Geneva Steel. You can also search for records on User, Serial number, Job Description, etc. This function can be very useful in pinpointing problem areas or simply to gather specific records on a location.

Step 6 After entering the search parameters values, press the Search button.

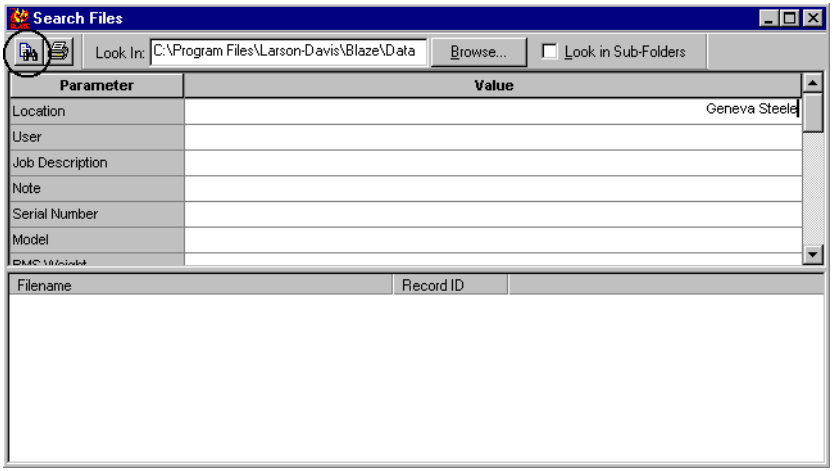

Step 7 Blaze® will bring up a status window, and then report the findings of the search in the bottom of the dialog box.

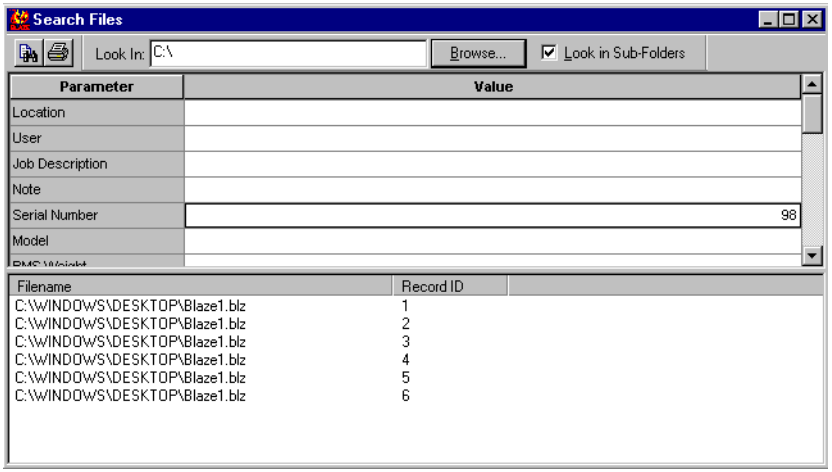

Step 8 To view a record that was located by the search, Double Click on the desired record, and the Data Record window will be brought up.

Step 9 You may also print the results of the search by pressing the print button.

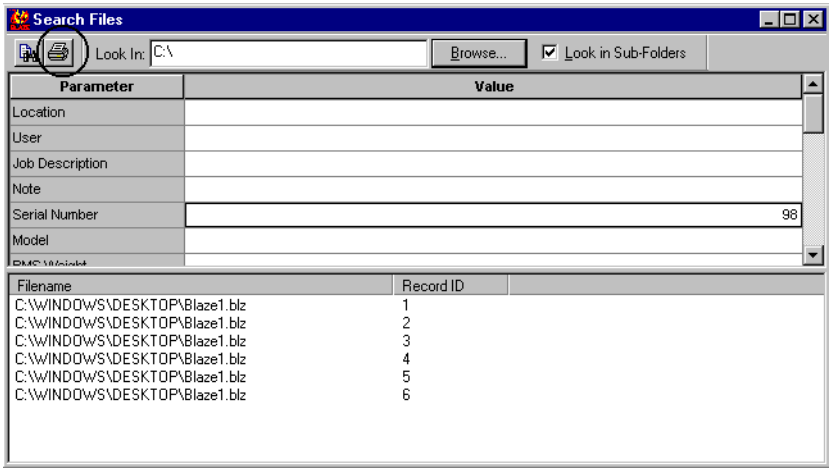

Troubleshooting Download Problems

A situation can occur in which the instrument connects to the Blaze® software, but the download process fails, indicated by the message "The file could not be downloaded. Check the battery and the connection and try again". There might also be a message "restore the connection" with a countdown.

Note: All stored data is in non-volatile memory and will be safe while the batteries are changed.

If this occurs, replace the batteries with fresh new batteries. Often times the batteries will have just enough energy to allow the unit to run fine, and connect to Blaze®, but there is not enough to allow the download process.

Also, it is often the case that the energy capacity in NiCd and NiMH batteries will degrade over time. If NiCd or NiMH batteries are being used and this problem occurs, try newly purchased NiCd or NiMH batteries, or temporarily install alkaline batteries for the download instead.

Temporary Workaround

A temporary workaround is as follows:

Step 1 Connect the Spark unit to the Blaze® software

Step 2 Locate the GENERAL SETTING tab of the SPARK INSTRUMENT MANAGER box.

Step 3 Change BATTERY TYPE from NiCd or NiMH to ALKALINE.

Step 4 Click on the CONFIGURE INSTRUMENT button.

Step 5 Perform download

Step 6 set BATTERY TYPE back to whatever it had been previously.

Step 7 click on the CONFIGURE INSTRUMENT button.

CHAPTER

3 Manual Operation of the 706-ATEX/706RC-ATEX

Spark® 706-ATEX/706RC-ATEX – Quick Reference

Congratulations! You now have your hands on the most powerful, smartest noise dosimeter available. It is also one of the smallest and lightest. We at Larson Davis thank you for your purchase of the Spark® 706-ATEX/706RC-ATEX, and trust you will receive many years of good service from it. This section has been developed to guide you through the operation of the 706-ATEX/706RC-ATEX, independent of the Blaze® software.

Overview

This manual is best used with the instrument at your side. You will be guided through a step-by-step tour of the Spark® 706-ATEX/706RC-ATEX. The appropriate keypad button will be shown on the page. The resultant 706-ATEX/706RC-ATEX display will then be presented to verify that you have performed the correct action.

You will likely find the user interface of the Spark® 706-ATEX/706RC-ATEX to be intuitive. This section is intended to give you a tour of the 706-ATEX/706RC-ATEX's capabilities, and insights to its operation. You will navigate through the 706-ATEX/706RC-ATEX's simple interface and make measurements immediately. You may find that it will also be useful to refer to this guide when trying something new with the 706-ATEX/706RC-ATEX.

User Interface

Navigation within the 706-ATEX/706RC-ATEX display is achieved using the keypad. The keypad allows the user to

maneuver through the 706-ATEX/706RC-ATEX's simple menu structure, change settings, and view data.

Keypad Functions

The keypad functions are as follows

⏻ – this key is used to power the 706-ATEX/706RC-ATEX on or off.

⏯ – this is the RUN/STOP key. It initiates or ends a measurement

You will not lose any data when doing a RESET.

⏏ – the RESET key performs a reset of the current measurement. The measurement screen will clear and a new measurement can be acquired. RESET is also used to exit from menus/screens.

🔧 – the TOOLS key is used to access various system functions of the 706-ATEX/706RC-ATEX such as calibration, setting the 706-ATEX/706RC-ATEX locking feature, changing the instrument setup, viewing the available memory, viewing the firmware version, viewing battery capacity, viewing the timers, and adjusting the contrast of the display.

The arrow keys: ◀ , ▶ , ▲ , and ▼ provide a variety of different navigation operations within the 706-ATEX/706RC-ATEX operating system. This includes maneuvering through menus and displays. Typically, the up and down arrows move the user up and down through displays and menus. The up and down arrow are also used to navigate through menu choices. The left and right arrows move the user from one related screen to another.

✓ – The check key is used to select an option or choice from a 706-ATEX/706RC-ATEX menu.

706-ATEX/706RC-ATEX Icon Descriptions

The 706-ATEX/706RC-ATEX's graphical display also has its own icons that provide status information.

Battery

The Battery icon provides information with respect to the remaining battery voltage of the 706-ATEX/706RC-ATEX. Notice that there are 3 bars within the battery graphic. When all 3 sectors are present, the battery voltage is greater than 2.8 (3.0 volts is full power). Two bars indicate that the voltage is greater than 2.4. With one bar illuminated, the voltage is greater than 2.2 volts. If the voltage is greater than 2.0, only the outlined battery will appear. When the voltage drops below 2.0, the outlined battery will begin to flash. At 1.8 volts, the 706-ATEX/706RC-ATEX will shut itself off.

Mail Icon

The mail icon is used to indicate a connection between a 706RC-ATEX and a remote unit. On the 706RC-ATEX the mail icon will come on and flash anytime the 706RC-ATEX is connected to a remote unit. This indicates that the 706RC-ATEX screen is showing the data being collected from the remote, or that data is being transferred. When the connection is lost, the mail icon will go away.

On a remote unit, the mail icon will come on and stay on solid anytime the remote is in communication with a 706RC-ATEX. If you are connecting 2 706RC-ATEX's together, the master unit's mail icon will be flashing and the remote's mail icon will be on solid.

Communication

The signal icon indicates IR communication. When the antennae is present, communication is occurring between the connected 706-ATEX/706RC-ATEX and the computer via the IR interface.

Run Indicator

When the instrument is running, this bar graph will be animated, rolling from left to right. When the instrument is in the stopped mode, the icon will not be present.

Overload

The alarm icon indicates that measurement overloads have occurred. This can happen when extremely loud noise levels occur, or if the microphone was bumped.

The icon will remain visible until a reset of the 706-ATEX/706RC-ATEX has been performed. During an overload event, the alarm icon will flash.

The bell Icon will also come on and flash during a microphone fault. After the microphone is connected, the bell will remain on until the Spark® instrument is reset.

Run-Time Clock

The clock icon is always present in the top right corner of the 706-ATEX/706RC-ATEX display. It indicates the total running time of the current measurement. This time can be set to zero by pressing the reset ⏬ button on the 706-ATEX/706RC-ATEX. During the first hour of run time, the clock will display in minutes and seconds (mm:ss). After completion of the first hour, the clock display will adjust to show hours and minutes (hh:mm). After 99 hours, the clock will start over again, although the actual run time (in hh:mm:ss) will always be maintained internally.

Powering up the 706-ATEX/706RC-ATEX

If you have not already done so, turn the 706-ATEX/706RC-ATEX on by pressing the On/Off key: ⏻

The instrument will move through a short start up cycle, where it briefly flashes the 706-ATEX/706RC-ATEX ID screen. Immediately following, the 706-ATEX/706RC-ATEX will stabilize to its ready state. The screen that will be displayed is the same screen that was active during the previous power down unless there are timers set.

If there are timers set, then the following screen will be displayed each time the unit is powered up. This will allow the user to immediately know if there are timers set. The message will not be displayed if no timers have been set.

If you are in a menu, press ⓗ one or more times to exit to a measurement display. Then press ⓤ or ⓓ until you see the following screen:



706-ATEX/706RC-ATEX Displays

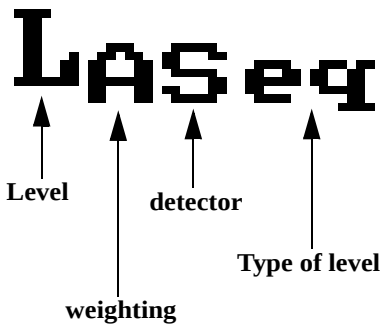

Below is an explanation of the metric abbreviations used in the 706-ATEX:

L_{AS} - sound pressure level, A-weighted, slow detector

L_{ASeq} - equivalent sound level, A-weighted, slow detector

L_{CSmx} - maximum sound pressure

Step 1 Press ⓗ to start a measurement. Notice that the current sound pressure level and Leq are currently being displayed.



Step 2 Press ⓓ to view the next display screen. This shows the current Lmax (maximum sound pressure), Leq (equivalent sound pressure level or "average"), Lmin (minimum sound pressure level)., and Lpeak (the largest peak sound pressure level).



Step 3 Press ⓓ to view the current SE (sound exposure), the 8 hour projected SE, and the 40 hour projected SE in units of Pa^2H.

L_{CSeq} - equivalent sound level, C-weighted, slow detector

L_{CSmn} - minimum sound pressure level, C-weighted, slow detector

L_{Cpk} - peak level, C-weighted

Step 4 Press ▼ to view the noise dose data for Dose 1. The 706-ATEX/706RC-ATEX will log four simultaneous doses. These dose computations can have independent dose variables such as exchange rates, threshold levels, criterion levels, and criterion times. This display shows the current dose value, the projected 8 hour dose, and the TWA (Time Weighted Average).

Step 5 Press ▼ to view the current dose data for Dose 2.

Step 6 Press ▼ to view the current dose data for Dose 3.

Step 7 Press ▼ to view the current dose data for Dose 4.

Step 8 Press ▼ to view the SPL 1 Exceedance data. The instrument counts the number of times the SPL 1 Exceedance level was exceeded, and also records the amount of time for which the level was exceeded.The Hysteresis is 2 dB, i.e. the level must fall 2 dB below the exceedance level, before a new exceedance will be recorded.

Step 9 Press ▼ to return to the sound pressure level screen.



Step 10 Press ▶ to move to the sound pressure level setting screen. Here you will see the current 706-ATEX/706RC-ATEX settings for the gain, rms weighting, peak weighting, and detector rate.

Step 11 Press ▼ twice to advance to the SE data display.

Step 12 Press ▶ to view the SE data in Pa^2S (Pasques), the 8 hour projected Pa^2S and the 40 hour projected Pa^2S.

Step 13 Press ▼ to advance to the Dose 1 display.

Step 14 Press ▶ to inspect the Dose 1 settings for the criterion time, criterion level, exchange rate, criterion time, rms detector, and rms weighting.

If you are measuring to OSHA regulations, the following is a list of appropriate settings:

- RMS Weighting – A

- Peak Weighting – Unweighted
- Detector Rate – Slow
- Exchange Rate – 5 dB
- Threshold Level – 80 dB
- Criterion Level – 90 dB
- Criterion Time – 8 hours

Step 15 Press ▼ to inspect the Dose 2 settings. As previously stated, independent dose settings for all four of the 706-ATEX/706RC-ATEX's simultaneous dose measurements can be established.

Step 16 Press ▼ three times to move to the SPL 1 Exceedance display.

Step 17 Press ▶ to examine the SPL 2 Exceedance values. This feature allows you to measure and view a second sound pressure level (RMS) exceedance. It counts the number of times the SPL 2 Exceedance level was surpassed, and the total time the RMS sound levels were above the threshold (120 dB).

Step 18 Press ▶ again to examine the Peak Exceedance values. The instrument counts the number of times the Peak Exceedance level was exceeded, and also records the amount of time for which the level was

exceeded. The Hysterisis is 2 dB, i.e. the level must fall 2 dB below the exceedance level, before a new exceedance will be recorded

Tools

The Tools area is where you go to change settings in the 706-ATEX/706RC-ATEX. Let's tour the Tools menu.

Step 1 Press ⓘ on the 706-ATEX/706RC-ATEX keypad.



A number of sub menus are available within the Tools menu including Calibration, Lock, Setup… (Emulate: Available only on the 706RC-ATEX)

Step 2 Press ▼ to move to the next set of Tools sub menus.

…Memory, About, Power…

Step 3 Press ▼ to move to the last set of Tools sub menus.

…Timers and Set Time. We will learn more about each of these sub menus in upcoming sections.

Step 4 Press ▲ a few times in the Tools menu to highlight Calibrate.

Remote Control of Remote unit

(706RC-ATEX ONLY)

The 706RC-ATEX can be used to control a remote unit. The units that can be controlled are the 706RC-ATEX, the 706-ATEX, 705+ATEX, and 703+ATEX. To start communication with a remote unit.

Step 1 Go to the ⓘ menu.

Step 2 Verify that the Emulate menu item is highlighted at the top of the tools menu.

Step 3 Press the ✓ key to bring up the Emulate menu items.

The Emulate menu contains two items, connect and invert.

The connect selection is what starts the 706RC-ATEX looking for a remote unit.

The inversion mode allows the user to operate the 706RC-ATEX while it is upside down. The Invert menu has 3 possible settings.

- never The display and keypad are never inverted.
- master ATEX is The inversion occurs only when the 706RC-connected to a remote unit.
- always The display and keypad are always inverted.

Step 4 Verify that the connect selection is highlighted, and press the ✓ key.

The 706RC-ATEX will now start searching for a remote unit. The 706RC-ATEX will connect to the first available remote unit to come in range.

Once the 706RC-ATEX finds a remote unit, the screen on the 706-ATEX/706RC-ATEX RC becomes the screen for the remote. When you press a key on the 706RC-ATEX, you are really pressing the key on the remote unit. All setup functions are then available from the controls of the 706RC-ATEX that would normally be available for manual control.

Please see Chapter 4 for a complete explanation of the 706RC-ATEX functionality.

Calibration of the 706-ATEX/706RC-ATEX

Step 1 To calibrate the 706-ATEX/706RC-ATEX, enter the Tools menu and highlight Calibrate.



If you need to change the Cal Level to reflect a different calibrator output level, go to Step 2. If the Cal Level is already set to the correct value (the output signal in dB of your calibrator), press ⓥ and proceed to Step 8.

Step 2 Press ⓥ to enter the Calibrate tools menu.

If you are using a Larson Davis Model CAL250, this should be set to 114.0. If you are using a Larson Davis CAL150 or CAL200, the value could be set to either 94.0 or 114.0 depending on the setting of the calibrator's adjustable level switch.

NOTE: The instrument will verify that the calibration tone is within the expected range, if it is not, the calibration will not be changed.

Step 3 Press ▼ to highlight the Cal Level. Then press ✓ to enable editing the Cal Level.

Step 4 Use ◀ or ▶ to highlight the number(s) you wish to change.

Step 5 Then use ▲ or ▼ to increment/decrement to the desired number.

Step 6 When you have the correct calibrator output level entered, press ✓ to accept.

Step 7 Press ▲ to highlight Perform Cal.

Step 8 Insert the 706-ATEX/706RC-ATEX microphone into the calibrator opening. Switch the calibrator on.

Step 9 Press ⓥ to initiate the calibration

During the calibration, notice the circle building on the left side of the display.

When the calibration is finished, the completed circle changes to a check √.



Step 10 Press ⓥ to accept the calibration.

Step 11 Press ⓥ again to keep this calibration. You will be returned to the Calibrate menu.

Step 12 Press ⓧ to return to the Tools menu.

Using the Lock Feature

The 706-ATEX/706RC-ATEX has a very useful keypad Lock feature. When the Lock is activated, the 706-ATEX/706RC-ATEX's display and keypad are disabled. This renders the 706-ATEX/706RC-ATEX virtually tamper proof during operation. The Lock is activated, and deactivated by way of a 4-digit user defined Lock code.

Activating the Lock

Step 1 From the Tools menu, press ⓓ to highlight Lock.



Step 2 Press ✓ to bring up the Lock combination screen.

Step 3 Type in any four-digit combination using ⓛ and ⓡ to move between number fields and ⓤ and ⓓ to increment and decrement the numbers.

Step 4 Press ✓ to enter the combination code. The following message/warning will appear.



Step 5 Press ▶ to highlight YES.

Step 6 Press ✓ to activate the Lock.

Deactivating the Lock

Step 1 To deactivate the lock, press any key on the 706-ATEX/706RC-ATEX keypad to bring up the Lock combination entry screen.

Note: If the 4-digit lock combination has been forgotten, the unit can be unlocked by connecting to the unit using the Blaze® software.

Step 2 Using ◀ and ▶ to move between number fields and ▲ and ▼ to increment and decrement the numbers, enter the 4-digit Lock combination you defined earlier.

Step 3 Press ✓ to enter the combination code and deactivate the Lock. You will be returned to the display screen prior to entering the Tools menu.



Setting the 706-ATEX Date and Time

Step 1 Opening the TOOLS Menu

Press the TOOLS key to open the Spark® dosimeter's menu. The following display should appear (with a 706RC-ATEX, "Emulate" will be the first item displayed on the menu).



Step 2 Selecting "Set Time"

Press the DOWN arrow key several times until "Set Time" is highlighted.

Press the CHECK key (?) and the following display will appear.



The first time displayed (i.e. 09:50:38) is the time that is currently set in the dosimeter. The seconds will be incrementing as the display is viewed.

Step 3 Setting the Hours, Minutes, and Seconds

The display shows the value that can be changed. For example, in the figure above the hours (09) are highlighted. Use the RIGHT and LEFT arrow keys to move back and forth between the hours, minutes, and seconds settings. Use the UP and DOWN arrow keys to change each setting.

For example, the figure below shows that the time has been changed to 14:27:30



Press the CHECK key (?) to store the new time in the dosimeter (If you decide to not change the current time, press the RESET key, instead of CHECK, to exit the menu.)

Step 4 Selecting "Set Date"

After setting the time and pressing the CHECK key (?), the instrument will again display the TOOLS menu as shown below.

Press the DOWN arrow key once to highlight the "Set Date" selection as shown below.

Press the CHECK key (?) and the following display will appear.



The first date displayed (i.e. 9/22/2003) is the date that is currently set in the dosimeter. The date is displayed as month / day / year.

Step 5 Setting the Month, Day, and Year

The display shows the value that can be changed. For example, in the figure above the month (9) is highlighted. Use the RIGHT and LEFT arrow keys to move back and forth between the month, day, and year settings. Use the UP and DOWN arrow keys to change each setting.

For example, the figure below shows that the date has been changed to 12/08/2011.

Press the CHECK key (?) to store the new date in the dosimeter (If you decide to not change the current date, press the RESET key, instead of CHECK, to exit the menu.)

Step 6 Viewing the New Time and Date

After setting the date and pressing the CHECK key (?), the instrument will again display the TOOLS menu as shown below.

Use the UP arrow key to highlight the Timers selection, and CHECK key (?) to display the newly set time and date.



Tour Tools Menu

The tools area is where you go to changes settings in the 706-ATEX/706RC-ATEX. Let's tour the Tools Menu.

Step 1 Press ⓣ on the 706-ATEX/706RC-ATEX keypad to enter the Tools menu.



Step 2 Press ▼ to highlight Setup.

Step 3 Press ✓ to enter the Setup menu.

Within the Setup menu, you can access the 706-ATEX/706RC-ATEX setup functions such as Gain, Frequency Weighting, Peak Weighting, Detector setting, Time History Period, Dose 1 settings, Dose 2 settings, Dose 3 settings, and Dose 4 settings. The choices for these different setup functions are:

- Gain (0, 10, 20, or 30 dB)
- Frequency Weighting (A or C)
- Peak Weighting (Unweighted or C)
- Detector Setting (Slow or Fast)
- Time History Period (1, 5, 10, 30, or 60 seconds)
- Dose 1 (Threshold Level, Exchange Rate (3, 4, 5, 6), Criterion Time, Criterion Level)
- Dose 2 (Threshold Level, Exchange Rate (3, 4, 5, 6), Criterion Time, Criterion Level)
- Dose 3 (Threshold Level, Exchange Rate (3, 4, 5, 6), Criterion Time, Criterion Level)
- Dose 4 (Threshold Level, Exchange Rate (3, 4, 5, 6), Criterion Time, Criterion Level)

Changing the Gain

Changing the Gain of the 706-ATEX/706RC-ATEX will alter the measurement range of the instrument. An increase in Gain will enable the 706-ATEX/706RC-ATEX to measure lower noise levels. It will also reduce the upper measurement range of the 706-ATEX/706RC-ATEX. To change the Gain:

Step 1 Verify that Gain is the highlighted choice in the Setup menu.

Step 2 Press ✓ to enter the Gain selection menu.

Step 3 Press ▲ to increment through the four Gain choices (use ▼ to return to the previous selections).

Step 4 Press ✓ to enter the new Gain value or ✓▼ to exit without making the change.

The new Gain selection is now active.

Changing the Frequency Weighting

The choices are either A or C weighting, although A is the most common setting.

Step 1 To change the RMS frequency weighting, first highlight Frq Wght by pressing ▼ in the Setup menu.

Step 2 Press ⓥ to enter the Frequency Weighting edit field.



Step 3 Press ⏶ or ⏷ to move to your desired weighting value.



Step 4 Press ⓥ to accept the new choice or press ⏬ to exit without making the change.

Changing the Peak Weighting

This function is used to change the weighting of the 706-ATEX/706RC-ATEX's Peak Detector. The choices are either C or U (Unweighted). Peak weighting is independent of the RMS weighting.

Step 1 To change the Peak weighting, first highlight Pk Wght by pressing ⏷ in the Setup menu.

Step 2 Press ⓥ to enter the Peak Weighting edit field.

Step 3 Press ⏶ or ⏷ to move to the desired weighting value.

Step 4 Press ✓ to accept the new choice or ⏏ to exit without making the change.

Changing the Detector

This function is used to change the rate of the 706-ATEX/ 706RC-ATEX's rms (root-mean-square) detector which is used to collect data. This is normally set to Slow for dosimetry applications, however you need to verify this with your particular countries regulations. Choices are either S (Slow) or F (Fast).

Step 1 To change the Detector rate, first highlight Detector by pressing ⏷ in the Setup menu.

Step 2 Press ✓ to enter the Detector edit field.

Step 3 Press ⏶ or ⏷ to move to your desired Detector rate.

Step 4 Press ⓥ to accept the new choice or ⓧ to exit without making the change.

Changing the Time History Period

The Time History Period or Sample Interval sets how often a sample is stored within the 706-ATEX/706RC-ATEX. Time Histories are very helpful if you wish to see how the sound varies during the measurement period. A short Sample Interval (1-second) will provide excellent resolution, but requires more 706-ATEX/706RC-ATEX memory. A longer Sample Interval (1-minute) is normally sufficient for work noise exposure surveys. The choices here are 1, 5, 15, 30, or 60 seconds). Shorter sample periods can be combined later in the Blaze® software after download.

Step 1 To change the Time History Period, first highlight Tm Hst Per by pressing ⓓ in the Setup menu.

Step 2 Press ⓥ to enter the Time History Period edit field.

Step 3 Press ⓤ or ⓓ to cycle to your desired Time History Period.

Step 4 Press ✓ to accept the new choice or ⏻ to exit without making the change.

Changing the Dose Measurement Settings

The 706-ATEX/706RC-ATEX has the facility to measure 4 simultaneous dose measurements. These are denoted as Dose 1, Dose 2, Dose 3, and Dose 4. Each of these Dose measurements can have independent settings, and thus be set with different Threshold Levels, Exchange Rates, Criterion Levels, and Criterion Times.

Step 1 To change the Dose 1 settings, highlight Dose 1 by pressing ▼ in the Setup menu.

Step 2 Press ✓ to enter the Dose 1 Settings menu.

Changing the Threshold Level

Step 3 Press ✓ to enter the Dose 1 Threshold Level edit field.



Step 4 Press ◀ and ▶ to move between digits and ▲ or ▼ to increment or decrement that digit.



Step 5 Press ✓ to accept the new choice or ⏻ to exit without making the change.

Changing the Exchange Rate

Step 6 Press ▼ to highlight the Dose 1 Exchange Rate.

Step 7 Press ✓ to enter the Dose 1 Exchange rate edit field.

Step 8 Press ▲ or ▼ to cycle to your desired Exchange Rate (3, 4, 5, or 6).

Step 9 Press ✓ to accept this Exchange Rate choice or press ⏻ to exit without making the change.

Changing the Criterion Time

Step 10 Press ▼ to highlight the Dose 1 Criterion Time.

Step 11 Press ✓ to enter the Dose 1 Criterion Time edit field.

Step 12 Press ◀ and ▶ to move between digits and ▲ or ▼ to increment or decrement that digit.

Step 13 Press ✓ to accept the new Dose 1 Criterion Time or press ⏏ to exit without making the change.

Changing the Criterion Level

Step 14 Press ✓ to enter the Dose 1 Criterion Level edit field.

Step 15 Press ◀ and ▶ to move between number fields and ▲ or ▼ to increment/decrement the numbers to your Dose 1 Criterion Level of choice.

Step 16 Press ✓ to accept this new Dose 1 Criterion Level or press ⏏ to exit without making the change.

Changing the Dose 2, Dose 3, and Dose 4 measurement setup is achieved in the same manner as shown with Dose 1.

The values that were entered in this tutorial do not necessarily reflect desirable or accurate dose settings. Please ensure that your 706-ATEX/706RC-ATEX contains the settings that are pertinent to your particular country's regulatory requirement. For OSHA, these values are: RMS Weighting – A; Peak Weighting – Unweighted; Detector Rate – Slow; Exchange Rate – 5 dB; Threshold Level – 80 dB; Criterion Level – 90 dB; Criterion Time – 8 hours.

Step 17 Press ⏬ to return to the Setup Menu

Step 18 Press ⏬ again to exit to the Tools Menu

Memory Settings

The 706-ATEX comes standard with 1 Mbyte of non-volatile memory. (The 706RC-ATEX has a memory capacity of 4 Mbytes) The Memory Time (how much run time you have with the current 706-ATEX/706RC-ATEX settings) can be viewed. Memory Used (in %) and the Memory Free (in %) can also be viewed. You can also clear the Memory by using Clear All.

Step 1 In the Tools menu, press ⏷ to highlight Memory.

Step 2 Press ✓ to enter the Memory menu. Use the ⏷ and ⏶ arrow keys to navigate through the menu.

Memory Time

Mem Time (Memory Time) lists the total time (in hh:mm) the 706-ATEX/706RC-ATEX can run before the memory is full, using the current measurement settings. The main variable controlling this value is the Time History Period setting.

Memory Used

Mem Used (Memory Used) lists the amount of consumed memory (in percent). The 706-ATEX and the 706RC-ATEX both have 4 Mbytes of on-board memory.

Memory Free

Mem Free (Memory Free) lists the amount of available memory remaining in the 706-ATEX/706RC-ATEX.

Number of Records Stored

This screen shows you how many files are currently stored in the Spark® instrument. A record consists of a Run and a Stop. Each Run/Stop is considered a separate record. The 706RC-ATEX can only hold 50 Records as well.

Installed Bytes of Memory

Indicates the number of bytes of memory that were originally installed in the Spark® instrument.

Upload (706RC-ATEX only)

Upload is the function that is used to upload data from a remote unit into the 706RC-ATEX, which can then be uploaded to the Blaze® software. Multiple instrument uploads can be taken before the 706RC-ATEX's memory fills. The 706RC-ATEX will not allow you to upload a remote unit unless there is sufficient memory available in the 706RC-ATEX to take the entire remote memory.



Clear All

Clear All memory is used to reset the memory in the 706-ATEX/706RC-ATEX. All measurement data residing in the 706-ATEX/706RC-ATEX memory will be lost when this function is performed.

WARNING!

Clear All is an unrecoverable function. All of the 706-ATEX/706RC-ATEX's data will be lost when this feature is used. The 706-ATEX/706RC-ATEX must be stopped to perform this function.

To clear the 706-ATEX/706RC-ATEX memory:

Step 1 Press ⓥ to initiate the reset.

Step 2 Press ⓡ to highlight YES.

Step 3 Press ⓥ to clear the memory.

Notice that the Memory Free value has changed to 100% and the Memory Used value has changed to 0%.

Step 4 Press ⓓ twice to exit to the Tools menu.

About

About screen contains the firmware version and serial number of your 706-ATEX/706RC-ATEX.

Step 1 Press ⓓ to highlight About.

Step 2 Press ⓥ enter the About Screen.

The firmware version of the 706-ATEX/706RC-ATEX is displayed.

Step 3 Press ▼ to see the 706-ATEX/706RC-ATEX serial number.

The706-ATEX's serial number appears.

Step 4 Press ⏬ to exit to the About Screen.

The Power Menu

Step 1 Press ▼ to highlight Power.

Step 2 Press ✓ to enter the Power menu.

The first displayed value is the Battery Time. This indicates the remaining time run time on the current batteries. This run time is dependent on a proper battery type selection.

Step 3 Press the ▼ to see the battery type being used. Press the ✓ key to select the type of battery you wish to use.

WARNING! In explosive environments, only approved alkaline batteries can be used in this instrument. (See page A-8 for approved batteries.)

Step 4 Press ▼ until Auto-Off is highlighted.

Step 5 Press ▼ until Volts is highlighted.

The Volts value displayed, reflects the remaining voltage in the batteries. New alkaline batteries will yield 1.5V each for a total displayed battery voltage value of about 3V. Fully charged NiCD's or NiMH's should indicate roughly 2.4V.

If you are using rechargeable batteries (NiCD or NiMH), it may take a few moments for the battery voltage value to stabilize.

Auto-Off

The Auto-Off feature allows you to set a time whereby the 706-ATEX/706RC-ATEX automatically powers off. If a 706-ATEX/706RC-ATEX key has not been pressed during this Auto-Off period, the 706-ATEX/706RC-ATEX automatically shuts off to conserve power.

The maximum time that can be set is 60 minutes. The minimum is 1 minute. Selecting the "Never" option disables this feature, leaving the 706-ATEX/706RC-ATEX power on indefinitely, or until the unit is powered off using ⏻.

If the 706-ATEX/706RC-ATEX Timer has been set, the Auto-Off feature will be disabled until one minute after completion of the last timer stop time. Auto-Off is also disabled during a manual start (run) until the unit is stopped or when the Spark® instrument is in range of any active IR device.

Step 6 Press ✓ to edit the Auto-Off time.

Step 7 Press ▼ to cycle through the Auto-Off times.



Step 8 When you have highlighted your Auto-Off time, press ✓ to accept.

Step 9 Press ⏏ to exit to the Power menu.

Timers

The Timers area is used to view the current time and date of the instrument's built in clock, and to view the automatic run/stop timers, if they have been established. The time, date and the timers can be changed using the Blaze® software. Time and date can also be changed manually with the instrument. Automatic timers, however, can only be changed using Blaze®.

Step 1 Press ▼ to highlight Timer.

Step 2 Press ✓ to enter the Timers screen.



Time Now show the Time and Date of the 706-ATEX/706RC-ATEX's clock

Step 3 Press ▼ to see if Timers have been set.



If a Timer is set, you can view the Start/Stop Times and Dates from this display. TO1 displayed in the upper right corner of the screen is the first action to be taken. This will always be a Timer start. In this case, the timer is set to start on September 13, 1999, at 2:30 PM. Press the ▼ arrow to see the stop time.



Step 4 Press ⏏ to exit to the Timers menu.

If the Repeat Twice Daily selection had been made, there would be two more timer indicators. TO3 and TO4.

If the 706-ATEX/706RC-ATEX is manually started (run) prior to the timer start time, the unit will still stop at the programmed timer stop time/date.

Display

Display allows you to adjust the contrast of the 706-ATEX/706RC-ATEX display, adjust the brightness of the display backlight, and establish a backlight shut off time to conserve battery power.

Step 1 Press ▼ to highlight Display.

Step 2 Press ✓ to enter the Display menu.

Contrast adjusts the contrast of the 706-ATEX/706RC-ATEX screen. The larger the percentage, the darker the screen will appear. To adjust the contrast, highlight the contrast menu item, press the ✓ key, and use the ▲ and ▼ arrows to adjust to the desired level. When finished, press the ✓ key to return to the display menu.

Step 3 Press ▼ to highlight BL Bright (Backlight Brightness).

This adjusts the brightness of the backlit display of the 706-ATEX/706RC-ATEX. A value of 0% turns the backlight off. This maximizes the battery life of the 706-ATEX/706RC-ATEX.

Step 4 Press ▼ to highlight BL Save (Backlight Save).

The Backlight Save feature allows you to set a time whereby the 706-ATEX/706RC-ATEX screen backlight automatically powers off. If a 706-ATEX/706RC-ATEX key has not been pressed during this Auto-Off period, the backlight is automatically turned off to conserve power.

Step 5 Press ⏏ to exit to the Display menu.

CHAPTER

4 706RC-ATEX Operation

The 706RC-ATEX is a 706-ATEX with the added capability to communicate with other Spark® Family instruments (703+ATEX, 705+ATEX, 706-ATEX). This remote function will allow the user to have complete control, including observation of the data being gathered on the 706RC-ATEX screen.

Menu Structure

The menu structure for the 706RC-ATEX is identical to the menu structure of the standard 706-ATEX, except that an Emulate selection has been added to the top of the tools menu, and the Upload section has been added to the Memory menu. Within the Emulate menu, the user will select either Connect or Invert. The Upload selection allows for uploading data from other Spark® Family instruments into the 706RC-ATEX. These settings are explained later in this chapter.



Controlling a Remote Device

Note: The remote dosimeter (703+ATEX or 705+ATEX) utilizes a digital infrared data transmission and control mechanism. The infrared transceivers operate on a "line of sight" principle, yet the infrared light beams will disperse in a conical manner and may reflect off highly polished surfaces including tabletops and notebook paper. The 706RC-ATEX can only process digital information from ONE remote dosimeter at a time. Thus, it is important to allow only ONE remote dosimeter to communicate with the 706RC-ATEX at one time. Physically separate the remote devices such that they do not interfere with one another.

Keys pressed on the 706RC-ATEX will be immediately sent to the remote as if you had pushed the button on the remote unit. All functions available in the remote device will be accessible from the 706RC-ATEX. The key response and screen update performance of the remote will typically be as quick as a regular 706-ATEX. To exit the emulation mode and terminate the connection to the remote, the 706RC-ATEX operator presses the ⏻(power) key. It is not possible to turn the remote off by using the 706RC-ATEX. The remote remains fully functional during emulation.

Place a single remote unit in front of the 706RC-ATEX.

To connect with the remote, select Connect from the Emulate menu.

The 706RC-ATEX master will indicate that it is searching for “(ANY 70x)". The serial number of the first remote that comes in range is recorded by the 706RC-ATEX.

After the connection is made, the 706RC-ATEX's screen will be replaced by the remote's screen. The "mail" icon will flash on the 706RC-ATEX as an indication that the display is showing the remote's data. The "mail" icon of the remote (706-ATEX and 706RC-ATEX only) will come on solid to indicate that it is being controlled by the 706RC-ATEX. If the connection is interrupted, the 706RC-ATEX will indicate that it is searching for a remote with the given serial number. To terminate the search, press the ⏻(power) key on the 706RC-ATEX.

Inversion Mode

The 706RC-ATEX can be used to control a remote instrument while a user is still wearing it. In order to point the 706RC-ATEX's IR window at the remote's IR window, the 706RC-ATEX can be held upside down. To facilitate this type of use, the 706RC-ATEX has an optional "inversion mode". Enabling this option causes both the 706RC-ATEX's display and the arrow keys on the keypad to be inverted. An example of an inverted screen is shown below.

Figure 4-1 ***Inverted and Standard Display Modes***

The inversion mode allows the user to operate the 706RC-ATEX while it is upside down. The Invert menu has 3 possible settings.

- **never** The display and keypad are never inverted.

- **master** The inversion occurs only when the 706RC-ATEX is connected to a remote.

- **always** The display and keypad are always inverted.

To change the invert status of the instrument:

Step 1 From the ⓘ tools menu, verify that Emulate is highlighted, and press the check key.

Step 2 Use the ▼ arrow key to highlight Invert, and press the check key.

Step 3 The ▼ and ▲ arrow keys can now be used to select the inversion mode for the 706RC-ATEX.

Step 4 After the desired mode is showing, press the ✓ key to enter the selection, and return to the Emulate menu.

The screen and keypad will invert when the connect menu item is selected and the ✓ key pressed.

Record Transfer

The 706RC-ATEX is able to upload records from remote units. Both the 706RC-ATEX and the remote will need to be stopped prior to initiating the transfer.

To initiate the Upload:

Step 1 Press the ⓣ (tools) key on the 706RC-ATEX while it is connected to a remote unit.

Step 2 Use the ⓤ and ⓓ arrow keys to scroll to the Memory menu item.

Step 3 Press the ⓒ check key.

Step 4 Use the ⓤ and ⓓ arrow keys to scroll to the Upload menu item, and press the ⓒ key.



The data transfer rate will be 1/3 to 1/2 the speed of an equivalent transfer to a PC (the available amount of free RAM on the 706RC-ATEX limits the size of the data packet). A 1 Megabyte transfer will take approximately 6 minutes. The 706RC-ATEX will refuse to start the transfer if it does not have enough free memory to store the entire used memory of the remote.

If the beam is broken during a file transfer, the 706RC-ATEX will continuously attempt to complete the transfer, unless the user elects to cancel the operation



If the beam is restored, the file transfer will resume. During transfer, the 706RC-ATEX's screen will display transfer statistics.

After the data upload is complete, the remote instrument may momentarily display a higher sound pressure level, which will then quickly come down to the regular ambient noise level. This is normal.

The following screen shows what type of information is available during a transfer:

- The total number of bytes to transfer (i.e. 117kB)
- The percentage of total bytes transferred (i.e. 12%)
- The total number of records to transfer (i.e. 2)
- The record currently being transferred (i.e. 1)
- The percentage of the current record that has been transferred (i.e. 80%)



If the operator of the 706RC-ATEX elects to cancel a transfer, the 706RC-ATEX will automatically delete the partially transferred record from its memory. The records on the 706RC-ATEX can be transferred into Blaze® as usual (each record will contain the serial number of the unit that created the record).

APPENDIX

A

Spark® 706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX Specifications

Specifications are subject to change without notice. Numerical values given are typical. Refer to specific calibration or test results for accurate data on a specific unit.

General Characteristics

Type Precision

The Larson Davis Spark® series meters with attached MPR001, combined preamplifier, 3/8" microphone cable and connector, is a Type 2 combination personal noise dosimeter and personal noise exposure meter.

Reference Direction

The reference direction is perpendicular to the plane of the microphone diaphragm.

Typical Measurement Ranges

RMS Detector

- Dynamic Range > 75 dB
- Primary Indicator Range > 70 dB

Measurement Ranges			
Gain = 30dB	Gain = 20dB	Gain = 10dB	Gain = 0dB
43 - 113 dBA	53 - 123 dBA	63 - 133 dBA	73 - 143 dBA

- Crest Factor Limit > 50
- Pulse Range = 70dB

The instrument's Noise Floor, Lower Limit, and Overload Level, vary, depending upon the sensitivity of the attached microphone. Typical values for a MPR001 or MPR002 3/8" microphone are listed in the table below.

Typical Noise Floor **A-Weighted**	**Typical Lower Limit** A-Weighted	**Typical Overload**	**Typical Max Peak Level**
Gain = 30dB	Gain = 30dB	Gain = 0dB	Gain = 0dB
35.0 dBSPL	40.0 dBSPL	143.0 dBSPL	146.0 dBSPL

Worst Case			
Noise Floor **A-Weighted**	**Lower Limit** **A-Weighted**	**Overload**	**Max Peak Level**
Gain = 30 dB	Gain = 30 dB	Gain = 0 dB	Gain = 0 dB
40 dB SPL	45 dB SPL	140 dB SPL	143 dB SPL

Peak Detector

- Dynamic Range > 40 dB
- Primary Indicator Range > 35 dB
- Measurement Range is approximately 80 to 146 dBSPL Peak in 4 ranges

Calibration Reference Level

The reference level is 114.0 dBSPL.

Frequency Weightings

The available frequency weightings for the Model 706-ATEX/703-ATEX are described in the following table.

Detector	**A Weight**	**C Weight**	**Flat Weighting**
RMS	√	√	
Peak		√	√

The typical frequency response of the Peak detector with FLAT weighting is shown in the following table.

Nominal Frequency Hz	Unweighted Peak FLAT Weighting - dB	Nominal Frequency Hz	Unweighted Peak FLAT Weighting - dB	Nominal Frequency Hz	Unweighted Peak FLAT Weighting - dB
10	–0.4	160	0.0	2500	0.0
12.5	–0.3	200	0.0	3150	0.0
16	–0.3	250	0.0	4000	0.0
20	–0.2	315	0.0	5000	0.0
25	–0.2	400	0.0	6300	–0.1
31.5	–0.1	500	0.0	8000	–0.1
40	–0.1	630	0.0	10000	–0.1
50	0.0	800	0.0	12500	–0.2
63	0.0	1000	0.0	16000	–0.2
80	0.0	1250	0.0	20000	–0.2
100	0.0	1600	0.0		
125	0.0	2000	0.0		

Detector Time Weightings

The available RMS detector time weightings are FAST and SLOW.

Operating Temperature Range

The SPL level varies ≤ 0.5 dB when the complete instrument is tested over the -10° C to 50° C temperature range. The reference reading, for this test, is taken at 20° C and 36% relative humidity (RH); the input signal is at 1000 Hz at 114.0 dB SPL.

Effects of Humidity

The SPL level varies ≤ 0.5 dB when the complete instrument is tested over the 30% to 90% RH range. This test is performed at 40° C, with an input signal of 1000 Hz at 114.0 dB SPL.

Storage Temperature

Permanent damage can occur when stored or operated above 60° C or below -20° C. Condensation of moisture will make readings inaccurate but will be correct when moisture has dissipated.

Effects of Magnetic Fields

The SPL level varies ≤ 0.5 dB when the complete instrument is tested in an 80 A/m, 60 Hz magnetic field (worst case orientation). Even at a field strength of 240 A/m the SPL level variation is still ≤ 0.5 dB.

Effects of Strong Acoustic Fields

With the microphone replaced by an equivalent electrical impedance, the instrument was placed in a sound field of 100 dBSPL. The acoustic signal (sine wave) was swept from 31.5 Hz to 8000 Hz at a 0.1 octave/second rate. The strong acoustic field did not affect the reading on the instrument.

CE

Compliance with Electromagnetic Compatibility Standards

CE Standard	Description
IEC 61326-1 (2005)	Electrical equipment for measurement, control and laboratory use – EMC requirements – Part 1: General requirements. Consisting of the tests below.
IEC 61000-4-2 (2008)	Electrostatic discharge immunity test. (±4kV contact, ±8kV air discharge).
IEC 61000-4-3 (2006)	Radiated, radio-frequency, electromagnetic field immunity test. AM at 1 kHz, 80%. 26 MHz to 1.0 GHz (10 V/m), 1.4 GHz to 2.0 GHz (3 V/m), 2.0 GHz to 2.7 GHz (1 V/m). Δ<±2 dB from 85 dB SPL.
IEC 61000-4-8 (2001)	Power frequency magnetic field immunity test. 80 A/m. Δ<±2 dB from 85 dB SPL.

Effects of Mechanical Vibration

The entire instrument (including the microphone and preamplifier) was sinusoidally vibrated at an acceleration of 1 m/s^2 at 1/3 octave frequencies from 10 Hz to 1000 Hz. The results of this test are shown in the following tables.

X Axis: Acceleration parallel to the mic diaphragm (mic/preamp body was laid on its side on the shaker)

Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL	Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL
10	66.1	**160**	73.9
12.5	66.5	**200**	73.2
16	68.0	**250**	70.5
20	69.2	**315**	76.9
25	70.7	**400**	76.0
31.5	71.7	**500**	76.2
40	72.6	**630**	75.2
50	73.2	**800**	75.6
63	73.7	**1000**	75.9
80	74.1		
100	74.4		
125	74.1		

Y Axis: Acceleration perpendicular to the mic diaphragm (mic/preamp body was laid on its side on the shaker)

Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL	Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL
10	68.4	**160**	80.6
12.5	69.6	**200**	80.5
16	72.1	**250**	79.6
20	73.9	**315**	81.8
25	75.7	**400**	81.6
31.5	77.5	**500**	81.5
40	78.8	**630**	82.5
50	79.6	**800**	83.2
63	80.2	**1000**	84.3
80	80.4		
100	80.7		
125	80.7		

Z Axis: Acceleration perpendicular to the top surface of the MRP001 cap

Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL	Nominal Frequency Hz	Instrument Reading (10 sec Leq) dB(C) SPL
10	66.1	160	66.1
12.5	66.1	200	66.1
16	66.1	250	66.1
20	66.1	315	66.1
25	66.1	400	66.1
31.5	66.1	500	66.1
40	66.1	630	66.1
50	66.1	800	66.1
63	66.1	1000	66.6
80	66.1		
100	66.1		
125	68.5		

Microphone Extension Cables

Microphone extension cables cannot be used with the Spark® series meters.

Calibration Procedure

The calibration procedure for the Spark® series meters is described on page 2.13 and 3.11 of this manual.

Reference Frequency

The reference frequency is 1000 Hz.

Stabilization Time

At power-on, the Spark® series meters will not proceed to a running condition until it is allowed to stabilize. A short stabilization time (approx. 5 seconds) is also invoked when certain settings (Weighting, Gain, etc.) are changed.

Microphone Electrical Impedance

The Larson Davis ADP046 should be substituted for the MPR001 microphone when performing electrical tests on the Spark® series meters.

Functions Measured

- Dose, Projected Dose, Time Weighted Average (TWA), and Leq
- Exposure in Pa^2S and Pa^2H, (including the E8 and E40 calculations)
- SPL, Lmax, Lmin, and Lpeak
- Exceedance count and duration for 115 and 120 dBSPL (RMS), and 140 dBSPL (Peak)

- Ln Table for SPL measurements (5 minute intervals, 0.5 dB resolution bins)
- Time History

Data Storage

- 4 Mbyte Memory
- Unlimited data memory retention with batteries removed.
- 2 minute (typical) data retention for clock during battery change.
- 5 second download (typical time required to transfer 8 hours of data, sampled at a 60 second rate, from a Spark® instrument to the Blaze® software)

The Spark noise dosimeters store a time-history sample once every 1, 5, 15, 30, or 60 seconds (user selectable). If necessary, longer sample periods can be calculated by the Blaze® software. Each time history sample contains the Leq, Lmax, Lmin, and Peak level for each sample period. In addition, four time weighted averages (TWAs) for each sample period are also stored (the four TWAs have four corresponding user selectable exchange rates and thresholds).

In addition to the time history samples, the Spark® instruments also store an LN table once every 5 minutes. The LN table has bins from 60dB to 150dB in 0.5dB increments.

Note: Recording time is also limited by battery life. See "Larson Davis Spark® Dosimeters Run-time Specifications" on page - A-9

Storage Capacity of Spark® Instruments

Sample Period	4 Mbyte Memory Maximum Storage Time (hh:mm)
1 second	54:48
5 second	221:41
15 second	450:01
30 second	606:06
60 second	733:16

Data Communications

- Infrared serial interface for computer communications

- Data Rate: 115,000 bits per second

Digital Display

- 97 x 32 pixel, graphical LCD display
- Icons for displaying battery life, run time, overload, IrDA activity and Microphone Disconnect

Digital Display Resolution

- dB levels: 0.1 dB
- Dose: 0.001%
- Update Rate 5 times/second

Real-time Clock/Calendar

- Accuracy: 0.02% (-10 to 50 degrees C)
- 24 hour clock: hh:mm:ss
- 1 second resolution
- Year 2000 compliant
- 98 Automatic run/stop timers

Run-time Clock

- One second resolution
- Format: mm:ss, (switches to hh:mm after 59 minutes and 59 seconds and colon flashes to indicate seconds)
- 99 hours and 59 minutes

Standards Met

- IEC60651 - 1979 (including amendment 1 - 1993)
- IEC60804 - 1985 (including amendment 1 - 1985, and amendment 2 - 1993)
- IEC61252 - 1993 (including amendment 1-2000)
- ANSI S1.4 - 1983
- ANSI S1.25 - 1991

Power Supply

- 703-ATEX/703+ATEX/704-ATEX706-ATEX/706RC-ATEX operate with 2 AA alkaline batteries, approximately 100 hour operation
- 703-ATEX/703+ATEX/704-ATEX706-ATEX/706RC-ATEX operate with 2 AA NiCd or NiHM batteries, run time is reduced to approximately 40 hours
- 705-ATEX/705+ATEX operate with 1 AA alkaline battery, approximately 35 hour operation

- 705-ATEX/705+ATEX operate with 1 AA NiCd or NiHM batteries, run time is reduced to approximately 15 hours
- Current draw when unit is off is approximately 800µA (batteries will drain down in about 3 months)
- Actual run-times vary depending on operating conditions
- Battery-life indication selected from keyboard or computer program

Dimensions/Weight (with Microphone, Preamplifier, and Battery, and Case)

- Width: 2.5 inches (6.4 cm)
- Length: 5.6 inches (14 cm) - without MPR001 (Microphone, Preamplifier, cable and connector combination.)
- Depth: 1.25 inches (3.2 cm)
- Weight: 8.4 ounces (238 gm)

Approved Battery Types

To comply with the intrinsic safety rating of this instrument, one of the following battery types must be used when this instrument is operated in an explosive environment.

- Duracell® MN1500 AA Alkaline
- Eveready® Energizer® E91 AA Alkaline

WARNING! Do not replace batteries in an explosive environment.

In NON-explosive environments, NiCd or NiMH rechargeable batteries may be used. (See page 1-17 for recommended rechargeable batteries).

Larson Davis Spark® Dosimeters Run-time Specifications

Running at Various Temperatures

	Dosimeter	Total Run-time @ -10°C (hrs)	Total Run-time @ 25°C (hrs)
	703-ATEX, 703+ATEX, 704-ATEX, 706-ATEX, 706RC-ATEX	**70**	**100**
	705-ATEX, 705+ATEX	**14**	**35**

Running at Various Temperatures

Notes:

- The reduction of run-times in colder environments is due to the chemical attributes and nature of the batteries.
- Run-times at higher temperatures will give similar run-times as those of 25°C.
- All of the above times are with units using alkaline batteries. Run times will be shorter when using NiCd and NiMH batteries.

705-ATEX, 705+ATEX downloading after run-times

Because the 705-ATEX, 705+ATEX units use only one battery, they tend to consume more battery energy during the downloading of data. Below are times listed on how long the unit can run and still be able to download data with no problems. The times in the table above still apply for continuous run-times, however, the user may encounter problems during the downloading if the run-times are longer than the times listed in the table below. If problems are encounter during downloading of data simply install a fresh battery; the data will still be safe.

Dosimeter	**Run-time and still downloadable (hrs)**
705-ATEX, 705+ATEX	**12**

All of the above times are with units using alkaline batteries. Run times will be shorter when using NiCd and NiMH batteries.

Microphone Pinout

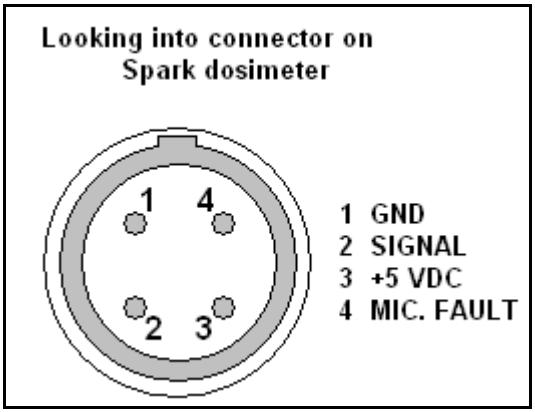

APPENDIX

B Frequently Asked Questions

Measurements and Interfaces

This FAQ answers the question "What do the Spark® Family of Instruments measure and how do they communicate with the computer and other instruments?

The Spark® Family of Instruments are **personal noise dosimeters**. They are designed to measure **workplace noise exposure**

The metrics they measure are:

Dose: 5 kinds: (ISO + 4 user selected)	Projected Dose (5, as with Dose)	TWA 4 (User selected)	SEL	SPL	Leq	Lmin	Lmax	Lpeak (Unweighted or C wght.)

PLUS: 4 - 6 Overall Ln values (Ln values can be changed even after measurement)

- The Spark® instruments deliver an incredible battery life of over **100 hours** continuous on two AA batteries (**35 hours for 705 and 705+ on 1 AA battery)**
- They also have quick **Infrared communication** capabilities with Blaze® software.

Model	LCD Screen	Keypad	Infrared Communication (with Blaze)	Remote Control Capability	Report Capability (in Blaze)	Casing
706RC	X	X	X	Control, Display, Upload	Complete Report	Lightweight Case
706	X	X	X	Sends info to 706RC or PC	Complete Report	Lightweight Case
705+			X	Sends info to 706RC or PC	Complete Report	Metal Case
705			X	N/A	Basic and Summary Reports	Metal Case
704	X	X	N/A	N/A	*Display Only – NO PC interface*	Lightweight Case
703+			X	Sends info to 706RC or PC	Complete Report	Lightweight Case
703			X	N/A	Basic and Summary Reports	Lightweight Case

Basic and Summary Reports means:	Summary Report Condensed Event Report Detailed Event Report
Complete Report means:	Summary Report Condensed Event Report Detailed Event Report Time History Report Time History Detailed Report Statistics Report

Connecting the IR Interface

This FAQ describes how to connect the Spark® noise dosimeter to a computer

The 706-ATEX, 706RC-ATEX, 705-ATEX, 705+ATEX, 703-ATEX, and the 703+ATEX all use an accompanying infrared interface module. The DVX008 can be used for direct serial connections. No driver is required for it. Or, for USB connections, use the DVX008A (with DVX008) or DVX009. These two interface modules do not need any additional drivers, as the Blaze® software installs all of them for you.

Identifying the COM Port

Step 1

Go to Start, Control Panel, and double click System.

Step 2

Within System Properties go to the Hardware tab, and click on Device Manager.

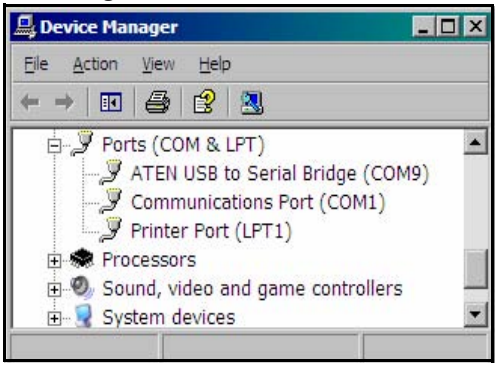

Step 3

Within Device Manager if you see anything that has to do with an IR port, disable it. This will ensure that the connection will be clear for Blaze®.

Step 4

Within Device Manager, go to Ports to see which COM port to use. You can see in the example above that the correct COM port is next to "ATEN USB to Serial Bridge" (COM9 in this example). This is the COM port you will use in Blaze®.

Step 5

Close Device Manager and System Properties.

Connecting to a Spark® Dosimeter in Blaze®

Step 1

Open Blaze®, and go to Options, Connection…

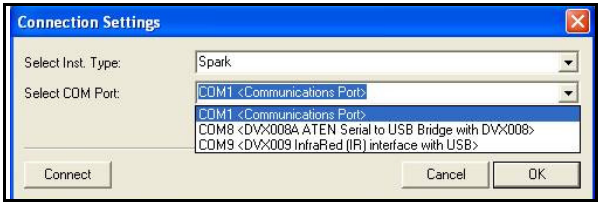

Step 2 Ensure that the instrument type is Spark

Step 3 If using a DVX008, select which COM port it is attached to, or select the DVX008A or DVX009 if one of these is being used instead. These all will appear in the Select COM Port pull down menu as the following:

- DVX008 appears as "COMn <Communications Port>"
- DVX008A with DVX008 appears as "COMn <DVX008A ATEN Serial to USB Bridge with DVX008>"
- DVX009 appears as "COMn <DVX009 Infrared (IR) interface with USB>"

Click **Connect** to make the connection.

NOTE: A text box may come up stating that the instrument time needs to be resolved with the computer time. Clicking OK will resolve the times and the Instrument Manager will come up.

APPENDIX

C Glossary

A-weight A standard frequency weighting to simulate the response of the human ear.

Calibration Adjustment of the system so that the measured sound level agrees with a reference sound source.

Calibration Check A check for variations between the measured level and a reference level - no adjustment is made to the system.

Criterion Duration Criterion duration is the time required for a continually applied sound of the selected criterion level to produce a dose of 100%. Criterion duration is typically 8 hours.

Criterion Level It is the level of a sound which will produce a dose of 100% if continually applied for the criterion time. The current OSHA criterion level is 90 dB.

C-weight A standard frequency weighting that simulates the response of the human ear to high amplitude (loud) noise.

Daily Personal Noise Exposure (LEP,d) $L_{EP,d}$ is the level, expressed in dB, of a constant sound over a specified normalization time period (T_n) that contains the same energy as the actual (unsteady) sound measured over a stated measurement period (T_2 - T_1). The measurement period is generally shorter, so the actual noise exposure is spread out (or normalized) over the normalization time period.

In Blaze, the Criterion Duration is the normalization time period, and the Run Time is the measurement period. For example, a measured Leq of 86 dB (Run Time = 4 hours) will produce an $L_{EP,d}$ of 83 dB (Criterion Duration = 8 hours).

In Blaze, $L_{EP,d}$ is annotated as Lep(x) where x represents the normalization time period or Criterion Duration (i.e. 8, 10, 12, etc. hours).

$$L_{EP,\,d} = 10Log_{10}\left(\frac{1}{T_n}\int_{T_1}^{T_2}\frac{P^2(t)}{P_0^2}dt\right)dB$$

OR

$$L_{EP,\,d} = Leq + 10Log_{10}[(T_2 - T_1)/Tn]\;dB$$

Leq = frequency weighted (A or C), equivalent-continuous sound pressure level in dB

P(t) = instantaneous, frequency weighted (A or C), sound pressure in pascals

P_0 = reference sound pressure, 20 μPa

T_n = normalization period (Criterion Duration)

T_2 - T_1 = measurement period (Run Time)

Detector Rate See Frequency and Exponential-Time Weighted Sound Level.

Dose See Noise Dose.

Exchange Rate Exchange rate is defined in ANSI S1.25 as "the change in sound level corresponding to a doubling or halving of the duration of sound level while a constant percentage of criterion exposure is maintained". Possible values for this field are 3, 4, 5, or 6. The current OSHA exchange rate is 5. A value of 3 will produce Leq-like levels.

Equivalent-Continuous Sound Level or Leq Leq is the level of a constant sound, expressed in dB, which in a given time period (T= T_2 - T_1) has the same energy as does a time varying sound. For the Spark dosimeters, an Leq value is recorded for 2 different time intervals. First, an Leq is recorded for the entire record's Run Time. Second, an Leq is recorded for each individual time history sample.

On the Spark dosimeters, Leq is annotated as L_{Aeq} or L_{Ceq} (A or C frequency weighted Leq)

.

$$Leq = 10Log_{10}\left(\frac{1}{T}\int_{T_1}^{T_2}\frac{P^2(t)}{P_0^2}dt\right)dB$$

P(t) = instantaneous, frequency weighted (A or C), sound pressure in pascals

P_0 = reference sound pressure, 20 μPa

T = measurement period (Run Time or time history interval), $T = T_2 - T_1$

Equivalent Time Weighted Average or TWA(x)

The level of a constant sound, expressed in dB, which if measured for a time period equal to the criterion duration, will produce the currently measured noise dose. The x in TWA(x) represents the criterion duration.

For example, suppose a worker is exposed to a noise environment with a TWA of 90 dB. Also, assume that the exchange rate is 5, the criterion level is 90 dB, and the criterion duration is 8 hours. After 1 hour, the worker's noise dose will be 12.5%, the TWA(8) will be 75.0 dB, and the TWA will be 90.0 dB. A TWA(8) of 75 dB indicates that if the worker is instead exposed to a noise environment with a TWA of 75 dB, then the noise dose after 8 hours will be 12.5%.

$$TWA(x) = TWA + q\log_{10}\left[\frac{T}{T_C}\right]$$

TWA = time weighted average sound level in dB

T = measurement period (Run Time)

T_C = criterion duration

q = exchange rate constant

if exchange rate = 3, q = 10
if exchange rate = 4, q = $4/\text{Log}_{10}(2) \approx 13.29$
if exchange rate = 5, q = $5/\text{Log}_{10}(2) \approx 16.61$
if exchange rate = 6, q = 20

Frequency & Exponential-Time Weighted Sound Level or *Lw*τ

*Lw*τ is the frequency and exponential-time weighted sound level in dB. *Lw*τ is sometimes referred to as the "rms sound level". Similarly the A or C frequency weightings are sometimes referred to as the "rms frequency weighting" (rms is an acronym for root-mean-square).

The Detector Rate setting on a Spark dosimeter corresponds to an exponential time constant of SLOW (1 second) of FAST (0.125 seconds), which is designated as τ in the equation below. These time constants are required by both ANSI and IEC standards.

In the *Lw*τ symbol, the *w* designates the frequency weighting (A or C) and the τ designates the exponential time constant (SLOW or FAST). **For example, on the Spark dosimeters, L_{AS} signifies the A weighted, SLOW expo-**

nential-time weighted sound level. Similarly, L_{CF} signifies the C weighted, FAST level.

$$Lw\tau = 10Log_{10}\left(\frac{1}{\tau}\int_{-\infty}^{t}\frac{P^2(\xi)e^{-(t-\xi)/\tau}}{P_0^2}d\xi\right)dB$$

$Lw\tau$ = frequency and exponential-time weighted sound level in dB

w designates the frequency weighting (A or C)

τ designates the exponential time constant (SLOW or FAST)

ξ = dummy variable of time integration

P(t) = instantaneous, frequency weighted (A or C), sound pressure in pascals

P_0 = reference sound pressure, 20 μPa

t = time of observation

τ = exponential time constant SLOW (1 second) or FAST (0.125 seconds)

Frequency Weighting See Frequency and Exponential-Time Weighted Sound Level

LEP,d See Daily Personal Noise Exposure.

Lmax Lmax is the maximum value, expressed in dB, of the frequency and exponential-time weighted sound level ($Lw\tau$) in a given time interval. For the Spark dosimeters, an Lmax value is recorded for 2 different time intervals. First, an Lmax is recorded for the entire record's Run Time. Second, an Lmax is recorded for each individual time history sample.

On the Spark display, the Lmax annotation includes the current settings for frequency weighting and exponential-time weighting. **For example, on a Spark dosimeter L_{ASmx} signifies the maximum, A weighted, SLOW level. Similarly, L_{CFmx} signifies the maximum, C weighted, FAST level.**

Lmin Lmin is the minimum value, expressed in dB, of the frequency and exponential-time weighted sound level ($Lw\tau$) in a given time interval. For the Spark dosimeters, the time interval is the record's Run Time.

On the Spark display, the Lmin annotation includes the current settings for frequency weighting and exponential-time weighting. **For example, on a Spark dosimeter L_{ASmn} signifies the minimum, A weighted, SLOW level. Similarly, L_{CFmn} signifies the minimum, C weighted, FAST level.**

Ln An Ln is the frequency and exponential-time weighted sound level ($Lw\tau$) that is exceeded n percent of the time in a give time interval. In Blaze, the time interval is the record's Run Time. For example, L10 is that sound level, expressed in dB, which was exceeded for 10% of the total Run Time. The default Ln percentages are 10, 30, 50, 70, 90. Different Ln values can be entered and recalculated in Blaze.

Noise Dose Noise dose is the percentage of time that a person is exposed to noise that is potentially damaging to hearing. Zero represents no exposure and 100 or more represents complete exposure. It is calculated by dividing the actual time of exposure by the allowed time of exposure. The allowed time of exposure is determined by the Criterion Duration and by the sound level (the higher the level, the shorter the allowed time). The sound levels must be measured with A-weighting in frequency and slow-exponential weighting in time.

$$Dose = (100/T_c)\int_{T_1}^{T_2} 10^{[(L_{AS}-L_c)/q]}dt$$

OR

$$Dose = (100T/T_c)\cdot 10^{[(TWA-L_c)/q]}$$

L_{AS} = frequency (A) and exponential-time (SLOW) weighted sound level in dB
(in the formula above, if the sound level is less than the user specified threshold level, then $L_{AS} = -\infty$)

L_c = criterion level in dB

T_c = Criterion duration in hours (8 hours typical)

T = Measurement period (Run Time), $T = T_2 - T_1$

TWA = time weighted average in dB

q = exchange rate constant

if exchange rate = 3, q = 10

if exchange rate = 4, $q = 4/\text{Log}_{10}(2) \approx 13.29$

if exchange rate = 5, $q = 5/\text{Log}_{10}(2) \approx 16.61$

if exchange rate = 6, q = 20

Peak

The maximum value of the instantaneous, frequency weighted (C or Unweighted), sound pressure in a given time interval. For the Spark dosimeters, a Peak value is recorded for 2 different time intervals. First, a Peak is recorded for the entire record's Run Time. Second, a Peak is recorded for each individual time history sample. Note, the Peak metric is not an integrated or averaged value, and it is measured with a separate peak detector circuit, which has a very fast rise time (see specifications for more details).

Blaze denotes the Peak value as "Max Lpeak". **On the Spark display, the Peak value is annotated as L_{Cpk} (C weighted peak) or L_{Upk} (Flat or Unweighted peak).**

Peak Frequency Weighting

It is the frequency weighting of the peak detector. Possible selections are C(weighted) or U (unweighted). Peak weighting is independent of the RMS frequency weighting.

Projected Noise Dose

The Noise Dose assuming that the current rate of noise dose exposure continues for the duration of a work shift. **On the Spark display, projected dose is shown as D_{PROJ}.**

$$ProjectedDose = (100/T)\int_{T_1}^{T_2} 10^{[(L_{AS}-Lc)/q]}dt$$

OR

$$ProjectedDose = 100 \cdot 10^{[(TWA-Lc)/q]}$$

L_{AS} = frequency (A) and exponential-time (SLOW) weighted sound level in dB

(in the formula above, if the sound level is less than the user specified threshold level, then $L_{AS} = -\infty$)

L_c = criterion level in dB

TWA = time weighted average in dB

q = exchange rate constant

if exchange rate = 3, q = 10

if exchange rate = 4, q = $4/\text{Log}_{10}(2) \approx 13.29$

if exchange rate = 5, q = $5/\text{Log}_{10}(2) \approx 16.61$

if exchange rate = 6, q = 20

Projected Sound Exposure

Projected sound exposure shows what the actual sound exposure will be (for a specified time period) if the current equivalent-continuous sound level (Leq) remains at its current level. The Spark dosimeters calculate an 8 hour and a 40 hour projected sound exposure. **On the Spark display,**

these values are shown as E_{A8} and E_{A40} (A frequency weighting) or E_{C8} and E_{C40} (C frequency weighting).

$$E_8 = \frac{8}{T}\int_{T_1}^{T_2} P^2(t)dt \quad \text{and} \quad E_{40} = \frac{40}{T}\int_{T_1}^{T_2} P^2(t)dt$$

P(t) = instantaneous, frequency weighted (A or C), sound pressure in pascals

$T_2 - T_1$ = measurement period (Run Time)

Sound Exposure (SE)

Sound Exposure is the total sound energy of the actual sound in a given time interval. For the Spark dosimeters, the time interval is the record's Run Time. The units for sound exposure are Pa^2S (pascal squared seconds) or Pa^2H (pascal squared hours).

Blaze denotes sound exposure as SE. **On the Spark display, sound exposure is shown as E_A or E_C (A or C frequency weighted sound exposure).**

$$E = \int_{T_1}^{T_2} P^2(t)dt$$

P(t) = instantaneous, frequency weighted (A or C), sound pressure in pascals

$T_2 - T_1$ = measurement period (Run Time)

Threshold Level

ANSI S1.25 defines threshold as "a sound level below which the dosimeter produces little or no dose accumulation as specified in this stand." The threshold should be selected to be within the measurement range of the instrument which is between 70 dB and 140 dB for the Spark. The current OSHA threshold is 80 dB.

Time Weighted Average (TWA)

The level of a constant sound, expressed in dB, which in a given time period ($T = T_2 - T_1$) would expose a person to the same noise dose as the actual (unsteady) sound over the same period. ANSI S1.25-1991 refers to the time weighted average as L_{av} or average sound level.

The Spark dosimeters simultaneously calculate 4 separate TWA values. The user specifies the exchange rate, criterion level, criterion duration, and threshold level for each TWA. These 4 separate TWA values are recorded for 2 different time intervals. First, 4 TWAs are recorded for the entire records record's Run Time. Second, 4 TWAs are recorded for each individual time history sample.

$$TWA = q \cdot \log_{10}\left[\frac{1}{T}\int_{T_1}^{T_2} 10^{(L_{AS})/q}\,dt\right]$$

L_{AS} = frequency (A) and exponential-time (SLOW) weighted sound level in dB
(in the formula above, if the sound level is less than the user specified threshold level, then $L_{AS} = -\infty$)

T = measurement period (Run Time or time history interval), $T = T_2 - T_1$

q = exchange rate constant

if exchange rate = 3, q = 10
if exchange rate = 4, $q = 4/\text{Log}_{10}(2) \approx 13.29$
if exchange rate = 5, $q = 5/\text{Log}_{10}(2) \approx 16.61$
if exchange rate = 6, q = 20

APPENDIX

D Communications Troubleshooting

If you are having difficulty establishing communication between your 706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX and computer, this section is provided to help you with a few basic steps to setting up IR communication. This section will help you get your infrared communications working in the shortest amount of time. If you prefer, feel free to call Larson-Davis technical support to help you with the infrared communications. Technical support is also available by e-mail: support@larsondavis.com.

The First Step

The first step in solving problems in IR communications is to establish that the 706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX is operating. If you are using a 706RC-ATEX/706-ATEX, it should be powered on. If you are using a 705+ATEX/705-ATEX/703+ATEX/703-ATEX, the green LED should be blinking. If the units do not power up, install new batteries. The 706-ATEX can be set to automatically power down after a specified time from within the power menu (see page 3-27). To disable this feature, set the **auto off** function on the 706-ATEX to "never".

706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX, and no further adjustments need to be made to the infrared software. If the 706RC-ATEX/706-ATEX/705+ATEX/705-ATEX/703+ATEX/703-ATEX

Still having problems?

If you are still experiencing problems, please contact Larson Davis technical support.

Additional IR Connection Solutions

The following suggestions and procedures will help in resolving most connection problems.

General Information

- Ensure the unit is powered on.
- Install new or freshly charged batteries.
- Ensure that IR interface module is firmly secured to the PC (either to the serial or USB port).
- For optimal data transfer performance, it is recommended that the instrument be placed a distance between one and three feet from the IR interface module.
- Ensure that the IR lens on both the instrument and the IR interface module are clean and not obstructed from each other.
- Ensure that all other Spark® instruments are facing away from the IR interface module.
- Ensure latest version of Blaze® is being used. You can find the version by clicking on Help on the main menu and About Blaze...
- If using in bright or direct sunlight, shade the instrument and IR interface module.
- If instrument and IR interface module are sitting on a reflective surface (i.e. gloss white or stainless steel surface) try moving them to a non-reflective surface.

Direct Serial Connection

Verify that no other programs have control of the COM port that the external IR adapter is using.

The software supplied with the DVX008 should not be installed. If it has already been installed, remove it.

The following message will be displayed when Blaze® cannot communicate with a Spark® unit.

> "A connection could not be established. Make sure your instrument is turned on and pointing at the IR receiver and that the receiver is plugged into the correct Com port"

In this case, try connection the IR adaptor to a different COM port.

Find out what the connection settings are for the Blaze® software.

Step 1 Open the Blaze® software.

Step 2 Click on the "Options" selection near the tool bar at the top of the window and select "Connection".

Step 3 Ensure that the corresponding COM port is being used.

If using the DVX008 IR interface module:

- Verify no other programs have control of the COM port.
- Try using a different COM port, if available. If switching to another COM port, ensure that the COM port number is switched as well, using the Connections Settings dialog box. This can be found by clicking on Options on the main menu, and Connection.

USB Connection

If a direct COM serial port is not available on the computer being used, a Larson Davis DVX008A (with DVX008) or a DVX009 USB-to-IR interface module should be used instead.

- If DVX008A (with DVX008) or DVX009 is being used, try using a different USB port.

Note: If the DVX008A or DVX009 is switched to a different USB port, reconfiguring the port through the Connections Settings dialog box is not necessary.

- Ensure the latest version of Blaze® is being used. The version can be found by clicking on Help in the main menu and About Blaze.
- Try using the IR interface module with an externally powered USB hub.

Blaze® Check for COM Port

The Options menu on the Blaze® toolbar includes Check for virtual port at startup, as shown below.

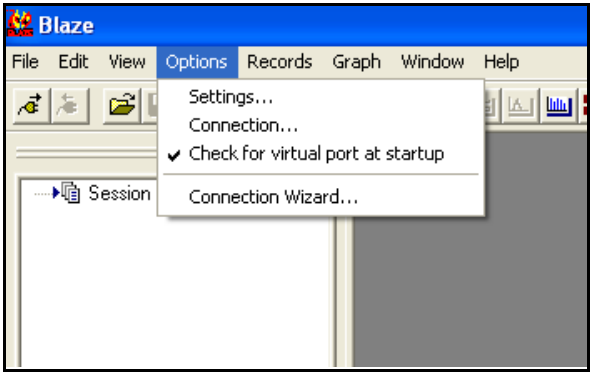

When enabled, Blaze® will always search for a virtual COM port upon startup. To enable this, click on this feature, which will place a checkmark as shown above.

When Blaze® detects a COM port is present and available, it will provide the following message.

DVX009 InfraRed (IR) interface with USB Found
A DVX009 InfraRed (IR) interface with USB has been found on port 9.
Would you like to make this the default port for Spark units?
Yes
No
Do not show this dialog again.

Blaze® Connection Wizard for IR Communications

The Blaze® software contains a Connection Wizard to aid in troubleshooting any possible IR connection problems between Blaze® and a Spark® instrument. This Connection Wizard will start automatically if an instrument is not found on a connection attempt.

To start the Connection Wizard manually for initial setup, click on Options in the main menu and then on Connection Wizard to open the screen shown below.

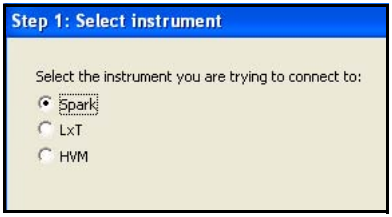

Select Spark and click Next.

Note that the rest of the instructions for the Connection Wizard are the same whether it was started manually or automatically.

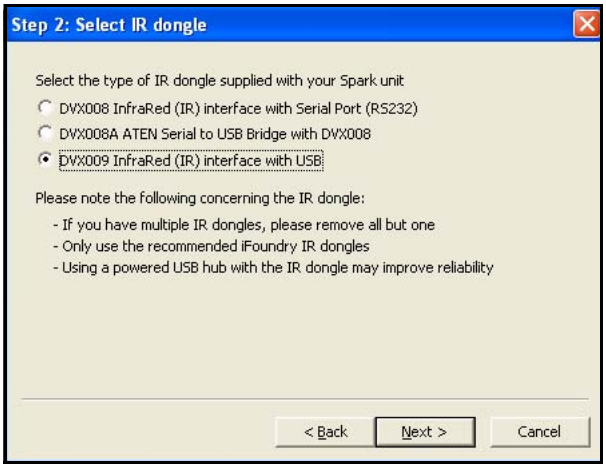
Step 2: Select IR dongle
Select the type of IR dongle supplied with your Spark unit
DVX008 InfraRed (IR) interface with Serial Port (RS232)
DVX008A ATEN Serial to USB Bridge with DVX008
DVX009 InfraRed (IR) interface with USB
Please note the following concerning the IR dongle:
- If you have multiple IR dongles, please remove all but one
- Only use the recommended iFoundry IR dongles
- Using a powered USB hub with the IR dongle may improve reliability
< Back
Next >
Cancel

Select the IR interface module you are using and click Next. If using the DVX008, ensure that it is plugged into the COM port that is being selected here.

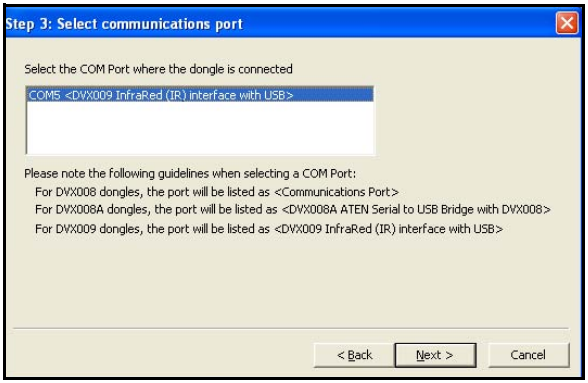

Highlight the port on which the desired IR interface module is connected. Click Next.

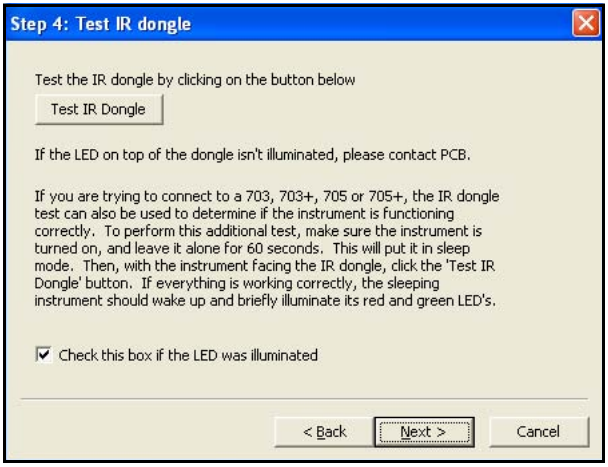

To ensure that the IR interface module is connected correctly to the PC, and to ensure that it is working properly, click on the TEST IR DONGLE button. The LED on the top of the IR dongle should light up. If it does, click Next.

If it does not light up, ensure that the dongle is properly connected to the PC. Try testing with another COM or USB port.

Step 5: Verify IR dongle / instrument placement
Make sure the instrument and IR dongle are positioned as follows:
The instrument and IR dongle should be separated by a distance of 12 inches (30cm). However, if you are still having connection problems, try moving the instrument closer or further away as necessary. Normal operating range is between 3in and 36in (1.5cm to 91cm).
< Back
Next >
Cancel

Place the instrument facing towards the IR interface module, at between 12" and 36" and click Next.

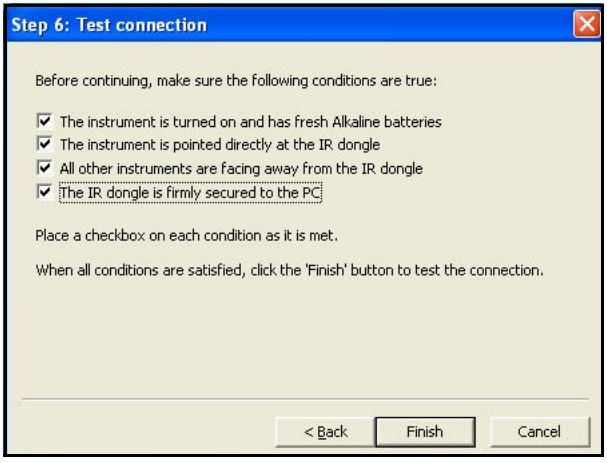
Step 6: Test connection
Before continuing, make sure the following conditions are true:
The instrument is turned on and has fresh Alkaline batteries
The instrument is pointed directly at the IR dongle
All other instruments are facing away from the IR dongle
The IR dongle is firmly secured to the PC
Place a checkbox on each condition as it is met.
When all conditions are satisfied, click the 'Finish' button to test the connection.
< Back
Finish
Cancel

Before finishing, ensure that all of the criterion listed are satisfied and after verifying and checking each, click Finish

If the IR connection is successful, the Blaze® Instrument Manager will be displayed.

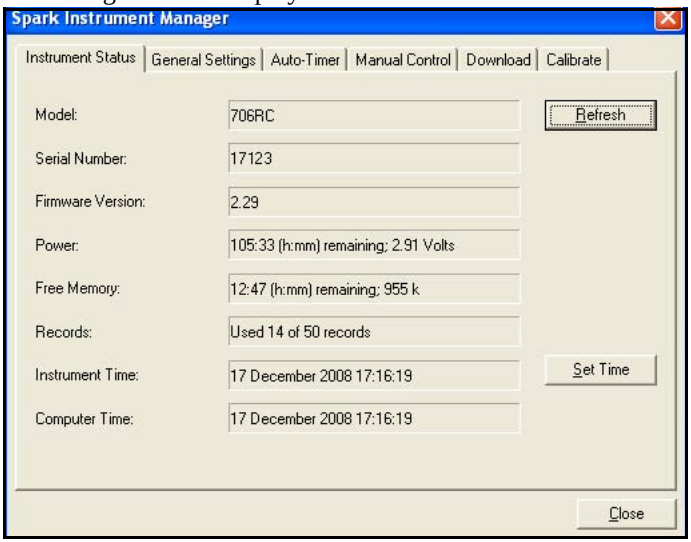

If the connection was not successful, please follow the troubleshooting suggestions listed in the screen below.

laze
A connection with the Spark unit could not be established.
The following suggestions may fix the problem:
1. Make sure the IR cover on both the instrument and IR dongle are clean
2. If using in bright or direct light, shade the instrument and IR dongle
3. If using a DVX008A or DVX009, plug these into a powered USB hub
4. Reboot the instrument by removing its batteries and replacing them
Please contact PCB at 1 716 926 8243 or in USA toll free 888 258 3222 for further assistance.
OK

If none of thee suggestions help, please call Larson Davis Technical Support at (716) 926-8243, or in the US toll free (888) 258-3222.

APPENDIX

E

Sample Reports

Summary Report

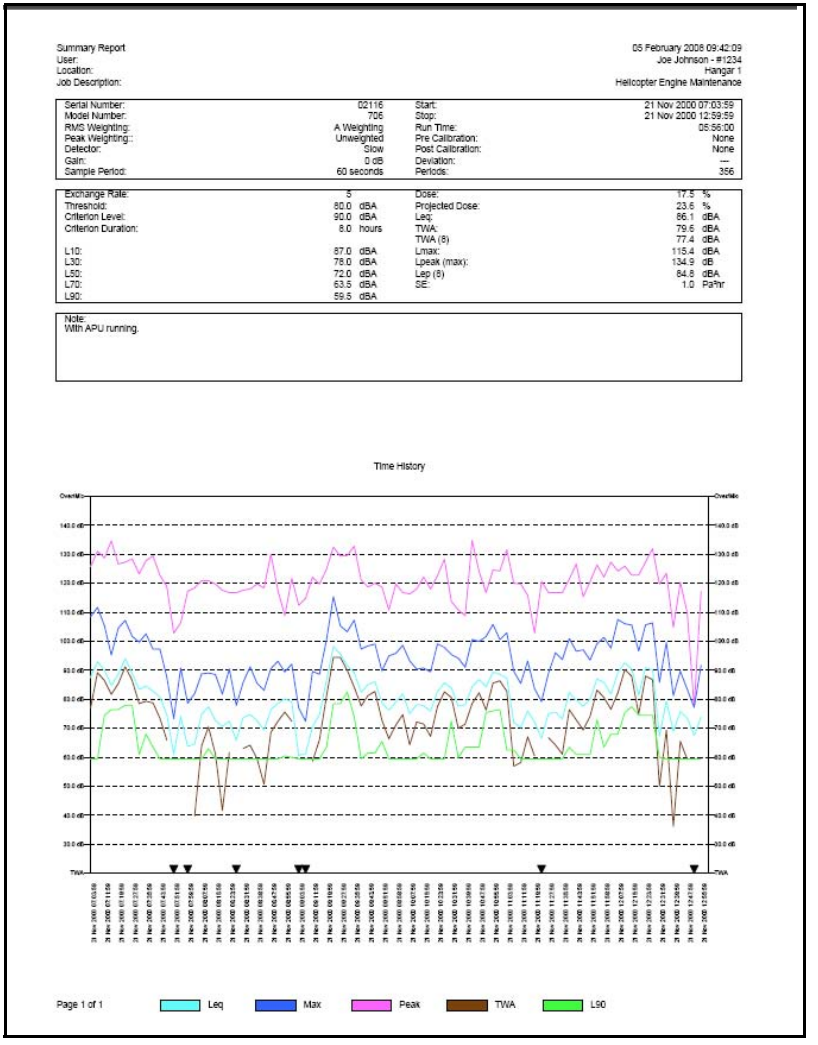

Summary Report
User:
Location:
Job Description:

05 February 2008 09:42:09
Joe Johnson - #1234
Hangar 1
Helicopter Engine Maintenance

Serial Number:	02116	Start:	21 Nov 2000 07:03:59
Model Number:	706	Stop:	21 Nov 2000 12:59:59
RMS Weighting:	A Weighting	Run Time:	05:56:00
Peak Weighting::	Unweighted	Pre Calibration:	None
Detector:	Slow	Post Calibration:	None
Gain:	0 dB	Deviation:	---
Sample Period:	60 seconds	Periods:	356

Exchange Rate:	5		Dose:	17.5	%
Threshold:	80.0	dBA	Projected Dose:	23.6	%
Criterion Level:	90.0	dBA	Leq:	86.1	dBA
Criterion Duration:	8.0	hours	TWA:	79.6	dBA
			TWA (8)	77.4	dBA
L10:	87.0	dBA	Lmax:	115.4	dBA
L30:	78.0	dBA	Lpeak (max):	134.9	dB
L50:	72.0	dBA	Lep (8)	84.8	dBA
L70:	63.5	dBA	SE:	1.0	Pa²hr
L90:	59.5	dBA			

Note:
With APU running.

Time History

Page 1 of 1

Leq Max Peak TWA L90

Time History Report

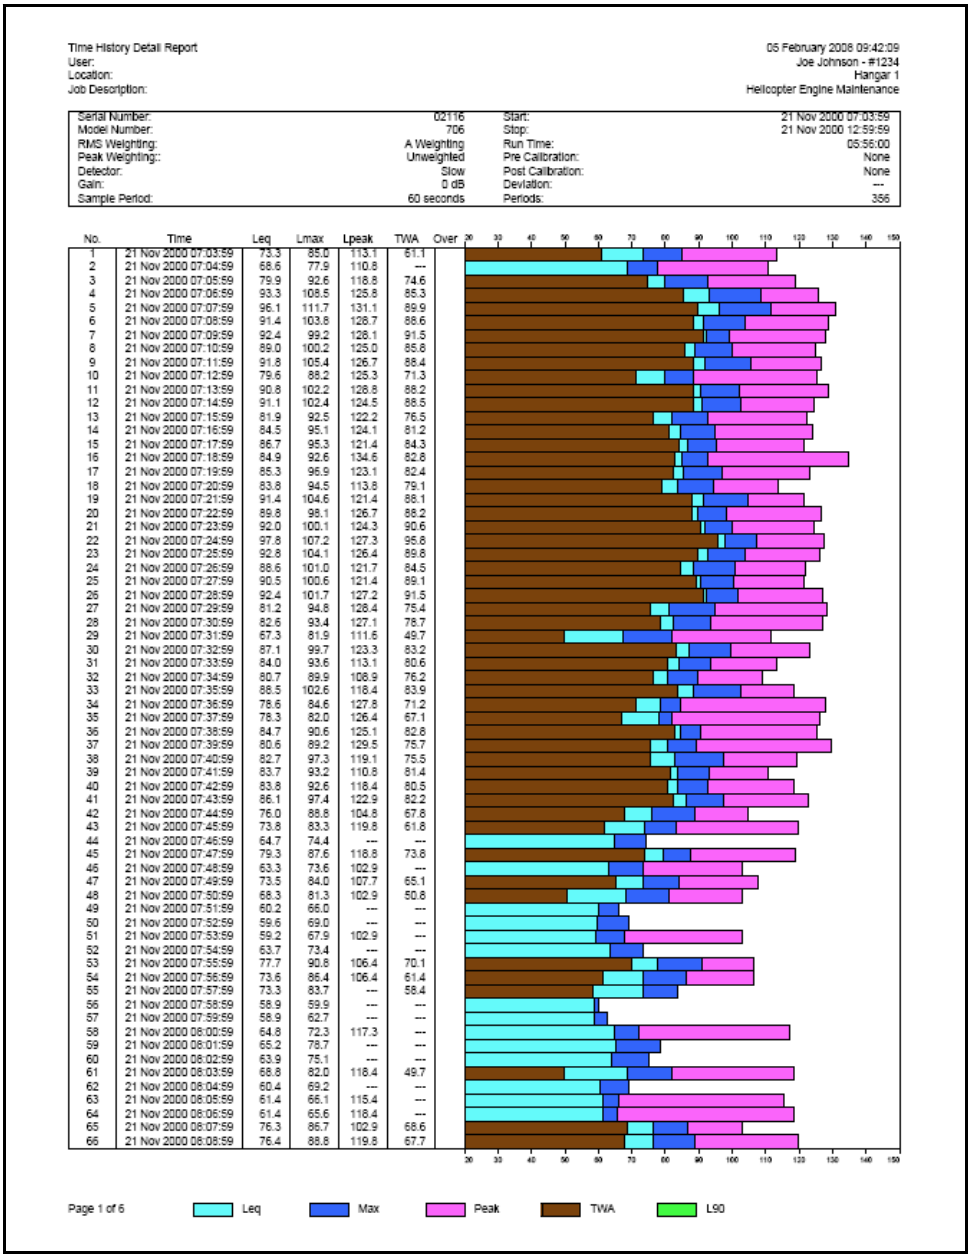

Time History Detail Report
User:
Location:
Job Description:

05 February 2008 09:42:09
Joe Johnson - #1234
Hangar 1
Helicopter Engine Maintenance

Serial Number:	02116	Start:	21 Nov 2000 07:03:59
Model Number:	706	Stop:	21 Nov 2000 12:59:59
RMS Weighting:	A Weighting	Run Time:	05:56:00
Peak Weighting::	Unweighted	Pre Calibration:	None
Detector:	Slow	Post Calibration:	None
Gain:	0 dB	Deviation:	---
Sample Period:	60 seconds	Periods:	356

No.	Time	Leq	Lmax	Lpeak	TWA	Over
1	21 Nov 2000 07:03:59	73.3	85.0	113.1	51.1	
2	21 Nov 2000 07:04:59	68.6	77.9	110.8	---	
3	21 Nov 2000 07:05:59	79.9	92.6	116.8	74.6	
4	21 Nov 2000 07:06:59	93.3	108.5	125.8	85.3	
5	21 Nov 2000 07:07:59	96.1	111.7	131.1	89.9	
6	21 Nov 2000 07:08:59	91.4	103.8	126.7	88.6	
7	21 Nov 2000 07:09:59	92.4	99.2	126.1	91.5	
8	21 Nov 2000 07:10:59	89.0	100.2	125.0	85.8	
9	21 Nov 2000 07:11:59	91.8	105.4	126.7	88.4	
10	21 Nov 2000 07:12:59	79.6	88.2	125.3	71.3	
11	21 Nov 2000 07:13:59	90.8	102.2	126.8	88.2	
12	21 Nov 2000 07:14:59	91.1	102.4	124.5	88.5	
13	21 Nov 2000 07:15:59	81.9	92.5	122.2	76.5	
14	21 Nov 2000 07:16:59	84.5	95.1	124.1	81.2	
15	21 Nov 2000 07:17:59	86.7	95.3	121.4	84.3	
16	21 Nov 2000 07:18:59	84.9	92.6	134.6	82.6	
17	21 Nov 2000 07:19:59	85.3	96.9	123.1	82.4	
18	21 Nov 2000 07:20:59	83.8	94.5	113.8	79.1	
19	21 Nov 2000 07:21:59	91.4	104.6	121.4	88.1	
20	21 Nov 2000 07:22:59	89.8	98.1	126.7	88.2	
21	21 Nov 2000 07:23:59	92.0	100.1	124.3	90.6	
22	21 Nov 2000 07:24:59	97.8	107.2	127.3	95.6	
23	21 Nov 2000 07:25:59	92.8	104.1	126.4	89.8	
24	21 Nov 2000 07:26:59	86.6	101.0	121.7	84.5	
25	21 Nov 2000 07:27:59	90.5	100.6	121.4	89.1	
26	21 Nov 2000 07:28:59	92.4	101.7	127.2	91.5	
27	21 Nov 2000 07:29:59	81.2	94.8	126.4	75.4	
28	21 Nov 2000 07:30:59	82.6	93.4	127.1	78.7	
29	21 Nov 2000 07:31:59	67.3	81.9	111.6	49.7	
30	21 Nov 2000 07:32:59	87.1	99.7	123.3	83.2	
31	21 Nov 2000 07:33:59	84.0	93.6	113.1	80.6	
32	21 Nov 2000 07:34:59	80.7	89.9	108.9	76.2	
33	21 Nov 2000 07:35:59	88.5	102.6	116.4	83.9	
34	21 Nov 2000 07:36:59	78.6	84.6	127.8	71.2	
35	21 Nov 2000 07:37:59	78.3	82.0	126.4	67.1	
36	21 Nov 2000 07:38:59	84.7	90.6	125.1	82.8	
37	21 Nov 2000 07:39:59	80.6	89.2	129.5	75.7	
38	21 Nov 2000 07:40:59	82.7	97.3	119.1	75.5	
39	21 Nov 2000 07:41:59	83.7	93.2	110.8	81.4	
40	21 Nov 2000 07:42:59	83.8	92.6	116.4	80.5	
41	21 Nov 2000 07:43:59	86.1	97.4	122.9	82.2	
42	21 Nov 2000 07:44:59	76.0	88.8	104.8	67.6	
43	21 Nov 2000 07:45:59	73.8	83.3	119.8	61.8	
44	21 Nov 2000 07:46:59	64.7	74.4	---	---	
45	21 Nov 2000 07:47:59	79.3	87.6	116.8	73.6	
46	21 Nov 2000 07:48:59	63.3	73.6	102.9	---	
47	21 Nov 2000 07:49:59	73.5	84.0	107.7	65.1	
48	21 Nov 2000 07:50:59	68.3	81.3	102.9	50.6	
49	21 Nov 2000 07:51:59	60.2	66.0	---	---	
50	21 Nov 2000 07:52:59	59.6	69.0	---	---	
51	21 Nov 2000 07:53:59	59.2	67.9	102.9	---	
52	21 Nov 2000 07:54:59	63.7	73.4	---	---	
53	21 Nov 2000 07:55:59	77.7	90.8	106.4	70.1	
54	21 Nov 2000 07:56:59	73.6	86.4	106.4	61.4	
55	21 Nov 2000 07:57:59	73.3	83.7	---	58.4	
56	21 Nov 2000 07:58:59	58.9	59.9	---	---	
57	21 Nov 2000 07:59:59	58.9	62.7	---	---	
58	21 Nov 2000 08:00:59	64.8	72.3	117.3	---	
59	21 Nov 2000 08:01:59	65.2	78.7	---	---	
60	21 Nov 2000 08:02:59	63.9	75.1	---	---	
61	21 Nov 2000 08:03:59	68.8	82.0	116.4	49.7	
62	21 Nov 2000 08:04:59	60.4	69.2	---	---	
63	21 Nov 2000 08:05:59	61.4	66.1	115.4	---	
64	21 Nov 2000 08:06:59	61.4	65.6	116.4	---	
65	21 Nov 2000 08:07:59	76.3	86.7	102.9	68.6	
66	21 Nov 2000 08:08:59	76.4	88.8	119.8	67.7	

Page 1 of 6

Leq Max Peak TWA L90

Statistics Report

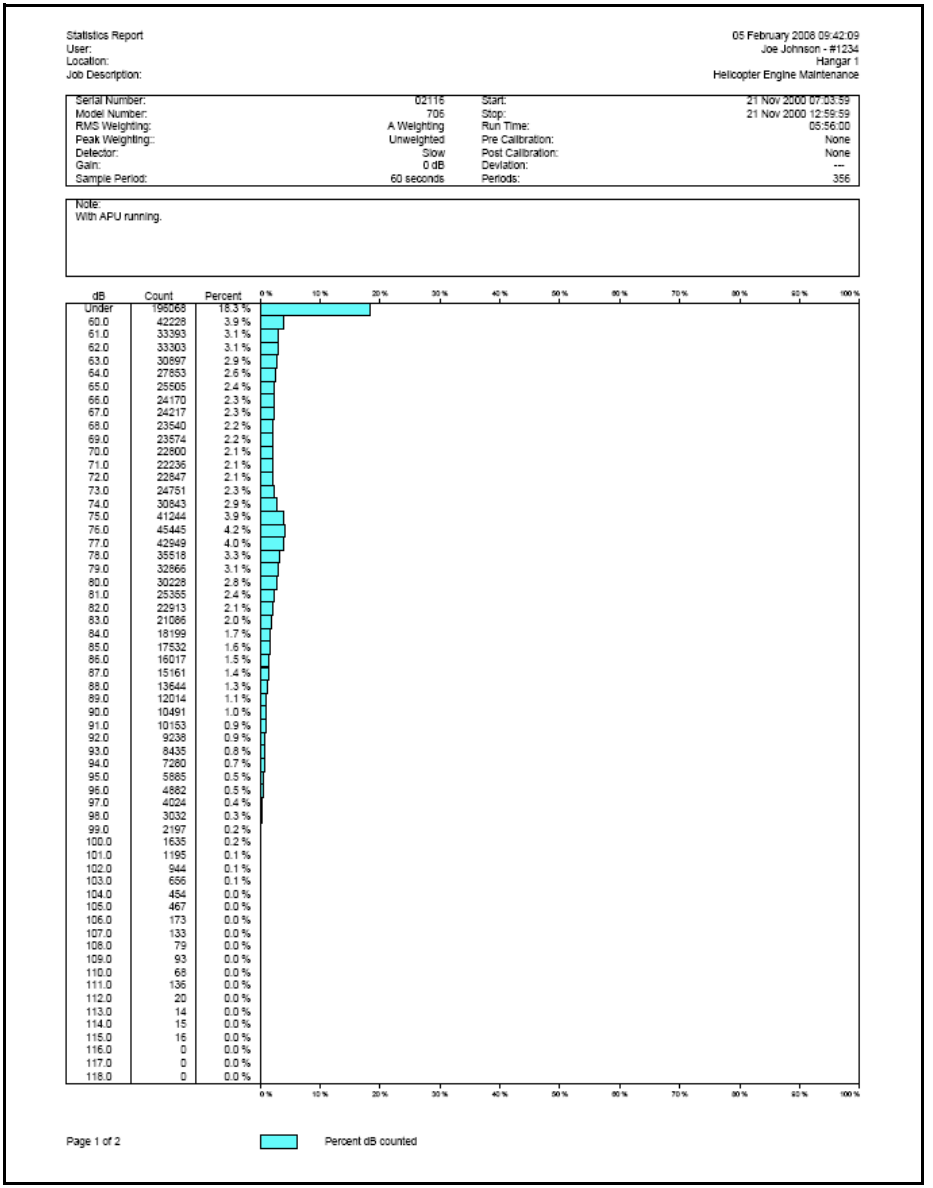

Statistics Report
05 February 2008 09:42:09
User: Joe Johnson - #1234
Location: Hangar 1
Job Description: Helicopter Engine Maintenance

Serial Number:	02116	Start:	21 Nov 2000 07:03:59
Model Number:	706	Stop:	21 Nov 2000 12:59:59
RMS Weighting:	A Weighting	Run Time:	05:56:00
Peak Weighting::	Unweighted	Pre Calibration:	None
Detector:	Slow	Post Calibration:	None
Gain:	0 dB	Deviation:	---
Sample Period:	60 seconds	Periods:	356

Note:
With APU running.

dB	Count	Percent
Under	196068	18.3 %
60.0	42228	3.9 %
61.0	33393	3.1 %
62.0	33303	3.1 %
63.0	30897	2.9 %
64.0	27853	2.6 %
65.0	25505	2.4 %
66.0	24170	2.3 %
67.0	24217	2.3 %
68.0	23540	2.2 %
69.0	23574	2.2 %
70.0	22800	2.1 %
71.0	22236	2.1 %
72.0	22847	2.1 %
73.0	24751	2.3 %
74.0	30843	2.9 %
75.0	41244	3.9 %
76.0	45445	4.2 %
77.0	42949	4.0 %
78.0	35518	3.3 %
79.0	32866	3.1 %
80.0	30228	2.8 %
81.0	25355	2.4 %
82.0	22913	2.1 %
83.0	21086	2.0 %
84.0	18199	1.7 %
85.0	17532	1.6 %
86.0	16017	1.5 %
87.0	15161	1.4 %
88.0	13644	1.3 %
89.0	12014	1.1 %
90.0	10491	1.0 %
91.0	10153	0.9 %
92.0	9238	0.9 %
93.0	8435	0.8 %
94.0	7280	0.7 %
95.0	5885	0.5 %
96.0	4882	0.5 %
97.0	4024	0.4 %
98.0	3032	0.3 %
99.0	2197	0.2 %
100.0	1635	0.2 %
101.0	1195	0.1 %
102.0	944	0.1 %
103.0	656	0.1 %
104.0	454	0.0 %
105.0	467	0.0 %
106.0	173	0.0 %
107.0	133	0.0 %
108.0	79	0.0 %
109.0	93	0.0 %
110.0	68	0.0 %
111.0	136	0.0 %
112.0	20	0.0 %
113.0	14	0.0 %
114.0	15	0.0 %
115.0	16	0.0 %
116.0	0	0.0 %
117.0	0	0.0 %
118.0	0	0.0 %

0 % 10 % 20 % 30 % 40 % 50 % 60 % 70 % 80 % 90 % 100 %

Page 1 of 2

Percent dB counted

Measurement Record
Summary Report

General Information		
Serial Number	02116	
Model	706	
User	Joe Johnson - #1234	
Job Description	Helicopter Engine Maintenance	
Location	Hangar 1	
Start Time	Tuesday, 21 November 2000 07:03:59	
Stop Time	Tuesday, 21 November 2000 12:59:59	
Run Time	05:56:00	
Pre Calibration	None	
Post Calibration	None	
Calibration Deviation	---	
Sample Interval	60 Sec.	

Note
With APU running.

Results	Dose 1	
Dose:	17.5	%
Projected Dose:	23.6	%
Leq:	86.1	dBA
TWA:	79.6	dBA
TWA (8)	77.4	dBA
Lmax:	115.4	dBA
Lpeak (max):	134.9	dB
Lmin:	51.2	dBA
Lep (8)	84.8	dBA
SE:	1.0	Pa²hr
Overload?	No	

Statistics		
L10	87.0	dBA
L30	78.0	dBA
L50	72.0	dBA
L70	63.5	dBA
L90	59.5	dBA

Settings		
Exchange Rate:	5	
Threshold:	80	dBA
Criterion Level:	90	dBA
Criterion Duration:	8	hours
RMS Weight:	A Weighting	
Peak Weight:	Unweighted	
Detector:	Slow	
Gain:	0	dB

Time History Graph Printout

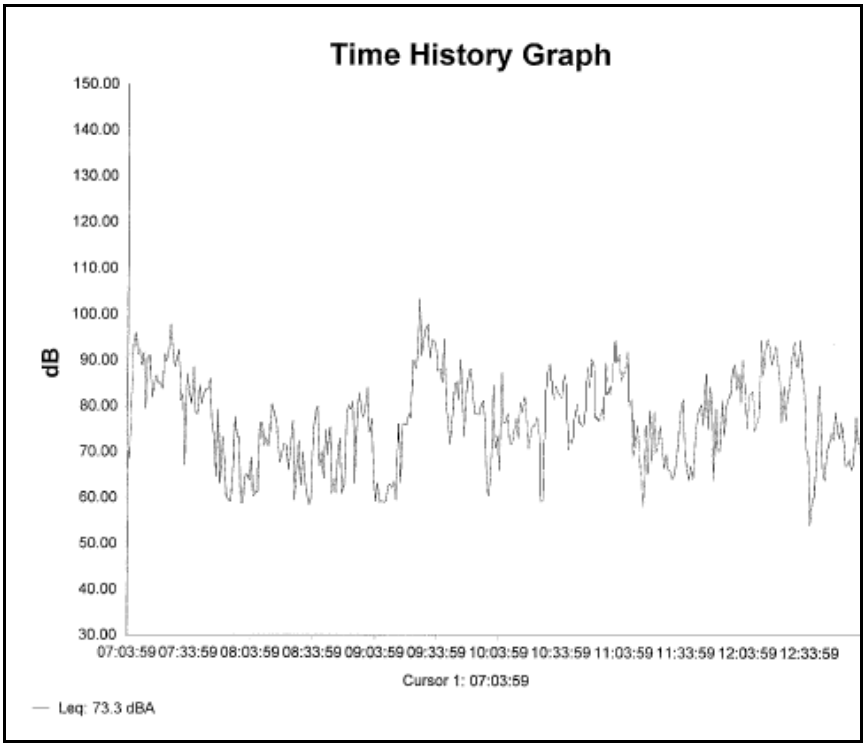

Statistics Graph Printout

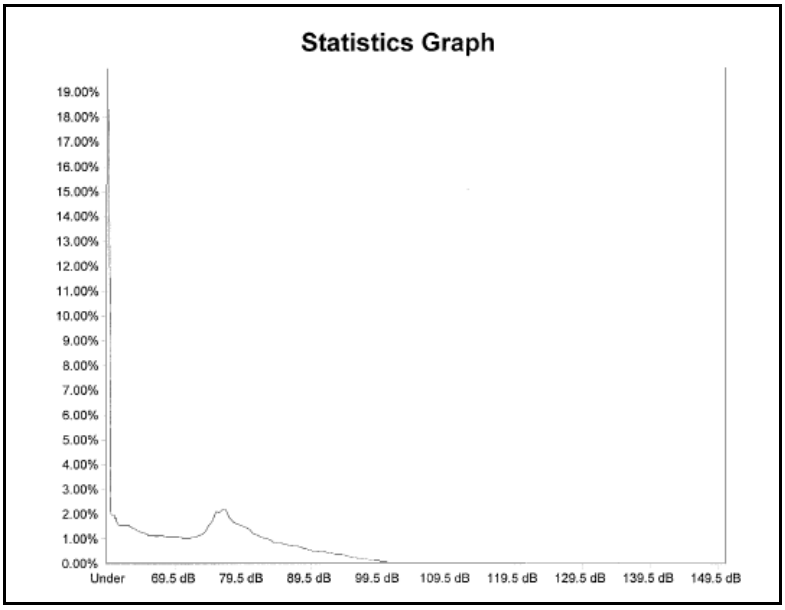

APPENDIX

F

ATEX Intrinsic Safety Approvals

This appendix presents details of the Spark®-ATEX instrument instrinsic safe approvals

Classification	Applicable Standards
Group II Category 2G Sub-Group IIB Ɛx II 2G EEx ib IIB T4 Ambient Temperature –10 to 40 °C	EN 60079-0:2004 EN 50020:2002

NOTES:
Group II: Non-Mining
Category 2G: Non-mining, explosive air/gas mixture is likely to occur
ib: Intrinsically safe with 1 countable fault and all non-countable faults
Group IIB: Ethylene
Maximum surface temperature produced under fault conditions at an ambient temperature of 40ºC
T4: 135ºC

Intertek Intrinsic Safety Approval: ITS 05 ATEX 25065X

Warning! For safe operation, Do not replace batteries in an explosive atmosphere.

To comply with the intrinsic safety rating of this instrument, one of the following battery types must be used when this instrument is operated in an explosive environment.

o Duracell MN1500 AA Alkaline

o Eveready Energizer E91 AA Alkaline

Warning! To reduce the risk of explosion do not mix old batteries with new batteries, or mix batteries from different manufacturers.

NOTE: The 703-ATEX, 703+ATEX, 704-ATEX, 706-ATEX and the 706RC-ATEX must remain in the protective case during service. The user should replace the protective pouch when it shows signs of deterioration.

Back Panel Labels

This section presents the intrinsic safe labels which appear on the back of the different instruments of the Spark®-ATEX family.

Note that the year of manufacture is provided in the year code, which is part of the serial number, as indicated in the following figures.

703-ATEX, 703+ATEX, 704-ATEX, 706-ATEX, 706RC-ATEX

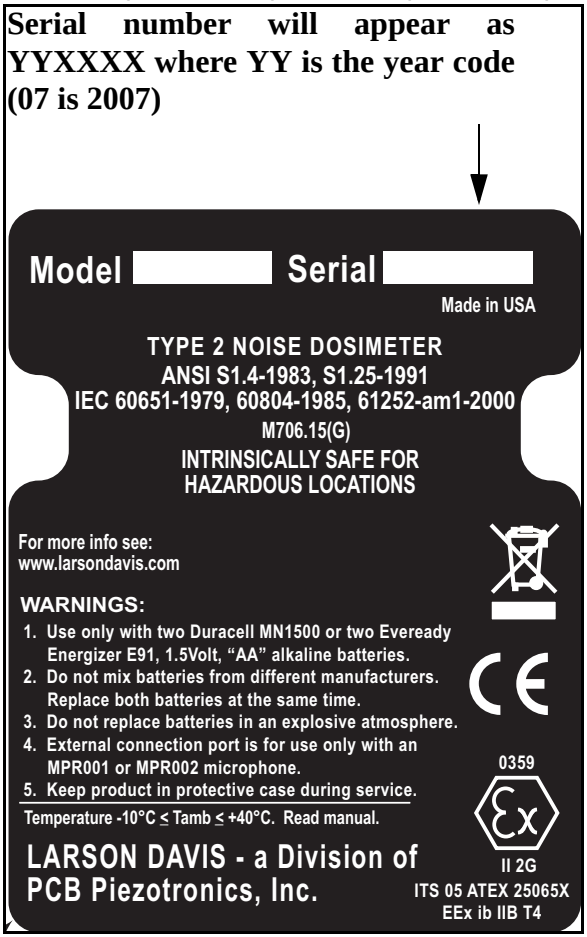
Serial number will appear as YYXXXX where YY is the year code (07 is 2007)
Model
Serial
Made in USA
TYPE 2 NOISE DOSIMETER
ANSI S1.4-1983, S1.25-1991
IEC 60651-1979, 60804-1985, 61252-am1-2000
M706.15(G)
INTRINSICALLY SAFE FOR HAZARDOUS LOCATIONS
For more info see:
www.larsondavis.com
WARNINGS:
1. Use only with two Duracell MN1500 or two Eveready Energizer E91, 1.5Volt, "AA" alkaline batteries.
2. Do not mix batteries from different manufacturers. Replace both batteries at the same time.
3. Do not replace batteries in an explosive atmosphere.
4. External connection port is for use only with an MPR001 or MPR002 microphone.
5. Keep product in protective case during service.
Temperature -10°C ≤ Tamb ≤ +40°C. Read manual.
0359
II 2G
ITS 05 ATEX 25065X
EEx ib IIB T4
LARSON DAVIS - a Division of PCB Piezotronics, Inc.

705-ATEX

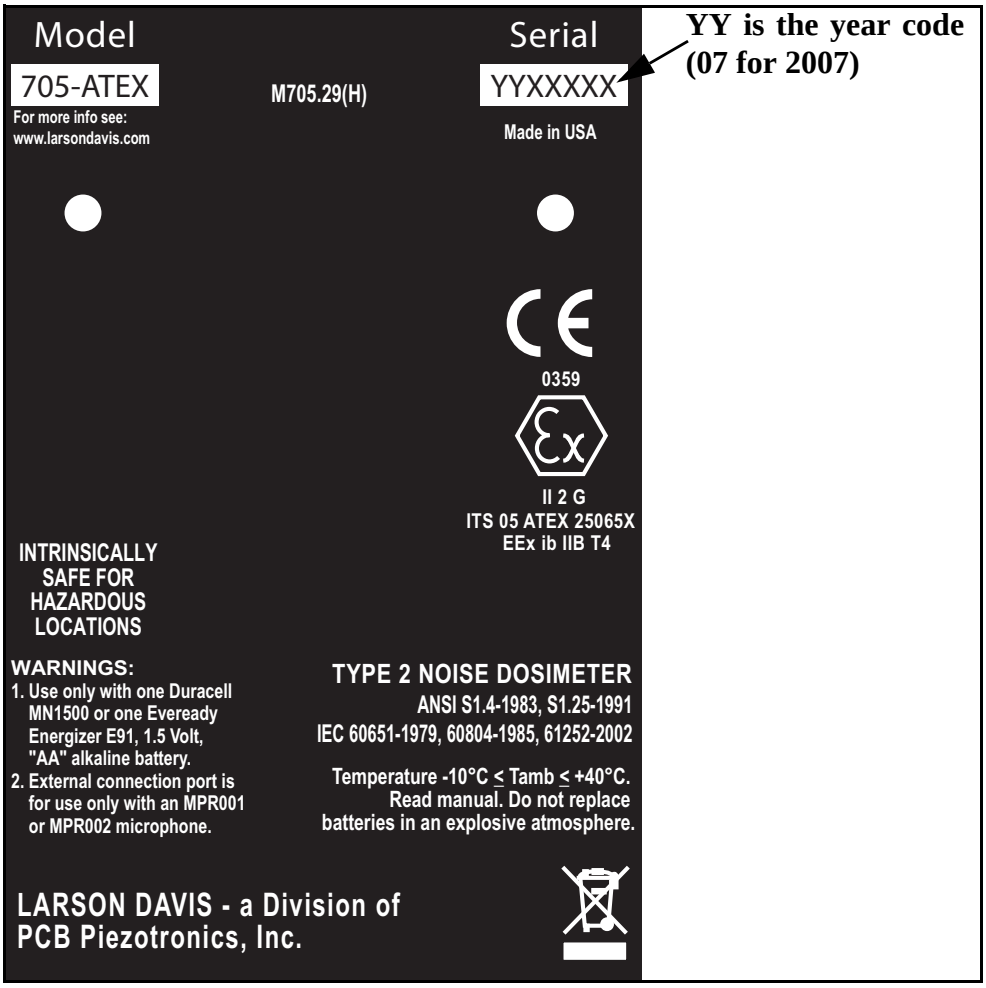
Model
705-ATEX
For more info see:
www.larsondavis.com
M705.29(H)
Serial
YYXXXXX
Made in USA
YY is the year code
(07 for 2007)
0359
II 2 G
ITS 05 ATEX 25065X
EEx ib IIB T4
INTRINSICALLY
SAFE FOR
HAZARDOUS
LOCATIONS
WARNINGS:
1. Use only with one Duracell
MN1500 or one Eveready
Energizer E91, 1.5 Volt,
"AA" alkaline battery.
2. External connection port is
for use only with an MPR001
or MPR002 microphone.
TYPE 2 NOISE DOSIMETER
ANSI S1.4-1983, S1.25-1991
IEC 60651-1979, 60804-1985, 61252-2002
Temperature -10°C ≤ Tamb ≤ +40°C.
Read manual. Do not replace
batteries in an explosive atmosphere.
LARSON DAVIS - a Division of
PCB Piezotronics, Inc.

705+ATEX

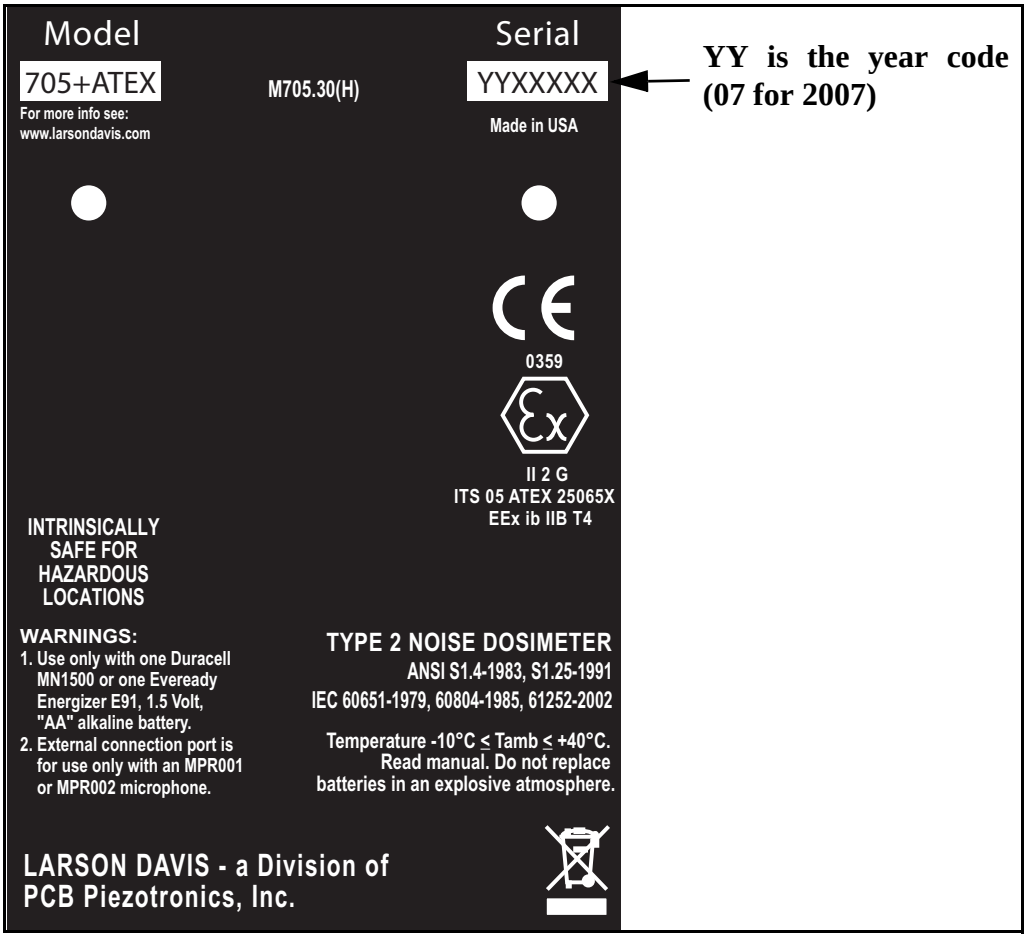
Model
705+ATEX
For more info see:
www.larsondavis.com
M705.30(H)
Serial
YYXXXXX
Made in USA
YY is the year code (07 for 2007)
0359
II 2 G
ITS 05 ATEX 25065X
EEx ib IIB T4
INTRINSICALLY SAFE FOR HAZARDOUS LOCATIONS
WARNINGS:
1. Use only with one Duracell MN1500 or one Eveready Energizer E91, 1.5 Volt, "AA" alkaline battery.
2. External connection port is for use only with an MPR001 or MPR002 microphone.
TYPE 2 NOISE DOSIMETER
ANSI S1.4-1983, S1.25-1991
IEC 60651-1979, 60804-1985, 61252-2002
Temperature -10°C ≤ Tamb ≤ +40°C.
Read manual. Do not replace batteries in an explosive atmosphere.
LARSON DAVIS - a Division of
PCB Piezotronics, Inc.

Index

Numerics

706/703 data records 2-44
706/703 instrument settings 2-35
706/703 timer 2-30
706/703 timer modes 2-31
706-ATEX - changing the detector 3-22
706-ATEX - changing the dose settings 3-24
706-ATEX - changing the frequency weighting 3-20
706-ATEX - changing the gain 3-19
706-ATEX - changing the Peak weighting 3-21
706-ATEX - clearing the memory 3-28
706-ATEX - manual setup 3-19
706-ATEX about screen 3-29
706-ATEX accessories 1-11
706-ATEX auto-off 3-31
706-ATEX backlight save 3-34
706-ATEX backlight settings 3-33
706-ATEX calibration 3-11
706-ATEX- changing the time history period 3-23
706-ATEX display contrast 3-33
706-ATEX display settings 3-33
706-ATEX dose 3-6
706-ATEX icon descriptions 3-3
706-ATEX memory 3-27
706-ATEX memory free 3-28
706-ATEX memory used 3-27
706-ATEX power menu 3-30
706-ATEX schematic 1-10
706-ATEX tools 3-9
706-ATEX/703-ATEX Features 1-3
706RC-ATEX 4-1
706RC-ATEX Operation 4-1

A

about screen 3-29
adding data to the time history 2-73
Assembly 1-12
Auto-off 3-31
Auto-timer 2-30

B

battery installation 1-14
Blaze - live display 2-37
Blaze - manual instrument control 2-35
Blaze - printing reports 2-95
Blaze - resetting the 706/703 2-40
Blaze - viewing records 2-50
Blaze dose field 2-20
Blaze general settings 2-16
Blaze installation 1-21
Blaze modified results 2-48
Blaze results summary 2-47
Blaze Session Log 2-26
Blaze setting the 706 lock 2-40
Blaze statistics graph 2-85
Blaze summaery window 2-46
block timer 2-32

C

CAL 150 3-11
CAL 200 3-11
calibration - 706-ATEX manual 3-11
calibration history 2-14
calibrators 2-11
CCS008 protective case 1-14
Clear all memory 3-28
clock - setting with Blaze 2-8
connecting the microphone 1-13
Contrast 3-34
criterion duration 2-26
criterion level 2-26

D

data downloading 2-43
data export 2-102
data records 2-44
date - setting with Blaze 2-8,2-9
detector - manual change in the 706-ATEX 3-22
Disconnecting from Blaze 2-7
dose 2-25
dose recalculation 2-52
dose settings - changing in the 706-ATEX 3-24
downloading the 706/703 to Blaze 2-43

DVX008 external IrDA 1-19

E

edit include 2-75
editing the time history 2-68
exchange rate 2-25
exclude all 2-73
exporting data 2-102
exporting data to another application 2-103

F

frequency weighting - manual changing in the 706-ATEX 3-20

G

gain 2-25
gain - manual gain selection of the 706-ATEX 3-19
general information window 2-52

I

Instrument Manager 2-7
instrument settings 2-35
Internal IR 1-19
Intrinsic Safety
    Approvals F-1
    ATEX Labels F-2
Inversion Mode 4-3
IR connection 1-19,2-6

K

keypad lock 2-40

L

launch viewer 2-104
Leq 3-5
live display 2-37
Lmax 3-5
Lmin 3-5
Ln table 2-44
Lock - manual deactiviation of the lock 3-15
Lock - manual locking of the 706-ATEX 3-14
lock function 2-40

M

manual calibration of the 706-ATEX 3-11
manual control using Blaze 2-35
measurement summary 2-47
memory free 3-28
memory retention 1-21
memory time 3-27
memory used 3-27
Merging Records 2-56
microphone clip 1-12
microphone preamplifier 1-12
modified data report 2-96
modified results 2-48
Modifying the Time History Interval 2-59

O

once daily timer 2-34
OSHA guidelines 2-17
overloads 3-4

P

peak weighting 2-24
Peak weighting - manual change in the 706-ATEX 3-21
Power menu - 706-ATEX 3-30
Printing - modified data report 2-96
printing - statistics report 2-96
Printing - time history detail report 2-96
printing reports 2-95
printing windows 2-100

R

recalculating the dose 2-52
rechargeable batteries 1-18
Referance Line 2-55
Reference Line 2-69
Remote Control Operation 4-1
Repeat Once Daily Timer 2-34
Repeat Twice Daily Timer 2-34
report - modified data 2-96
report - summary 2-96
report - time history detail 2-96
reports - statistics 2-96
reset key 3-2

resetting the 706/703 using Blaze 2-40
results summary 2-47
rms detector 2-24
rms weighting 2-24

S

saving settings in Blaze 2-30
Screen Contrast 3-34
SE 3-5
selecting data records 2-50
set timer 2-35
Spark data records 2-44
Spark-ATEX - user interface 3-1
Spark-ATEX keypad 3-2
statistics graph 2-85
statistics graph zoom 2-87
statistics report 2-96
statistics table 2-44
subtracting data from the time history 2-73
summary report 2-95
summary window 2-46

T

threshold level 2-26
time history data exclusion 2-68
time history detail report 2-96
time history edit restore 2-76
time history editing 2-68
time history graph 2-62
Time History Interval 2-59
time history interval 2-24
time history period - changing in the 706-ATEX 3-23
time history zoom 2-65
timer - block mode 2-32
timer - once daily 2-34
timer - twice daily 2-34
timer modes 2-31
tools key 3-2
twice daily timer 2-34

U

unlocking the 706 2-41
unzooming the statistics graph 2-89

unzooming the time history 2-68
User Defined Limit Line 2-69
User Defined Limit line 2-55

V

viewing data records 2-50

W

windscreen 1-12

Y

Year Code F-2
Year of Manufacture F-2

Z

zoom - statistics graph 2-87
zoom out - statistics graph 2-89
zoom out - time history graph 2-68
zooming the time history 2-65

Total Customer Satisfaction Guaranteed
3425 Walden Avenue, Depew NY USA 14043
Phone: 716-926-8243 Toll Free: 888-258-3222
LarsonDavis.com FAX: 716-926-8215